Spill Notification for WRR Environmental Services Co., Inc.

EPA ID# WID990829475 FID# 618026530 WI SPILL# 15057

ID 20200310WC18-1 – Hazardous waste from solvent recovery process

Per Condition 86 of WRR Environmental Services' current Feasibility and Plan of Operations Report (FPOR), WRR is making the following spill report to the Department's designated Hazardous Waste Inspector assigned to WRR, to the Department's designated Hazardous Waste plan review staff person assigned to WRR and to the Department's designated Spills Coordinator.

This notification, required by Condition 86 of the WRR FPOR and NR 706.05(1), contains the following information to the extent practicable or applicable:

1. Name, address, and telephone number of the person reporting the discharge.

Becky Anderson – Director of Compliance WRR Environmental Services Co., Inc. 5200 Ryder Road Eau Claire WI 54701

2. Name, address, and telephone number of the discharger, or owner and operator of the UST system and any other potentially responsible persons.

WRR Environmental Services Co., Inc. 5200 Ryder Road Eau Claire WI 54701

3. Date, time, and duration of the discharge.

March 10, 2020 at 4:00 am. Time to clean up the release was 1.0 hour.

Location of the discharge including street address, county, town, city or village

WRR Environmental Services Co., Inc. 5200 Ryder Road Eau Claire WI 54701

Town of Washington

- 4. Identity, physical state, and quantity of the material discharged.
 - ~20 gallons of a residue from a solvent recovery operation.

Spill Notification for WRR Environmental Services Co - Residue Tanker Overfilled 03102020

5. Physical, chemical, hazardous, and toxicological characteristics of the substance.

This residue is a hazardous waste due to flammability.

6. Cause of the discharge.

It was initially thought the release was due to a valve failure that allowed residue to be leaked to a residue tanker as well as a tank. While investigating the release, it was discovered that a valve to the residue tanker was partially open. In interviewing the operators in the area, it was found that an operator had assisted another in adding a tote of material to the residue tanker earlier in the evening. The operator then did not completely close the valve to the residue tanker before returning to the solvent recovery operation. This partially open valve caused the tanker to overfill, releasing material to the concrete pad.

7. Immediate actions being taken and the name of the contractor or other person performing the action.

Area operations were shut down so no more material was allowed to be added to the residue tanker.

Spill material that collected in the concrete pad containment was pumped out and added to waste fuel. Clean up was completed with floor-dri and pads. The absorbents were placed in open top drums for disposal.

All clean up activities were conducted by WRR personnel.

8. Source, speed of movement, and destination or probable destination of the discharged hazardous substance.

The release was contained on a concrete pad with a containment sump. The release was contained and didn't leave the concrete pad. No material impacted soil or contaminated the WRR stormwater collection area.

Included with this report is a facility map with the release location marked with a red arrow.

9. Actual or potential impacts to human health or the environment, including actual or potential impacts to drinking water supplies.


No drinking water supplies were impacted by the spill. Air emissions from the spill were calculated to be less than 0.5 lb based on the weather conditions at the time of the release and cleanup activities.

10. Weather conditions existing at the scene, including presence of precipitation and wind direction and velocity.

It was 24 F at time of the release and clean up activities. There was no precipitation. The weather was cloudy with calm winds.

11. Other agencies on-scene during the discharge incident.

No agencies were on-site during the discharge or clean-up.

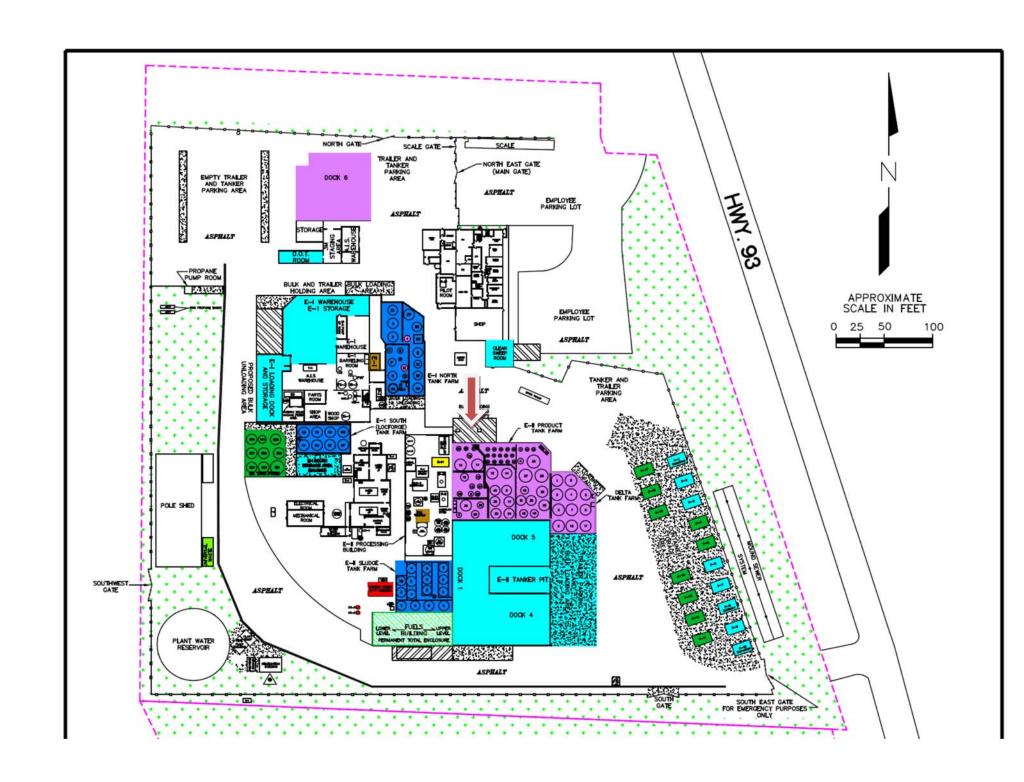



20200310WC18-1 WRR Environmental Services





Legend

- Open Site
- Closed Site
- Continuing Obligations Apply

0.2 Miles 1: 7,920

NAD_1983_HARN_Wisconsin_TM

DISCLAIMER: The information shown on these maps has been obtained from various sources, and are of varying age, reliability and resolution. These maps are not intended to be used for navigation, nor are these maps an authoritative source of information about legal land ownership or public access. No warranty, expressed or implied, is made aregarding accuracy, applicability for a particular use, completemenss, or legality of the information depicted on this map. For more information, see the DNR Legal Notices web page: http://dnr.wi.gov/org/legal/

Note: Not all sites are mapped.

Notes

Hazardous Solvent Eau Claire Eau Claire Co.