environmental services, inc.

April 18, 2014

Mr. James R. King
Vice President
Environmental Risk Manager
Fifth Third Bank
222 South Riverside Plaza
Chicago, Illinois 60606

Re: Phase II Limited Subsurface Investigation

Location: 3122 14th Avenue; C14-023-0128-01-1
3122 14th Avenue
Kenosha, Wisconsin

Project #: 14022-0214CO#1

Dear Mr. King:

The following report presents the methods and results of the Limited Subsurface Investigation performed by EPS Environmental Services, Inc. (EPS Environmental) at the above referenced location (the Property). The report includes field observations and laboratory results of samples collected during the course of the investigation.

As always, EPS Environmental appreciates the opportunity to have been of service. Should you have any questions regarding this report or should your future needs require our services, please do not hesitate to call.

Sincerely,

Nicholas J. Cuzzone, P.E.
Senior Project Engineer

enclosures

7237 West Devon Avenue • Chicago, Illinois 60631
(773) 792-3090 Fax (773) 792-3091

environmental services, inc.

PHASE II LIMITED SUBSURFACE INVESTIGATION

3122 14th Avenue; C14-023-0128-01-1
3122 14th Avenue
Kenosha, Wisconsin

Prepared For:

Fifth Third Bank
222 South Riverside Plaza
Chicago, Illinois 60606

Prepared By:

EPS Environmental Services, Inc.
7237 West Devon Avenue
Chicago, Illinois 60631

Nicholas J. Cuzzone, P.E.
Senior Project Engineer

NICHOLAS J. CUZZONE
062-050060
LICENSED PROFESSIONAL ENGINEER OF ILLINOIS

Reviewed By:

Peter N. Partipilo, CHMM
Senior Environmental Specialist

Project Number:

14022-0214CO#1

April 18, 2014

TABLE OF CONTENTS

1.0 GENERAL 1

1.1 Authorization 1
1.2 Background 1
1.3 Purpose 1

2.0 SAMPLING PROCEDURE 2

2.1 Field Activities 2
2.2 Field Observations 3

3.0 PHYSICAL SETTING 3

3.1 Topography 3
3.2 Soils 4
3.3 Geologic Profile 4

4.0 LABORATORY ANALYSES 4

4.1 Analytical Program 4
4.2 Evaluation of Analytical Results 4
4.3 Analytical Results 4

5.0 CONCLUSIONS 5

6.0 WARRANTY AND LIMITATION OF LIABILITY 6

6.1 Confidentiality 7
6.2 Reliance on Phase II Limited Subsurface Investigation and Report 7

FIGURE

Figure 1 - Boring and Monitoring Well Location Map

APPENDICES

Appendix A - Geologic Boring Logs
Appendix B - Laboratory Report and Chain of Custody Record
Appendix C - Comparison Tables

1.0 GENERAL

This report presents the methodology, findings and conclusions of the Phase II Limited Subsurface Investigation (Subsurface Investigation) conducted at 3122 14th Avenue, Kenosha, Wisconsin (Property).

1.1 Authorization

Authorization to perform this Subsurface Investigation was given by acceptance of EPS Environmental Services, Inc.'s (EPS Environmental) proposal number 14022-0214CO#1 by Fifth Third Bank (the Client).

1.2 Background Information

A *Phase I Environmental Property Assessment* (Phase I) prepared by EPS Environmental dated March 18, 2014 (EPS Environmental project #: 14022-0214) identified the following recognized environmental conditions[1] (RECs) in connection with the Property:

- The Property was identified on the Wisconsin Department of Natural Resources (WDNR) Leaking Underground Storage Tank (LUST) database with a reported release (e.g., spills, overfills and/or leaking tanks) of gasoline in 1998. According to the LUST database, the incident remains "open" (e.g., testing and/or remediation incomplete and/or discontinued).

- Indicator contaminants associated with petroleum and hazardous materials (e.g., chlorinated solvents) are present in Property soil and groundwater with concentrations above regulatory cleanup objectives.

1.3 Purpose

The purpose of the Subsurface Investigation was to attempt to determine the extent of concentrations of indicator contaminants associated with petroleum and hazardous materials in Property soil and groundwater related to the aforementioned RECs.

[1] According to ASTM Practice E 1527-13, a recognized environmental condition (REC) means "the presence or likely presence of any hazardous substances or petroleum products in, on, or at a Property: due to any release to the environment, under conditions indicative of a release to the environment, or under conditions that pose a material threat of a release of a future release to the environment; a controlled recognized environmental condition (CREC) is defined as a REC resulting from a past release of hazardous substances or petroleum products that has been addressed to the satisfaction of the applicable regulatory authority allowing for hazardous substances or petroleum products to remain in place subject to the implementation of required controls; and a historical recognized environmental condition (HREC) means past release of hazardous substances or petroleum products that has been addressed to the satisfaction of the applicable regulatory authority meeting unrestrictive land use criteria.

2.0 SAMPLING PROCEDURE

2.1 Field Activities

Soil Sampling

Soil borings and groundwater sampling were conducted on March 31, 2014 and April 1, 2014, under the direction and supervision of Mr. Nicholas J. Cuzzone, P.E. Senior Project Engineer for EPS Environmental. Ten (10) soil borings (SB-1 through SB-10) were conducted and nine (9) temporary groundwater monitoring wells (GW-2 trough GW-10) were installed in select locations on the Property where contamination would most likely be encountered. The boring and monitoring well locations are depicted on Figure 1 - Boring and Monitoring Well Location Map following the text of this Report.

Soil borings were conducted following American Society for Testing and Materials (ASTM)-recommended practices for continuous thin wall probe sampling. A truck-mounted, hydraulically-powered percussion/probing device (Geoprobe®) was used to advance a two-inch diameter steel drive point to the top of the desired sampling interval. Soil samples were collected in 48-inch intervals by advancing two-inch diameter steel thin-wall probe samplers. Samplers were attached to the leading end of extension probe rods, and driven downward until desired target depths were reached. After the desired sampling interval was obtained, the sampler was extracted, opened and the samples were collected.

Soil borings were advanced ten (10) to 16 feet below ground surface (bgs). Five (5) to eight (8) soil samples were collected from each soil boring. Triplicate soil samples were collected from each sampling interval. The first sample was deposited into a two-ounce (oz) jar preserved with methanol, then placed onto a scale to ensure a minimum of 25 grams of sample was obtained. The second sample was collected into an eight-ounce unpreserved jar. The third sample was placed into an air-tight plastic bag for field screening. The sampling was conducted according to Wisconsin Department of Natural Resources (WDNR) methodology.

All downhole sampling equipment was cleaned with water and non-alkaline soap between each sampling event. This procedure was used to minimize the possibility of cross contamination. After sampling was complete, the boreholes were properly abandoned to grade with hydrated bentonite pellets and concrete or asphalt patch in paved areas.

Groundwater Sampling

Monitoring wells GW-2 through GW-10 were constructed by inserting five-foot sections of one-inch diameter schedule 40 polyvinyl chloride (PVC) well screen (0.010" wide slots spaced 0.125" apart) into the two-inch diameter boreholes of SB-2 through SB-10, respectively. Screen and riser pipes had threaded connections; therefore solvent-cement type couplings were not used. The annular space between the borehole and well screen was packed with uniformly graded,

clean silica sand (not passing a No. 50 sieve) from total depth to grade. It should be noted, an existing monitoring well was located adjacent to soil boring SB-1; a groundwater sample (GW-1) was obtained from this well.

Prior to collecting a groundwater sample, the monitoring wells were purged by bailing five times (5X) the casing volume of water from each well. After purging of the well was complete, sufficient time was allowed for particulates to settle out of the well casing before obtaining a water sample for analysis. The groundwater sampled was obtained by attaching a dedicated cotton string to a disposable polyethylene bailer and lowering the bailer into the well. Care was taken not to allow the bailer to touch the bottom of the well and agitate sediments. The bailer was carefully drawn out of the well and the groundwater sample was poured into three (3) sterile 40-milliliter (mL) volatile organic analysis (VOA) sample vials preserved with hydrochloric acid, filled to the top allowing no head space, and sealed. After the sample vial was sealed, it was inspected to determine that no air bubbles existed. In addition, two (2) one-liter unpreserved amber bottles were filled to the top allowing no headspace. Monitoring wells GW-2, GW-4, GW-5, and GW-9 were allowed ample time to generate groundwater. However, no groundwater entered the wells and no groundwater samples were obtained. Therefore, soil samples were obtained at the terminus of these soil borings (SB-2/16', SB-4/15’, SB-5/16’ and SB-9/16’) and submitted for analysis.

2.2 Field Observations

Soil samples were examined for visual signs of petroleum hydrocarbon or solvent contamination and/or the presence of unusual odors. Samples in airtight plastic bags were allowed to equilibrate to approximately 70° Fahrenheit. Headspace air in each sample bag was then screened with a Rae photo-ionization detector (PID) and the screening results were recorded on Geological Boring Logs (Appendix A). The PID records total concentrations of organic vapors; however, the instrument does not differentiate between types of organic vapors and is inconclusive in identifying specific contaminants.

PID screening results ranged from zero to 10.4 parts per million (ppm) for the screened soil samples. No visual or olfactory signs of petroleum hydrocarbon or solvent contamination were noted in any of the borings conducted.

3.0 PHYSICAL SETTING

3.1 Topography

According to the Kenosha Quadrangle map, the general topography of the area displays an approximate ten (10) foot decrease in elevation within ¼-mile east of the Property in the direction of Lake Michigan.

3.2 Soils

Web Soil Survey provided by the United States Department of Agriculture (USDA)

The Property is located within a transitional zone between the Wasepi (WnA) series and Loamy Land (Lu). In general, these soils consists of very deep, somewhat poorly drained soils formed in loamy and sandy glaciofluvial deposits underlain by sand and gravel that formed on outwash plains, deltas, valley trains, glacial drainage ways, and lake plains. Permeability is moderately rapid in the solum and rapid in the underlying sand and gravel.

3.3 Geologic Profile

Based on the borings conducted, the geologic profile of the Property consists of varying depths of sand and gravel fill material underlain by silty clay to the maximum boring depth of 16 feet bgs. Based on the borings conducted, the geological profile of Property native soil appears to be consistent with published geological information reviewed.

4.0 LABORATORY ANALYSES

4.1 Analytical Program

Based on soil screening results and field observations, 14 representative soil samples (SB-1/12', SB-2/12', SB-2/16', SB-3/6', SB-4/6', SB-4/15', SB-5/4', SB-5/16', SB-6/8', SB-7/4', SB-8/6', SB-9/10', SB-9/16' and SB-10/6') and six (6) groundwater samples (GW-1, GW-3, GW-6, GW-7, GW-8 and GW-10) were submitted for laboratory analysis. The soil and groundwater samples were obtained as previously described, chilled, and transported under chain of custody to Environmental Monitoring and Technologies, Inc. of Morton Grove, Illinois. The representative soil and groundwater samples were analyzed for volatile organic compounds (VOCs) and polynuclear aromatic hydrocarbons (PNAs), indicator contaminates associated with petroleum and hazardous materials. Analyses were conducted in accordance with *WDNR: PUBL-FW-140* using appropriate methodology. See Appendix B for Chain of Custody Record.

4.2 Evaluation of Analytical Results

To assess potential detrimental environmental impacts, United States Environmental Protection Agency (USEPA) Industrial Soil Tables Regional Screening Levels (RSLs) and WDNR Wisconsin Administrative Code N.R. 140 preventative action limits (PALs) were used to address concerns associated with contaminated soil and groundwater.

4.3 Analytical Results

Varying concentrations of PNAs were identified above laboratory reporting limits in soil samples SB-1/12', SB-2/12', SB-2/16', SB-8/6', SB-9/10' and SB-10/6' and groundwater samples GW-6

and GW-7. Varying concentrations of VOCs were identified above laboratory reporting limits in groundwater samples GW-6, GW-8, and GW-10. No concentrations of VOCs or PNAs were identified above laboratory reporting limits in any of the remaining analyzed soil and groundwater samples. Refer to Appendix B for Laboratory Report and Chain of Custody, and Appendix C for Comparison Tables.

5.0 CONCLUSIONS

A *Phase I Environmental Property Assessment* (Phase I) prepared by EPS Environmental dated March 18, 2014 (EPS Environmental project #: 14022-0214) identified the following recognized environmental conditions[1] (RECs) in connection with the Property:

- The Property was identified on the Wisconsin Department of Natural Resources (WDNR) Leaking Underground Storage Tank (LUST) database with a reported release (e.g., spills, overfills and/or leaking tanks) of gasoline in 1998. According to the LUST database, the incident remains "open" (e.g., testing and/or remediation incomplete and/or discontinued).

- Indicator contaminants associated with petroleum and hazardous materials (e.g., chlorinated solvents) are present in Property soil and groundwater with concentrations above regulatory objectives.

The purpose of the Subsurface Investigation was to attempt to determine the extent of concentrations of indicator contaminants associated with petroleum and hazardous materials in Property soil and groundwater related to the aforementioned RECs.

Ten (10) soil borings (SB-1 through SB-10) were conducted and nine (9) temporary groundwater monitoring wells (GW-2 trough GW-10) were installed in select locations on the Property where contamination would most likely be encountered. It should be noted, an existing monitoring well was located adjacent to soil boring SB-1; a groundwater sample (GW-1) was obtained from this well. Additionally, monitoring wells GW-2, GW-4, GW-5 and GW-9 were allowed ample time to generate groundwater. However, no groundwater entered the wells and no groundwater samples were obtained. Therefore, soil samples were obtained at the terminus of these borings (SB-2/16', SB-4/15', SB-5/16', and SB-9/16') and submitted for analysis.

No visual or olfactory signs of petroleum hydrocarbon or solvent contamination were noted in soil samples obtained from any of the borings conducted. Based on soil screening results and field observations, 14 representative soil samples (SB-1/12', SB-2/12', SB-2/16', SB-3/6', SB-

[1] According to ASTM Practice E 1527-13, a recognized environmental condition (REC) means "the presence or likely presence of any hazardous substances or petroleum products in, on, or at a Property: due to any release to the environment, under conditions indicative of a release to the environment, or under conditions that pose a material threat of a release of a future release to the environment; a controlled recognized environmental condition (CREC) is defined as a REC resulting from a past release of hazardous substances or petroleum products that has been addressed to the satisfaction of the applicable regulatory authority allowing for hazardous substances or petroleum products to remain in place subject to the implementation of required controls; and a historical recognized environmental condition (HREC) means past release of hazardous substances or petroleum products that has been addressed to the satisfaction of the applicable regulatory authority meeting unrestrictive land use criteria.

4/6', SB-4/15', SB-5/4', SB-5/16', SB-6/8', SB-7/4', SB-8/6', SB-9/10', SB-9/16' and SB-10/6') and six (6) groundwater samples (GW-1, GW-3, GW-6, GW-7, GW-8 and GW-10) were submitted for laboratory analysis of volatile organic compounds (VOCs) and polynuclear aromatic hydrocarbons (PNAs), indicator contaminates associated with petroleum and hazardous materials.

Summary

Varying concentrations of various PNAs were identified above laboratory reporting limits in soil samples SB-1/12', SB-2/12', SB-2/16', SB-8/6', SB-9/10' and SB-10/6' and groundwater samples GW-6 and GW-7. Varying concentrations of various VOCs were identified above laboratory reporting limits in groundwater samples GW-6, GW-8 and GW-10. No concentrations of VOCs or PNAs were identified above laboratory reporting limits in any of the remaining analyzed soil and groundwater samples.

The concentrations of identified contaminants were **below** the most stringent United States Environmental Protection Agency (USEPA) Industrial Soil Tables Regional Screening Levels (RSLs) and Wisconsin Department of Natural Resources (WDNR) Wisconsin Administrative Code N.R. 140 preventative action limits (PALs). See **Discussion** below for additional information.

Discussion

Although no concentrations of contaminants were identified above the most stringent RSLs and PALs, according to the WDNR regulations Chapter 292.11 a person who possesses or controls a hazardous substance (e.g. substances which are toxic, corrosive, flammable, irritants, strong sensitizers or explosives) or who causes the discharge of a hazardous substance shall notify the department immediately of any discharge (e.g., any spilling, leaking, pumping, pouring, emitting, emptying or dumping). The presence of indicator contaminants associated with hazardous materials and petroleum identified in Property soil and groundwater above laboratory reporting limits, and previously identified concentrations of contaminants in Property soil and groundwater, is considered ***prima facie*** evidence that a discharge has occurred. ***EPS Environmental recommends legal counsel is retained by the Property owner to determine regulatory reporting requirements. In addition, a WDNR certified site assessor should be contracted to prepare the required reports for submittal to WDNR according to Chapter NR 706.***

6.0 WARRANTY AND LIMITATION OF LIABILITY

EPS Environmental's Limited Subsurface Investigation was of limited scope. The Limited Subsurface Investigation was structured to screen for the presence of hazardous materials contamination in the areas where contamination would most likely be encountered, and was not intended to be an all inclusive search for soil contamination across the subject Property.

However, the Limited Subsurface Investigation can provide an indication of the presence or absence of those contaminants sampled and analyzed for at the sample locations, at the time the samples were obtained in the sampled media.

EPS Environmental warrants that the findings and conclusions contained in this Report have been promulgated in accordance with generally accepted environmental engineering methods. These environmental methods have been developed to provide the Client with information regarding apparent indications of existing or potential environmental conditions relating to the soils and are limited to the conditions observed at the time that the Limited Subsurface Investigation was conducted. This Report is also limited to the information available at the time it is prepared. There is a distinct possibility that conditions may exist at the subject Property which were not apparent during the Limited Subsurface Investigation. EPS Environmental makes no other warranties, expressed or implied.

6.1 Confidentiality

EPS Environmental shall hold all field observations, borings, logs, analysis, laboratory reports and other reports in strict confidence and shall not disclose these items except to the Client or except as ordered by any state or federal agency or court of law. In the event that EPS Environmental is ordered by a state or federal agency or court of law to make any such disclosures, the Client shall release EPS from liability for any and all damages the Client may suffer due to EPS's disclosure consistent with the proposal.

6.2 Reliance on the Phase II Limited Subsurface Investigation and Report

The Limited Subsurface Investigation and Report has been conducted exclusively for the Client it is intended that only those parties will rely on the Report. The Limited Subsurface Investigation and Report will be solely for the benefit of the Client may not be relied upon by other parties.

FIGURE 1

Boring and Monitoring Well Location Map

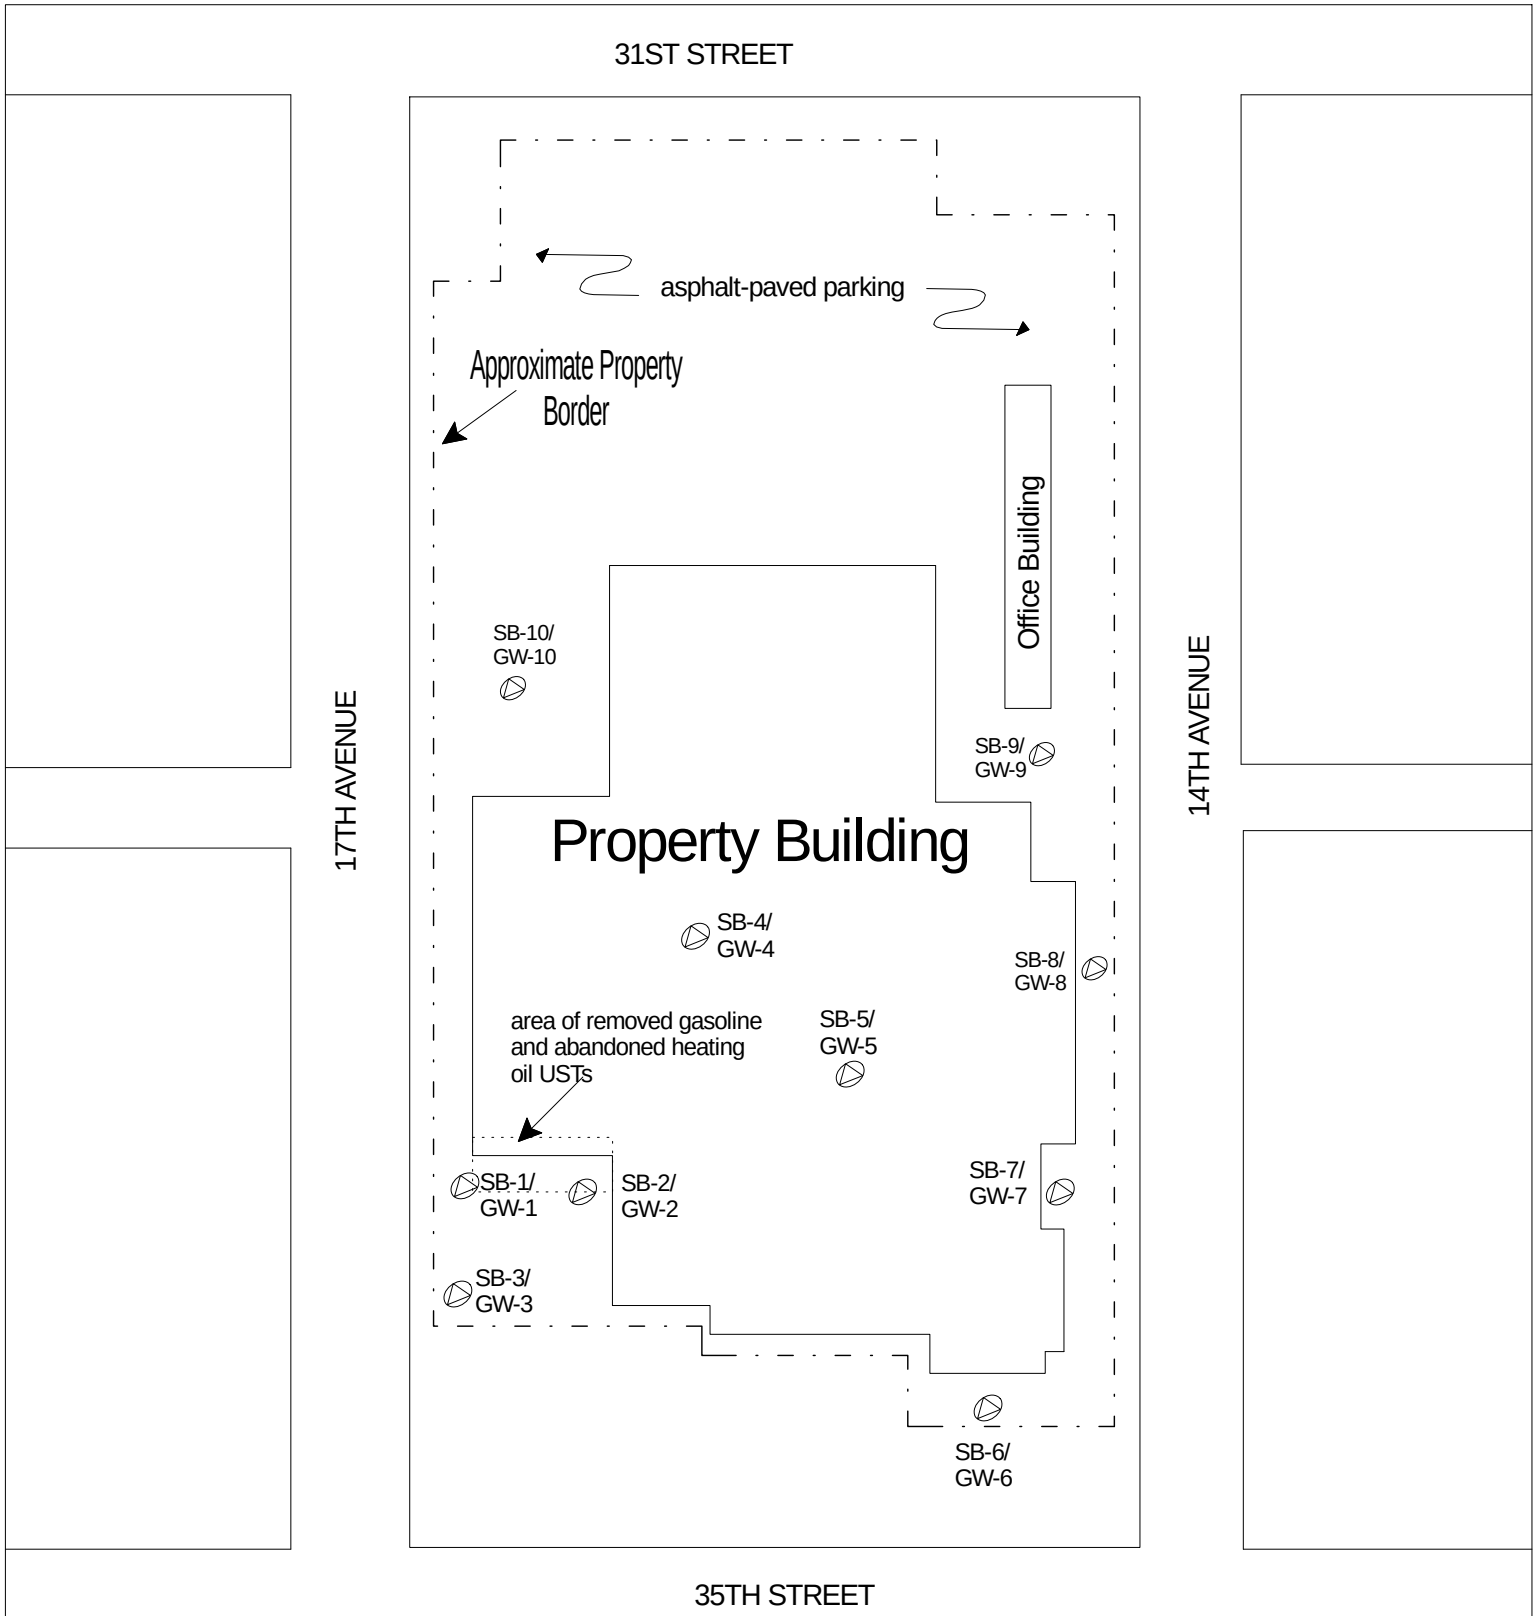

SB-1/ GW-1 = Approximate Boring and Well Location

Figure 1 - Boring and Monitoring Well Location Map

3122 14th Avenue
Kenosha, Wisconsin

North

EPS Environmental Services, Inc.
7237 West Devon Avenue, Chicago ,Illinois 60631

not to scale
Date: 03/31/14

Project #: 14022-0214CO#1

APPENDIX A

Geologic Boring Logs

EPS ENVIRONMENTAL SERVICES, INC.
GEOLOGIC BORING LOG

Project Address: 3122 14th Avenue, Kenosha, Wisconsin Project #: 14022-0214CO#1
Engineer/Geologist: Nicholas J. Cuzzone, P.E.
Weather Condition: Dry X Wet_____ Snow_____ Temp: 35-40°F
Boring #: SB-1 Date: 03/31/14 Time: 1315 Location: See Boring Location Map

DESCRIPTION OF SOILS	DEPTH	SAMPLE	PID-PPM	ODOR
Asphalt Sand and Gravel Fill Material	-			
	-2		0.6	None
	-			
	-4		0.2	None
CLAY, Silty, Gray Color, Moist	-			
	-6		0.3	None
	-			
	-8		0.1	None
	-			
	-10		0.1	None
	-			
	-12	SB-1/12’	1.4	None
Total Depth: 12’ Rig: Truck Mounted GeoProbe® Sampler Type: Clear plastic sleeves	-			
	-14			
	-			
	-16			
	-			
	-18			

EPS ENVIRONMENTAL SERVICES, INC.
GEOLOGIC BORING LOG

Project Address: 3122 14th Avenue, Kenosha, Wisconsin Project #: 14022-0214CO#1
Engineer/Geologist: Nicholas J. Cuzzone, P.E.
Weather Condition: Dry X Wet_____ Snow_____ Temp: 35-40°F
Boring #: SB-2/GW-2 Date: 03/31/14 Time: 1357 Location: See Boring Location Map

DESCRIPTION OF SOILS	DEPTH	SAMPLE	PID-PPM	ODOR
Concrete				
Sand and Gravel Fill Material	-			
	-2		3.7	None
	-			
	-4		2.9	None
	-			
	-6		4.1	None
	-			
CLAY, Silty, Gray Color, Dry	-8		3.1	None
	-			
	-10		1.9	None
	-			
	-12	SB-2/12’	7.0	None
	-			
	-14		0.1	None
	-			
	-16	SB-2/16’	10.4	None
Total Depth: 16’				
Monitoring Well GW-2 set at 15’	-			
Rig: Truck Mounted GeoProbe®				
Sampler Type: Clear plastic sleeves	-18			

EPS ENVIRONMENTAL SERVICES, INC.
GEOLOGIC BORING LOG

Project Address: 3122 14th Avenue, Kenosha, Wisconsin Project #: 14022-0214CO#1
Engineer/Geologist: Nicholas J. Cuzzone, P.E.
Weather Condition: Dry X Wet_____ Snow_____ Temp: 35-40°F
Boring #: SB-3/GW-3 Date: 03/31/14 Time: 1448 Location: See Boring Location Map

DESCRIPTION OF SOILS	DEPTH	SAMPLE	PID-PPM	ODOR
Asphalt Sand and Gravel Fill Material	-			
	-2		0.0	None
	-			
SAND, Well-Sorted, Fine-Grained, Red/Brown Color, Moist	-4		0.0	None
	-			
	-6	SB-3/6’	0.5	None
	-			
	-8		0.1	None
CLAY, Silty, Gray Color, Dry	-			
Refusal	-10		0.0	None
Total Depth: 10’ Monitoring Well GW-3 set at 10’ Rig: Truck Mounted GeoProbe® Sampler Type: Clear plastic sleeves	-			
	-12			
	-			
	-14			
	-			
	-16			
	-			
	-18			

EPS ENVIRONMENTAL SERVICES, INC.
GEOLOGIC BORING LOG

Project Address: 3122 14th Avenue, Kenosha, Wisconsin Project #: 14022-0214CO#1
Engineer/Geologist: Nicholas J. Cuzzone, P.E.
Weather Condition: Dry X Wet_____ Snow_____ Temp: 35-40°F
Boring #: SB-4/GW-4 Date: 04/01/14 Time: 0830 Location: See Boring Location Map

DESCRIPTION OF SOILS	DEPTH	SAMPLE	PID-PPM	ODOR
Concrete				
Sand and Gravel Fill Material	-			
	-2		0.0	None
SAND, Well-Sorted, Fine-Grained, Brown Color, Moist	-			
	-4		0.0	None
	-			
Grades To Gray Color Becomes Wet	-6	SB-4/6’	0.0	None
	-			
	-8		0.0	None
	-			
	-10		0.0	None
CLAY, Silty, Gray Color, Dry	-			
	-12		0.0	None
	-			
	-14		0.0	None
	-	SB-4/15’	0.0	None
Total Depth: 15’				
Monitoring Well GW-4 set at 15’	-16			
Rig: Truck Mounted GeoProbe®				
Sampler Type: Clear plastic sleeves	-			
	-18			

EPS ENVIRONMENTAL SERVICES, INC.
GEOLOGIC BORING LOG

Project Address: 3122 14th Avenue, Kenosha, Wisconsin Project #: 14022-0214CO#1
Engineer/Geologist: Nicholas J. Cuzzone, P.E.
Weather Condition: Dry X Wet_____ Snow_____ Temp: 35-40°F
Boring #: SB-5/GW-5 Date: 04/01/14 Time: 0949 Location: See Boring Location Map

DESCRIPTION OF SOILS	DEPTH	SAMPLE	PID-PPM	ODOR
Concrete Sand and Gravel Fill Material	-			
	-2		0.0	None
SAND, Well-Sorted, Fine-Grained, Brown Color, Moist	-			
	-4		0.1	None
	-			
	-6	SB-5/6’	0.0	None
	-			
	-8		0.0	None
CLAY, Silty, Gray Color, Dry	-			
	-10		0.0	None
	-			
	-12		0.0	None
	-			
	-14		0.0	None
	-			
	-16	SB-5/15’	0.1	None
Total Depth: 16’ Monitoring Well GW-5 set at 15’ Rig: Truck Mounted GeoProbe® Sampler Type: Clear plastic sleeves	- -18			

EPS ENVIRONMENTAL SERVICES, INC.
GEOLOGIC BORING LOG

Project Address: 3122 14th Avenue, Kenosha, Wisconsin Project #: 14022-0214CO#1
Engineer/Geologist: Nicholas J. Cuzzone, P.E.
Weather Condition: Dry X Wet_____ Snow_____ Temp: 35-40°F
Boring #: SB-6/GW-6 Date: 04/01/14 Time: 1115 Location: See Boring Location Map

DESCRIPTION OF SOILS	DEPTH	SAMPLE	PID-PPM	ODOR
Asphalt Sand and Gravel Fill Material	-			
	-2		0.0	None
SAND, Well-Sorted, Fine-Grained, Brown Color, Moist	-			
	-4		0.0	None
Becomes Wet	-			
	-6		0.0	None
	-			
	-8	SB-6/8’	0.3	None
CLAY, Silty, Gray Color, Dry	-			
	-10		0.0	None
	-			
	-12		0.0	None
	-			
	-14		0.0	None
	-			
	-16		0.0	None
Total Depth: 16’ Monitoring Well GW-6 set at 15’ Rig: Truck Mounted GeoProbe® Sampler Type: Clear plastic sleeves	- -18			

EPS ENVIRONMENTAL SERVICES, INC.
GEOLOGIC BORING LOG

Project Address: 3122 14th Avenue, Kenosha, Wisconsin Project #: 14022-0214CO#1
Engineer/Geologist: Nicholas J. Cuzzone, P.E.
Weather Condition: Dry X Wet_____ Snow_____ Temp: 35-40°F
Boring #: SB-7/GW-7 Date: 04/01/14 Time: 1145 Location: See Boring Location Map

DESCRIPTION OF SOILS	DEPTH	SAMPLE	PID-PPM	ODOR
Asphalt Sand and Gravel Fill Material	-			
	-2		0.0	None
	-			
	-4	SB-7/4’	5.6	None
	-			
	-6		0.0	None
	-			
CLAY, Silty, Gray Brown Mottled Color, Moist	-8		0.0	None
	-			
	-10		0.0	None
	-			
	-12		0.1	None
	-			
	-14		2.4	None
	-			
	-16		0.3	None
Total Depth: 16’ Monitoring Well GW-7 set at 15’ Rig: Truck Mounted GeoProbe® Sampler Type: Clear plastic sleeves	- -18			

EPS ENVIRONMENTAL SERVICES, INC.
GEOLOGIC BORING LOG

Project Address: 3122 14th Avenue, Kenosha, Wisconsin Project #: 14022-0214CO#1
Engineer/Geologist: Nicholas J. Cuzzone, P.E.
Weather Condition: Dry X Wet_____ Snow_____ Temp: 35-40°F
Boring #: SB-8/GW-8 Date: 04/01/14 Time: 1235 Location: See Boring Location Map

DESCRIPTION OF SOILS	DEPTH	SAMPLE	PID-PPM	ODOR
Topsoil, Black Color, Moist	-			
	-2		0.0	None
SAND, Poorly-Sorted, Coarse-Grained, Brown Color. Moist	-			
	-4		0.0	None
	-			
	-6	SB-8/6’	0.0	None
	-			
	-8		0.0	None
	-			
CLAY, Silty, Gray Brown Mottled Color, Moist	-10		0.0	None
	-			
	-12		0.0	None
	-			
	-14		0.0	None
	-			
	-16		0.0	None
Total Depth: 16’ Monitoring Well GW-8 set at 15’ Rig: Truck Mounted GeoProbe® Sampler Type: Clear plastic sleeves	- -18			

EPS ENVIRONMENTAL SERVICES, INC.
GEOLOGIC BORING LOG

Project Address: 3122 14th Avenue, Kenosha, Wisconsin Project #: 14022-0214CO#1
Engineer/Geologist: Nicholas J. Cuzzone, P.E.
Weather Condition: Dry X Wet_____ Snow_____ Temp: 35-40°F
Boring #: SB-9/GW-9 Date: 04/01/14 Time: 1304 Location: See Boring Location Map

DESCRIPTION OF SOILS	DEPTH	SAMPLE	PID-PPM	ODOR
Asphalt Sand and Gravel Fill Material	-			
	-2		0.0	None
SAND, Well-Sorted, Fine-Grained, Brown Color, Moist	-			
	-4		0.0	None
	-			
	-6		0.0	None
CLAY, Silty, Brown Color, Dry	-			
	-8		0.0	None
Grades To Gray Color	-			
	-10	SB-9/10’	0.1	None
	-			
	-12		0.0	None
	-			
	-14		0.0	None
	-			
	-16	SB-9/16’	0.0	None
Total Depth: 16’ Monitoring Well GW-9 set at 15’ Rig: Truck Mounted GeoProbe® Sampler Type: Clear plastic sleeves	- -18			

EPS ENVIRONMENTAL SERVICES, INC.
GEOLOGIC BORING LOG

Project Address: 3122 14th Avenue, Kenosha, Wisconsin Project #: 14022-0214CO#1
Engineer/Geologist: Nicholas J. Cuzzone, P.E.
Weather Condition: Dry X Wet_____ Snow_____ Temp: 35-40°F
Boring #: SB-10/GW-10 Date: 04/01/14 Time: 1352 Location: See Boring Location Map

DESCRIPTION OF SOILS	DEPTH	SAMPLE	PID-PPM	ODOR
Asphalt Sand and Gravel Fill Material	-			
	-2		0.0	None
	-			
CLAY, Silty, Gray Color, Dry	-4		0.0	None
	-			
Grades To Gray Color	-6	SB-10/6’	0.0	None
	-			
	-8		0.0	None
	-			
	-10		0.0	None
	-			
	-12		0.0	None
	-			
	-14		0.0	None
	-			
	-16		0.0	None
Total Depth: 16’ Monitoring Well GW-10 set at 15’ Rig: Truck Mounted GeoProbe® Sampler Type: Clear plastic sleeves	- -18			

APPENDIX B

Laboratory Report
And
Chain of Custody Record

ENVIRONMENTAL MONITORING AND TECHNOLOGIES, INC.

8100 North Austin • Morton Grove, IL 60053-3203
847.967.6666 • 800.246.0663 • fax: 847.967.6735 • www.emt.com

Nick Cuzzone
EPS Environmental Services, Inc.
7237 W. Devon Avenue
Chicago, IL 606311621

April 09, 2014

RE 3122 14th Ave., Kenosha, W

Lab Orders:
14040141

Dear Mr. Nick Cuzzone:

Enclosed are the analytical reports for the EMT Lab Order listed. Also included with this analytical report is a copy of the chain of custody associated with these samples. If you have any questions, please contact me at 847-967-6666.

Sincerely,

Arminta Priddy
Project Manager

Approved by,

Marilyn Krueding
Laboratory Director

This Report Contains 68 pages

The Contents of this report apply to the sample(s) analyzed. No duplication is allowed except in its entirety.

State of Illinois, NELAC Accredited Lab. No. 100256
State of Wisconsin, WDNR Accredited Lab No. 999888890

ENVIRONMENTAL MONITORING AND TECHNOLOGIES, INC.

8100 North Austin • Morton Grove, IL 60053-3203
847.967.6666 • 800.246.0663 • fax: 847.967.6735 • www.emt.com

CLIENT: EPS Environmental Services, Inc.

Date: *4/9/2014*

Project: 3122 14th Ave., Kenosha, W

Lab Order: 14040141

CASE NARRATIVE

Unless otherwise noted, samples were analyzed using the methods outlined in the following references:
Test Methods for Evaluating Solid Waste, Physical/Chemical Methods, SW846, 3rd Edition

Unless otherwise noted, all method blanks, laboratory spikes, and/or matrix spikes met quality assurance objectives.

Sample results relate only to the analytes of interest tested and to the sample received at the laboratory.

All results are reported on a wet weight basis, unless otherwise noted. Dry weight adjusted results, reporting limits, method detection limits and dilution factors are indicated by the notation "dry" in the Units column. If present, a dilution factor will adjust the method detection limits and reporting limits.

The test results contained in this report meet all of the requirements of NELAC. Accreditation by the State of Illinois or Wisconsin is not an endorsement or a guarantee of the validity of data generated. For specific information regarding EMT's scope of accreditation , please contact your EMT project manager.

The Reporting Limit listed on the Report of Laboratory Analysis is EMT's reporting limit for the analyte reported. For most test methods this reporting limit is primarily based upon the lowest point in the calibration curve.

Analyst's initials of "OUT" indicate that the analyte was analyzed by a subcontracted laboratory.

Method References:
SW=USEPA, Test Methods for Evaluating Solid Waste, SW-846.
E=USEPA Methods for the Determination of Inorganic Substances in Environmental Samples; Methods for Chemical Analysis of Water and Wastes; Methods for Organic Chemical Analysis of Municipal and Industrial Wastewater, 40 CFR Part 136, App A; methods for the Determination of Metals in Environmental Samples; Methods for the Determination of Organic Compounds in Drinking Water.
SM= APHA, Standard Methods for the Examination of Water and Wastewater.
D=ASTM, Annual Book of Standards

Batch numbers starting with a letter indicate an analytical batch while those that are exculsively numerals indicate a preparation batch.

ENVIRONMENTAL MONITORING AND TECHNOLOGIES, INC.

8100 North Austin • Morton Grove, IL 60053-3203
847.967.6666 • 800.246.0663 • fax: 847.967.6735 • www.emt.com

Report of Laboratory Analysis

CLIENT:	EPS Environmental Services, Inc.	**Client Sample ID:**	SB - 1/12'
Lab Order:	14040141	**Report Date:**	4/9/2014
Project:	3122 14th Ave., Kenosha, W	**Collection Date:**	3/31/2014 1:15:00 PM
Lab ID:	14040141-01	**Matrix:**	Soil

Analyses	Result	EMT Reporting Limit	Qual	Units	MDL	Date Analyzed	Batch	DF	Analyst
Percent Moisture		**Method:**		**SM2540G**					
Percent Moisture	14.2	0.100		% (Percent)	0.0150	4/4/14 16:15	R200091	1.00	TB2
Polynuclear Aromatic Hydrocarbons		**Method:**		**SW8310 / SW3540C**					
Acenaphthene	< 4.96	28.6		µg/Kg-dry	4.96	4/7/14	88852	1.00	RYL
Acenaphthylene	< 3.42	143		µg/Kg-dry	3.42	4/7/14	88852	1.00	RYL
Anthracene	< 3.45	28.6		µg/Kg-dry	3.45	4/7/14	88852	1.00	RYL
Benz(a)anthracene	< 3.4	28.6		µg/Kg-dry	3.40	4/7/14	88852	1.00	RYL
Benzo(a)pyrene	< 2.95	28.6		µg/Kg-dry	2.95	4/7/14	88852	1.00	RYL
Benzo(b)fluoranthene	< 3.16	28.6		µg/Kg-dry	3.16	4/7/14	88852	1.00	RYL
Benzo(g,h,i)perylene	< 3.59	28.6		µg/Kg-dry	3.59	4/7/14	88852	1.00	RYL
Benzo(k)fluoranthene	< 2.7	28.6		µg/Kg-dry	2.70	4/7/14	88852	1.00	RYL
Chrysene	< 2.84	28.6		µg/Kg-dry	2.84	4/7/14	88852	1.00	RYL
Dibenz(a,h)anthracene	< 4.23	28.6		µg/Kg-dry	4.23	4/7/14	88852	1.00	RYL
Fluoranthene	< 2.63	28.6		µg/Kg-dry	2.63	4/7/14	88852	1.00	RYL
Fluorene	< 8.15	28.6		µg/Kg-dry	8.15	4/7/14	88852	1.00	RYL
Indeno(1,2,3-cd)pyrene	< 4.58	28.6		µg/Kg-dry	4.58	4/7/14	88852	1.00	RYL
Naphthalene	< 4.03	28.6		µg/Kg-dry	4.03	4/7/14	88852	1.00	RYL
Phenanthrene	15	28.6	J	µg/Kg-dry	5.95	4/7/14	88852	1.00	RYL
Pyrene	< 4.38	28.6		µg/Kg-dry	4.38	4/7/14	88852	1.00	RYL
Surrogates:									
4-Terphenyl-d14	81.8	47.1-125		%REC	0	4/7/14	88852	1.00	RYL
Volatile Organic Compounds by GC/MS		**Method:**		**SW8260B / WDNR: PUBL-FW-140**					
1,1,1-Trichloroethane	< 25	52.2		µg/Kg	17.4	4/5/14 02:47	88919	1.00	JL
1,1,2,2-Tetrachloroethane	< 25	50.9		µg/Kg	17.0	4/5/14 02:47	88919	1.00	JL
1,1,2-Trichloroethane	< 27.4	82.2		µg/Kg	27.4	4/5/14 02:47	88919	1.00	JL
1,1-Dichloroethane	< 25	67.2		µg/Kg	22.4	4/5/14 02:47	88919	1.00	JL
1,1-Dichloroethene	< 25	66.2		µg/Kg	22.1	4/5/14 02:47	88919	1.00	JL
1,2-Dibromo-3-chloropropane	< 120	359.		µg/Kg	120	4/5/14 02:47	88919	1.00	JL
1,2-Dibromoethane	< 25	49.2		µg/Kg	16.4	4/5/14 02:47	88919	1.00	JL
1,2-Dichloroethane	< 25	45.		µg/Kg	15.0	4/5/14 02:47	88919	1.00	JL
1,2-Dichloropropane	< 32.4	97.2		µg/Kg	32.4	4/5/14 02:47	88919	1.00	JL
1-Butanol	< 1630	4890.		µg/Kg	1,630	4/5/14 02:47	88919	1.00	JL

Qualifiers:

B - Analyte detected in the associated Method Blank
E - Estimated
H - Holding Time Exceeded
S - Spike Recovery outside accepted recovery limits
R - RPD outside accepted recovery limits
J - Analyte detected below quantitation limits

ENVIRONMENTAL MONITORING AND TECHNOLOGIES, INC.

8100 North Austin • Morton Grove, IL 60053-3203
847.967.6666 • 800.246.0663 • fax: 847.967.6735 • www.emt.com

Report of Laboratory Analysis

CLIENT:	EPS Environmental Services, Inc.	**Client Sample ID:**	SB - 1/12'
Lab Order:	14040141	**Report Date:**	4/9/2014
Project:	3122 14th Ave., Kenosha, W	**Collection Date:**	3/31/2014 1:15:00 PM
Lab ID:	14040141-01	**Matrix:**	Soil

Analyses	Result	EMT Reporting Limit	Qual	Units	MDL	Date Analyzed	Batch	DF	Analyst
2-Butanone	< 333	998.		µg/Kg	333	4/5/14 02:47	88919	1.00	JL
2-Hexanone	< 40.9	123.		µg/Kg	40.9	4/5/14 02:47	88919	1.00	JL
4-Methyl-2-pentanone	< 148	443.		µg/Kg	148	4/5/14 02:47	88919	1.00	JL
Acetone	< 391	1170.		µg/Kg	391	4/5/14 02:47	88919	1.00	JL
Acrylonitrile	< 126	378.		µg/Kg	126	4/5/14 02:47	88919	1.00	JL
Benzene	< 25	45.3		µg/Kg	15.1	4/5/14 02:47	88919	1.00	JL
Bromodichloromethane	< 25	56.4		µg/Kg	18.8	4/5/14 02:47	88919	1.00	JL
Bromoform	< 25.4	76.3		µg/Kg	25.4	4/5/14 02:47	88919	1.00	JL
Bromomethane	< 39.1	117.		µg/Kg	39.1	4/5/14 02:47	88919	1.00	JL
Carbon disulfide	< 25	55.8		µg/Kg	18.6	4/5/14 02:47	88919	1.00	JL
Carbon tetrachloride	< 25	62.3		µg/Kg	20.8	4/5/14 02:47	88919	1.00	JL
Chlorobenzene	< 25	24.7		µg/Kg	8.22	4/5/14 02:47	88919	1.00	JL
Chloroethane	< 32.8	98.5		µg/Kg	32.8	4/5/14 02:47	88919	1.00	JL
Chloroform	< 25	33.6		µg/Kg	11.2	4/5/14 02:47	88919	1.00	JL
Chloromethane	< 45.3	136.		µg/Kg	45.3	4/5/14 02:47	88919	1.00	JL
cis-1,2-Dichloroethene	< 25	43.4		µg/Kg	14.5	4/5/14 02:47	88919	1.00	JL
Dibromochloromethane	< 25	47.		µg/Kg	15.7	4/5/14 02:47	88919	1.00	JL
Ethylbenzene	< 25.4	76.3		µg/Kg	25.4	4/5/14 02:47	88919	1.00	JL
m,p-Xylene	< 64	192.		µg/Kg	64.0	4/5/14 02:47	88919	1.00	JL
Methyl tert-butyl ether	< 25	62.9		µg/Kg	21.0	4/5/14 02:47	88919	1.00	JL
Methylene chloride	< 35.1	105.		µg/Kg	35.1	4/5/14 02:47	88919	1.00	JL
o-Xylene	< 28	84.1		µg/Kg	28.0	4/5/14 02:47	88919	1.00	JL
Styrene	< 25	37.2		µg/Kg	12.4	4/5/14 02:47	88919	1.00	JL
Tetrachloroethene	< 25	70.4		µg/Kg	23.5	4/5/14 02:47	88919	1.00	JL
Toluene	< 30.9	92.6		µg/Kg	30.9	4/5/14 02:47	88919	1.00	JL
trans-1,2-Dichloroethene	< 25	72.7		µg/Kg	24.2	4/5/14 02:47	88919	1.00	JL
Trichloroethene	< 25	61.6		µg/Kg	20.5	4/5/14 02:47	88919	1.00	JL
Vinyl acetate	< 25	34.9		µg/Kg	11.6	4/5/14 02:47	88919	1.00	JL
Vinyl chloride	< 25	27.7		µg/Kg	9.24	4/5/14 02:47	88919	1.00	JL
1,3-Dichloropropene, Total	< 50	98.8		µg/Kg	32.9	4/5/14 02:47	88919	1.00	JL
Xylenes, Total	< 92.1	276.		µg/Kg	92.1	4/5/14 02:47	88919	1.00	JL
Surrogates:									
1,2-Dichloroethane-d4	92.6	70-140		%REC	0	4/5/14 02:47	88919	1.00	JL

Qualifiers:

B - Analyte detected in the associated Method Blank
E - Estimated
H - Holding Time Exceeded
S - Spike Recovery outside accepted recovery limits
R - RPD outside accepted recovery limits
J - Analyte detected below quantitation limits

ENVIRONMENTAL MONITORING AND TECHNOLOGIES, INC.

8100 North Austin • Morton Grove, IL 60053-3203
847.967.6666 • 800.246.0663 • fax: 847.967.6735 • www.emt.com

Report of Laboratory Analysis

CLIENT:	EPS Environmental Services, Inc.	**Client Sample ID:**	SB - 1/12'
Lab Order:	14040141	**Report Date:**	4/9/2014
Project:	3122 14th Ave., Kenosha, W	**Collection Date:**	3/31/2014 1:15:00 PM
Lab ID:	14040141-01	**Matrix:**	Soil

Analyses	Result	EMT Reporting Limit	Qual	Units	MDL	Date Analyzed	Batch	DF	Analyst
4-Bromofluorobenzene	114	80-130		%REC	0	4/5/14 02:47	88919	1.00	JL
d4-1,2-Dichlorobenzene	106	80-125		%REC	0	4/5/14 02:47	88919	1.00	JL
Dibromofluoromethane	97.7	80-125		%REC	0	4/5/14 02:47	88919	1.00	JL
Fluorobenzene	97.6	80-120		%REC	0	4/5/14 02:47	88919	1.00	JL
Toluene-d8	101	80-120		%REC	0	4/5/14 02:47	88919	1.00	JL

Qualifiers:

B - Analyte detected in the associated Method Blank
E - Estimated
H - Holding Time Exceeded
S - Spike Recovery outside accepted recovery limits
R - RPD outside accepted recovery limits
J - Analyte detected below quantitation limits

ENVIRONMENTAL MONITORING AND TECHNOLOGIES, INC.

8100 North Austin • Morton Grove, IL 60053-3203
847.967.6666 • 800.246.0663 • fax: 847.967.6735 • www.emt.com

Report of Laboratory Analysis

CLIENT:	EPS Environmental Services, Inc.	**Client Sample ID:**	SB - 2/12'
Lab Order:	14040141	**Report Date:**	4/9/2014
Project:	3122 14th Ave., Kenosha, W	**Collection Date:**	3/31/2014 1:57:00 PM
Lab ID:	14040141-02	**Matrix:**	Soil

Analyses	Result	EMT Reporting Limit	Qual	Units	MDL	Date Analyzed	Batch	DF	Analyst
Percent Moisture		**Method:**		**SM2540G**					
Percent Moisture	13.9	0.100		% (Percent)	0.0150	4/4/14 16:15	R200091	1.00	TB2
Polynuclear Aromatic Hydrocarbons		**Method:**		**SW8310 / SW3540C**					
Acenaphthene	< 4.97	28.7		µg/Kg-dry	4.97	4/7/14	88852	1.00	RYL
Acenaphthylene	< 3.43	143		µg/Kg-dry	3.43	4/7/14	88852	1.00	RYL
Anthracene	< 3.45	28.7		µg/Kg-dry	3.45	4/7/14	88852	1.00	RYL
Benz(a)anthracene	< 3.41	28.7		µg/Kg-dry	3.41	4/7/14	88852	1.00	RYL
Benzo(a)pyrene	< 2.96	28.7		µg/Kg-dry	2.96	4/7/14	88852	1.00	RYL
Benzo(b)fluoranthene	< 3.17	28.7		µg/Kg-dry	3.17	4/7/14	88852	1.00	RYL
Benzo(g,h,i)perylene	< 3.6	28.7		µg/Kg-dry	3.60	4/7/14	88852	1.00	RYL
Benzo(k)fluoranthene	< 2.71	28.7		µg/Kg-dry	2.71	4/7/14	88852	1.00	RYL
Chrysene	< 2.85	28.7		µg/Kg-dry	2.85	4/7/14	88852	1.00	RYL
Dibenz(a,h)anthracene	< 4.25	28.7		µg/Kg-dry	4.25	4/7/14	88852	1.00	RYL
Fluoranthene	< 2.64	28.7		µg/Kg-dry	2.64	4/7/14	88852	1.00	RYL
Fluorene	< 8.17	28.7		µg/Kg-dry	8.17	4/7/14	88852	1.00	RYL
Indeno(1,2,3-cd)pyrene	< 4.59	28.7		µg/Kg-dry	4.59	4/7/14	88852	1.00	RYL
Naphthalene	< 4.04	28.7		µg/Kg-dry	4.04	4/7/14	88852	1.00	RYL
Phenanthrene	35.0	28.7		µg/Kg-dry	5.97	4/7/14	88852	1.00	RYL
Pyrene	< 4.4	28.7		µg/Kg-dry	4.40	4/7/14	88852	1.00	RYL
Surrogates:									
4-Terphenyl-d14	90.4	47.1-125		%REC	0	4/7/14	88852	1.00	RYL
Volatile Organic Compounds by GC/MS		**Method:**		**SW8260B / WDNR: PUBL-FW-140**					
1,1,1-Trichloroethane	< 25	50.		µg/Kg	16.7	4/5/14 03:19	88919	1.00	JL
1,1,2,2-Tetrachloroethane	< 25	48.7		µg/Kg	16.2	4/5/14 03:19	88919	1.00	JL
1,1,2-Trichloroethane	< 26.2	78.7		µg/Kg	26.2	4/5/14 03:19	88919	1.00	JL
1,1-Dichloroethane	< 25	64.4		µg/Kg	21.5	4/5/14 03:19	88919	1.00	JL
1,1-Dichloroethene	< 25	63.4		µg/Kg	21.1	4/5/14 03:19	88919	1.00	JL
1,2-Dibromo-3-chloropropane	< 115	344.		µg/Kg	115	4/5/14 03:19	88919	1.00	JL
1,2-Dibromoethane	< 25	47.2		µg/Kg	15.7	4/5/14 03:19	88919	1.00	JL
1,2-Dichloroethane	< 25	43.1		µg/Kg	14.4	4/5/14 03:19	88919	1.00	JL
1,2-Dichloropropane	< 31	93.1		µg/Kg	31.0	4/5/14 03:19	88919	1.00	JL
1-Butanol	< 1560	4690.		µg/Kg	1,560	4/5/14 03:19	88919	1.00	JL

Qualifiers:

B - Analyte detected in the associated Method Blank
E - Estimated
H - Holding Time Exceeded
S - Spike Recovery outside accepted recovery limits
R - RPD outside accepted recovery limits
J - Analyte detected below quantitation limits

ENVIRONMENTAL MONITORING AND TECHNOLOGIES, INC.

8100 North Austin • Morton Grove, IL 60053-3203
847.967.6666 • 800.246.0663 • fax: 847.967.6735 • www.emt.com

Report of Laboratory Analysis

CLIENT:	EPS Environmental Services, Inc.	**Client Sample ID:**	SB - 2/12'
Lab Order:	14040141	**Report Date:**	4/9/2014
Project:	3122 14th Ave., Kenosha, W	**Collection Date:**	3/31/2014 1:57:00 PM
Lab ID:	14040141-02	**Matrix:**	Soil

Analyses	Result	EMT Reporting Limit	Qual	Units	MDL	Date Analyzed	Batch	DF	Analyst
2-Butanone	< 319	956.		µg/Kg	319	4/5/14 03:19	88919	1.00	JL
2-Hexanone	< 39.2	118.		µg/Kg	39.2	4/5/14 03:19	88919	1.00	JL
4-Methyl-2-pentanone	< 142	425.		µg/Kg	142	4/5/14 03:19	88919	1.00	JL
Acetone	< 375	1120.		µg/Kg	375	4/5/14 03:19	88919	1.00	JL
Acrylonitrile	< 121	362.		µg/Kg	121	4/5/14 03:19	88919	1.00	JL
Benzene	< 25	43.4		µg/Kg	14.5	4/5/14 03:19	88919	1.00	JL
Bromodichloromethane	< 25	54.1		µg/Kg	18.0	4/5/14 03:19	88919	1.00	JL
Bromoform	< 25	73.1		µg/Kg	24.4	4/5/14 03:19	88919	1.00	JL
Bromomethane	< 37.5	112.		µg/Kg	37.5	4/5/14 03:19	88919	1.00	JL
Carbon disulfide	< 25	53.4		µg/Kg	17.8	4/5/14 03:19	88919	1.00	JL
Carbon tetrachloride	< 25	59.7		µg/Kg	19.9	4/5/14 03:19	88919	1.00	JL
Chlorobenzene	< 25	23.6		µg/Kg	7.87	4/5/14 03:19	88919	1.00	JL
Chloroethane	< 31.5	94.4		µg/Kg	31.5	4/5/14 03:19	88919	1.00	JL
Chloroform	< 25	32.2		µg/Kg	10.7	4/5/14 03:19	88919	1.00	JL
Chloromethane	< 43.4	130.		µg/Kg	43.4	4/5/14 03:19	88919	1.00	JL
cis-1,2-Dichloroethene	< 25	41.6		µg/Kg	13.9	4/5/14 03:19	88919	1.00	JL
Dibromochloromethane	< 25	45.		µg/Kg	15.0	4/5/14 03:19	88919	1.00	JL
Ethylbenzene	< 25	73.1		µg/Kg	24.4	4/5/14 03:19	88919	1.00	JL
m,p-Xylene	< 61.4	184.		µg/Kg	61.4	4/5/14 03:19	88919	1.00	JL
Methyl tert-butyl ether	< 25	60.3		µg/Kg	20.1	4/5/14 03:19	88919	1.00	JL
Methylene chloride	< 33.6	101.		µg/Kg	33.6	4/5/14 03:19	88919	1.00	JL
o-Xylene	< 26.9	80.6		µg/Kg	26.9	4/5/14 03:19	88919	1.00	JL
Styrene	< 25	35.6		µg/Kg	11.9	4/5/14 03:19	88919	1.00	JL
Tetrachloroethene	< 25	67.5		µg/Kg	22.5	4/5/14 03:19	88919	1.00	JL
Toluene	< 29.6	88.8		µg/Kg	29.6	4/5/14 03:19	88919	1.00	JL
trans-1,2-Dichloroethene	< 25	69.7		µg/Kg	23.2	4/5/14 03:19	88919	1.00	JL
Trichloroethene	< 25	59.1		µg/Kg	19.7	4/5/14 03:19	88919	1.00	JL
Vinyl acetate	< 25	33.4		µg/Kg	11.1	4/5/14 03:19	88919	1.00	JL
Vinyl chloride	< 25	26.6		µg/Kg	8.85	4/5/14 03:19	88919	1.00	JL
1,3-Dichloropropene, Total	< 50	94.7		µg/Kg	31.6	4/5/14 03:19	88919	1.00	JL
Xylenes, Total	< 88.2	265.		µg/Kg	88.2	4/5/14 03:19	88919	1.00	JL
Surrogates:									
1,2-Dichloroethane-d4	102	70-140		%REC	0	4/5/14 03:19	88919	1.00	JL

Qualifiers:

B - Analyte detected in the associated Method Blank
E - Estimated
H - Holding Time Exceeded
S - Spike Recovery outside accepted recovery limits
R - RPD outside accepted recovery limits
J - Analyte detected below quantitation limits

ENVIRONMENTAL MONITORING AND TECHNOLOGIES, INC.

8100 North Austin • Morton Grove, IL 60053-3203
847.967.6666 • 800.246.0663 • fax: 847.967.6735 • www.emt.com

Report of Laboratory Analysis

CLIENT:	EPS Environmental Services, Inc.	**Client Sample ID:**	SB - 2/12'
Lab Order:	14040141	**Report Date:**	4/9/2014
Project:	3122 14th Ave., Kenosha, W	**Collection Date:**	3/31/2014 1:57:00 PM
Lab ID:	14040141-02	**Matrix:**	Soil

Analyses	Result	EMT Reporting Limit	Qual	Units	MDL	Date Analyzed	Batch	DF	Analyst
4-Bromofluorobenzene	111	80-130		%REC	0	4/5/14 03:19	88919	1.00	JL
d4-1,2-Dichlorobenzene	109	80-125		%REC	0	4/5/14 03:19	88919	1.00	JL
Dibromofluoromethane	99.8	80-125		%REC	0	4/5/14 03:19	88919	1.00	JL
Fluorobenzene	96.9	80-120		%REC	0	4/5/14 03:19	88919	1.00	JL
Toluene-d8	98.8	80-120		%REC	0	4/5/14 03:19	88919	1.00	JL

Qualifiers:

B - Analyte detected in the associated Method Blank
E - Estimated
H - Holding Time Exceeded
S - Spike Recovery outside accepted recovery limits
R - RPD outside accepted recovery limits
J - Analyte detected below quantitation limits

ENVIRONMENTAL MONITORING AND TECHNOLOGIES, INC.

8100 North Austin • Morton Grove, IL 60053-3203
847.967.6666 • 800.246.0663 • fax: 847.967.6735 • www.emt.com

Report of Laboratory Analysis

CLIENT:	EPS Environmental Services, Inc.	**Client Sample ID:**	SB - 2/16'
Lab Order:	14040141	**Report Date:**	4/9/2014
Project:	3122 14th Ave., Kenosha, W	**Collection Date:**	3/31/2014 2:05:00 PM
Lab ID:	14040141-03	**Matrix:**	Soil

Analyses	Result	EMT Reporting Limit	Qual	Units	MDL	Date Analyzed	Batch	DF	Analyst
Percent Moisture		**Method:**		**SM2540G**					
Percent Moisture	15.2	0.100		% (Percent)	0.0150	4/4/14 16:15	R200091	1.00	TB2
Polynuclear Aromatic Hydrocarbons		**Method:**		**SW8310 / SW3540C**					
Acenaphthene	< 5	28.9		µg/Kg-dry	5.00	4/7/14	88852	1.00	RYL
Acenaphthylene	< 3.45	144		µg/Kg-dry	3.45	4/7/14	88852	1.00	RYL
Anthracene	< 3.47	28.9		µg/Kg-dry	3.47	4/7/14	88852	1.00	RYL
Benz(a)anthracene	< 3.43	28.9		µg/Kg-dry	3.43	4/7/14	88852	1.00	RYL
Benzo(a)pyrene	< 2.98	28.9		µg/Kg-dry	2.98	4/7/14	88852	1.00	RYL
Benzo(b)fluoranthene	< 3.19	28.9		µg/Kg-dry	3.19	4/7/14	88852	1.00	RYL
Benzo(g,h,i)perylene	< 3.62	28.9		µg/Kg-dry	3.62	4/7/14	88852	1.00	RYL
Benzo(k)fluoranthene	< 2.72	28.9		µg/Kg-dry	2.72	4/7/14	88852	1.00	RYL
Chrysene	< 2.86	28.9		µg/Kg-dry	2.86	4/7/14	88852	1.00	RYL
Dibenz(a,h)anthracene	< 4.27	28.9		µg/Kg-dry	4.27	4/7/14	88852	1.00	RYL
Fluoranthene	< 2.65	28.9		µg/Kg-dry	2.65	4/7/14	88852	1.00	RYL
Fluorene	< 8.22	28.9		µg/Kg-dry	8.22	4/7/14	88852	1.00	RYL
Indeno(1,2,3-cd)pyrene	< 4.62	28.9		µg/Kg-dry	4.62	4/7/14	88852	1.00	RYL
Naphthalene	< 4.06	28.9		µg/Kg-dry	4.06	4/7/14	88852	1.00	RYL
Phenanthrene	25	28.9	J	µg/Kg-dry	6.00	4/7/14	88852	1.00	RYL
Pyrene	< 4.42	28.9		µg/Kg-dry	4.42	4/7/14	88852	1.00	RYL
Surrogates:									
4-Terphenyl-d14	78.8	47.1-125		%REC	0	4/7/14	88852	1.00	RYL
Volatile Organic Compounds by GC/MS		**Method:**		**SW8260B / WDNR: PUBL-FW-140**					
1,1,1-Trichloroethane	< 25	48.		µg/Kg	16.0	4/5/14 03:51	88919	1.00	JL
1,1,2,2-Tetrachloroethane	< 25	46.8		µg/Kg	15.6	4/5/14 03:51	88919	1.00	JL
1,1,2-Trichloroethane	< 25.2	75.6		µg/Kg	25.2	4/5/14 03:51	88919	1.00	JL
1,1-Dichloroethane	< 25	61.8		µg/Kg	20.6	4/5/14 03:51	88919	1.00	JL
1,1-Dichloroethene	< 25	60.9		µg/Kg	20.3	4/5/14 03:51	88919	1.00	JL
1,2-Dibromo-3-chloropropane	< 110	330.		µg/Kg	110	4/5/14 03:51	88919	1.00	JL
1,2-Dibromoethane	< 25	45.3		µg/Kg	15.1	4/5/14 03:51	88919	1.00	JL
1,2-Dichloroethane	< 25	41.4		µg/Kg	13.8	4/5/14 03:51	88919	1.00	JL
1,2-Dichloropropane	< 29.8	89.4		µg/Kg	29.8	4/5/14 03:51	88919	1.00	JL
1-Butanol	< 1500	4500.		µg/Kg	1,500	4/5/14 03:51	88919	1.00	JL

Qualifiers:

B - Analyte detected in the associated Method Blank
E - Estimated
H - Holding Time Exceeded
S - Spike Recovery outside accepted recovery limits
R - RPD outside accepted recovery limits
J - Analyte detected below quantitation limits

ENVIRONMENTAL MONITORING AND TECHNOLOGIES, INC.

8100 North Austin • Morton Grove, IL 60053-3203
847.967.6666 • 800.246.0663 • fax: 847.967.6735 • www.emt.com

Report of Laboratory Analysis

CLIENT:	EPS Environmental Services, Inc.	**Client Sample ID:**	SB - 2/16'
Lab Order:	14040141	**Report Date:**	4/9/2014
Project:	3122 14th Ave., Kenosha, W	**Collection Date:**	3/31/2014 2:05:00 PM
Lab ID:	14040141-03	**Matrix:**	Soil

Analyses	Result	EMT Reporting Limit	Qual	Units	MDL	Date Analyzed	Batch	DF	Analyst
2-Butanone	< 306	918.		µg/Kg	306	4/5/14 03:51	88919	1.00	JL
2-Hexanone	< 37.6	113.		µg/Kg	37.6	4/5/14 03:51	88919	1.00	JL
4-Methyl-2-pentanone	< 136	408.		µg/Kg	136	4/5/14 03:51	88919	1.00	JL
Acetone	< 360	1080.		µg/Kg	360	4/5/14 03:51	88919	1.00	JL
Acrylonitrile	< 116	348.		µg/Kg	116	4/5/14 03:51	88919	1.00	JL
Benzene	< 25	41.7		µg/Kg	13.9	4/5/14 03:51	88919	1.00	JL
Bromodichloromethane	< 25	51.9		µg/Kg	17.3	4/5/14 03:51	88919	1.00	JL
Bromoform	< 25	70.2		µg/Kg	23.4	4/5/14 03:51	88919	1.00	JL
Bromomethane	< 36	108.		µg/Kg	36.0	4/5/14 03:51	88919	1.00	JL
Carbon disulfide	< 25	51.3		µg/Kg	17.1	4/5/14 03:51	88919	1.00	JL
Carbon tetrachloride	< 25	57.3		µg/Kg	19.1	4/5/14 03:51	88919	1.00	JL
Chlorobenzene	< 25	22.7		µg/Kg	7.56	4/5/14 03:51	88919	1.00	JL
Chloroethane	< 30.2	90.6		µg/Kg	30.2	4/5/14 03:51	88919	1.00	JL
Chloroform	< 25	30.9		µg/Kg	10.3	4/5/14 03:51	88919	1.00	JL
Chloromethane	< 41.7	125.		µg/Kg	41.7	4/5/14 03:51	88919	1.00	JL
cis-1,2-Dichloroethene	< 25	39.9		µg/Kg	13.3	4/5/14 03:51	88919	1.00	JL
Dibromochloromethane	< 25	43.2		µg/Kg	14.4	4/5/14 03:51	88919	1.00	JL
Ethylbenzene	< 25	70.2		µg/Kg	23.4	4/5/14 03:51	88919	1.00	JL
m,p-Xylene	< 58.9	177.		µg/Kg	58.9	4/5/14 03:51	88919	1.00	JL
Methyl tert-butyl ether	< 25	57.9		µg/Kg	19.3	4/5/14 03:51	88919	1.00	JL
Methylene chloride	< 32.3	96.9		µg/Kg	32.3	4/5/14 03:51	88919	1.00	JL
o-Xylene	< 25.8	77.4		µg/Kg	25.8	4/5/14 03:51	88919	1.00	JL
Styrene	< 25	34.2		µg/Kg	11.4	4/5/14 03:51	88919	1.00	JL
Tetrachloroethene	< 25	64.8		µg/Kg	21.6	4/5/14 03:51	88919	1.00	JL
Toluene	< 28.4	85.2		µg/Kg	28.4	4/5/14 03:51	88919	1.00	JL
trans-1,2-Dichloroethene	< 25	66.9		µg/Kg	22.3	4/5/14 03:51	88919	1.00	JL
Trichloroethene	< 25	56.7		µg/Kg	18.9	4/5/14 03:51	88919	1.00	JL
Vinyl acetate	< 25	32.1		µg/Kg	10.7	4/5/14 03:51	88919	1.00	JL
Vinyl chloride	< 25	25.5		µg/Kg	8.50	4/5/14 03:51	88919	1.00	JL
1,3-Dichloropropene, Total	< 50	90.9		µg/Kg	30.3	4/5/14 03:51	88919	1.00	JL
Xylenes, Total	< 84.7	254.		µg/Kg	84.7	4/5/14 03:51	88919	1.00	JL
Surrogates:									
1,2-Dichloroethane-d4	96.5	70-140		%REC	0	4/5/14 03:51	88919	1.00	JL

Qualifiers:

B - Analyte detected in the associated Method Blank
E - Estimated
H - Holding Time Exceeded
S - Spike Recovery outside accepted recovery limits
R - RPD outside accepted recovery limits
J - Analyte detected below quantitation limits

ENVIRONMENTAL MONITORING AND TECHNOLOGIES, INC.

8100 North Austin • Morton Grove, IL 60053-3203
847.967.6666 • 800.246.0663 • fax: 847.967.6735 • www.emt.com

Report of Laboratory Analysis

CLIENT:	EPS Environmental Services, Inc.	**Client Sample ID:**	SB - 2/16'
Lab Order:	14040141	**Report Date:**	4/9/2014
Project:	3122 14th Ave., Kenosha, W	**Collection Date:**	3/31/2014 2:05:00 PM
Lab ID:	14040141-03	**Matrix:**	Soil

Analyses	Result	EMT Reporting Limit	Qual	Units	MDL	Date Analyzed	Batch	DF	Analyst
4-Bromofluorobenzene	112	80-130		%REC	0	4/5/14 03:51	88919	1.00	JL
d4-1,2-Dichlorobenzene	110	80-125		%REC	0	4/5/14 03:51	88919	1.00	JL
Dibromofluoromethane	98.8	80-125		%REC	0	4/5/14 03:51	88919	1.00	JL
Fluorobenzene	99.2	80-120		%REC	0	4/5/14 03:51	88919	1.00	JL
Toluene-d8	98.9	80-120		%REC	0	4/5/14 03:51	88919	1.00	JL

Qualifiers:

B - Analyte detected in the associated Method Blank
E - Estimated
H - Holding Time Exceeded
S - Spike Recovery outside accepted recovery limits
R - RPD outside accepted recovery limits
J - Analyte detected below quantitation limits

ENVIRONMENTAL MONITORING AND TECHNOLOGIES, INC.

8100 North Austin • Morton Grove, IL 60053-3203
847.967.6666 • 800.246.0663 • fax: 847.967.6735 • www.emt.com

Report of Laboratory Analysis

CLIENT:	EPS Environmental Services, Inc.	**Client Sample ID:**	SB - 3/6'
Lab Order:	14040141	**Report Date:**	4/9/2014
Project:	3122 14th Ave., Kenosha, W	**Collection Date:**	3/31/2014 2:48:00 PM
Lab ID:	14040141-04	**Matrix:**	Soil

Analyses	Result	EMT Reporting Limit	Qual	Units	MDL	Date Analyzed	Batch	DF	Analyst
Percent Moisture		**Method:**		**SM2540G**					
Percent Moisture	17.3	0.100		% (Percent)	0.0150	4/4/14 16:15	R200091	1.00	TB2
Polynuclear Aromatic Hydrocarbons		**Method:**		**SW8310 / SW3540C**					
Acenaphthene	< 5.04	29.1		µg/Kg-dry	5.04	4/7/14	88852	1.00	RYL
Acenaphthylene	< 3.48	146		µg/Kg-dry	3.48	4/7/14	88852	1.00	RYL
Anthracene	< 3.51	29.1		µg/Kg-dry	3.51	4/7/14	88852	1.00	RYL
Benz(a)anthracene	< 3.46	29.1		µg/Kg-dry	3.46	4/7/14	88852	1.00	RYL
Benzo(a)pyrene	< 3.01	29.1		µg/Kg-dry	3.01	4/7/14	88852	1.00	RYL
Benzo(b)fluoranthene	< 3.22	29.1		µg/Kg-dry	3.22	4/7/14	88852	1.00	RYL
Benzo(g,h,i)perylene	< 3.66	29.1		µg/Kg-dry	3.66	4/7/14	88852	1.00	RYL
Benzo(k)fluoranthene	< 2.75	29.1		µg/Kg-dry	2.75	4/7/14	88852	1.00	RYL
Chrysene	< 2.89	29.1		µg/Kg-dry	2.89	4/7/14	88852	1.00	RYL
Dibenz(a,h)anthracene	< 4.31	29.1		µg/Kg-dry	4.31	4/7/14	88852	1.00	RYL
Fluoranthene	< 2.68	29.1		µg/Kg-dry	2.68	4/7/14	88852	1.00	RYL
Fluorene	< 8.29	29.1		µg/Kg-dry	8.29	4/7/14	88852	1.00	RYL
Indeno(1,2,3-cd)pyrene	< 4.66	29.1		µg/Kg-dry	4.66	4/7/14	88852	1.00	RYL
Naphthalene	< 4.1	29.1		µg/Kg-dry	4.10	4/7/14	88852	1.00	RYL
Phenanthrene	< 6.06	29.1		µg/Kg-dry	6.06	4/7/14	88852	1.00	RYL
Pyrene	< 4.46	29.1		µg/Kg-dry	4.46	4/7/14	88852	1.00	RYL
Surrogates:									
4-Terphenyl-d14	90.1	47.1-125		%REC	0	4/7/14	88852	1.00	RYL
Volatile Organic Compounds by GC/MS		**Method:**		**SW8260B / WDNR: PUBL-FW-140**					
1,1,1-Trichloroethane	< 25	48.		µg/Kg	16.0	4/5/14 04:23	88919	1.00	JL
1,1,2,2-Tetrachloroethane	< 25	46.8		µg/Kg	15.6	4/5/14 04:23	88919	1.00	JL
1,1,2-Trichloroethane	< 25.2	75.6		µg/Kg	25.2	4/5/14 04:23	88919	1.00	JL
1,1-Dichloroethane	< 25	61.8		µg/Kg	20.6	4/5/14 04:23	88919	1.00	JL
1,1-Dichloroethene	< 25	60.9		µg/Kg	20.3	4/5/14 04:23	88919	1.00	JL
1,2-Dibromo-3-chloropropane	< 110	330.		µg/Kg	110	4/5/14 04:23	88919	1.00	JL
1,2-Dibromoethane	< 25	45.3		µg/Kg	15.1	4/5/14 04:23	88919	1.00	JL
1,2-Dichloroethane	< 25	41.4		µg/Kg	13.8	4/5/14 04:23	88919	1.00	JL
1,2-Dichloropropane	< 29.8	89.4		µg/Kg	29.8	4/5/14 04:23	88919	1.00	JL
1-Butanol	< 1500	4500.		µg/Kg	1,500	4/5/14 04:23	88919	1.00	JL

Qualifiers:

B - Analyte detected in the associated Method Blank
E - Estimated
H - Holding Time Exceeded
S - Spike Recovery outside accepted recovery limits
R - RPD outside accepted recovery limits
J - Analyte detected below quantitation limits

ENVIRONMENTAL MONITORING AND TECHNOLOGIES, INC.

8100 North Austin • Morton Grove, IL 60053-3203
847.967.6666 • 800.246.0663 • fax: 847.967.6735 • www.emt.com

Report of Laboratory Analysis

CLIENT:	EPS Environmental Services, Inc.	**Client Sample ID:**	SB - 3/6'
Lab Order:	14040141	**Report Date:**	4/9/2014
Project:	3122 14th Ave., Kenosha, W	**Collection Date:**	3/31/2014 2:48:00 PM
Lab ID:	14040141-04	**Matrix:**	Soil

Analyses	Result	EMT Reporting Limit	Qual	Units	MDL	Date Analyzed	Batch	DF	Analyst
2-Butanone	< 306	918.		µg/Kg	306	4/5/14 04:23	88919	1.00	JL
2-Hexanone	< 37.6	113.		µg/Kg	37.6	4/5/14 04:23	88919	1.00	JL
4-Methyl-2-pentanone	< 136	408.		µg/Kg	136	4/5/14 04:23	88919	1.00	JL
Acetone	< 360	1080.		µg/Kg	360	4/5/14 04:23	88919	1.00	JL
Acrylonitrile	< 116	348.		µg/Kg	116	4/5/14 04:23	88919	1.00	JL
Benzene	< 25	41.7		µg/Kg	13.9	4/5/14 04:23	88919	1.00	JL
Bromodichloromethane	< 25	51.9		µg/Kg	17.3	4/5/14 04:23	88919	1.00	JL
Bromoform	< 25	70.2		µg/Kg	23.4	4/5/14 04:23	88919	1.00	JL
Bromomethane	< 36	108.		µg/Kg	36.0	4/5/14 04:23	88919	1.00	JL
Carbon disulfide	< 25	51.3		µg/Kg	17.1	4/5/14 04:23	88919	1.00	JL
Carbon tetrachloride	< 25	57.3		µg/Kg	19.1	4/5/14 04:23	88919	1.00	JL
Chlorobenzene	< 25	22.7		µg/Kg	7.56	4/5/14 04:23	88919	1.00	JL
Chloroethane	< 30.2	90.6		µg/Kg	30.2	4/5/14 04:23	88919	1.00	JL
Chloroform	< 25	30.9		µg/Kg	10.3	4/5/14 04:23	88919	1.00	JL
Chloromethane	< 41.7	125.		µg/Kg	41.7	4/5/14 04:23	88919	1.00	JL
cis-1,2-Dichloroethene	< 25	39.9		µg/Kg	13.3	4/5/14 04:23	88919	1.00	JL
Dibromochloromethane	< 25	43.2		µg/Kg	14.4	4/5/14 04:23	88919	1.00	JL
Ethylbenzene	< 25	70.2		µg/Kg	23.4	4/5/14 04:23	88919	1.00	JL
m,p-Xylene	< 58.9	177.		µg/Kg	58.9	4/5/14 04:23	88919	1.00	JL
Methyl tert-butyl ether	< 25	57.9		µg/Kg	19.3	4/5/14 04:23	88919	1.00	JL
Methylene chloride	< 32.3	96.9		µg/Kg	32.3	4/5/14 04:23	88919	1.00	JL
o-Xylene	< 25.8	77.4		µg/Kg	25.8	4/5/14 04:23	88919	1.00	JL
Styrene	< 25	34.2		µg/Kg	11.4	4/5/14 04:23	88919	1.00	JL
Tetrachloroethene	< 25	64.8		µg/Kg	21.6	4/5/14 04:23	88919	1.00	JL
Toluene	< 28.4	85.2		µg/Kg	28.4	4/5/14 04:23	88919	1.00	JL
trans-1,2-Dichloroethene	< 25	66.9		µg/Kg	22.3	4/5/14 04:23	88919	1.00	JL
Trichloroethene	< 25	56.7		µg/Kg	18.9	4/5/14 04:23	88919	1.00	JL
Vinyl acetate	< 25	32.1		µg/Kg	10.7	4/5/14 04:23	88919	1.00	JL
Vinyl chloride	< 25	25.5		µg/Kg	8.50	4/5/14 04:23	88919	1.00	JL
1,3-Dichloropropene, Total	< 50	90.9		µg/Kg	30.3	4/5/14 04:23	88919	1.00	JL
Xylenes, Total	< 84.7	254.		µg/Kg	84.7	4/5/14 04:23	88919	1.00	JL
Surrogates:									
1,2-Dichloroethane-d4	96.6	70-140		%REC	0	4/5/14 04:23	88919	1.00	JL

Qualifiers:

B - Analyte detected in the associated Method Blank
E - Estimated
H - Holding Time Exceeded
S - Spike Recovery outside accepted recovery limits
R - RPD outside accepted recovery limits
J - Analyte detected below quantitation limits

ENVIRONMENTAL MONITORING AND TECHNOLOGIES, INC.

8100 North Austin • Morton Grove, IL 60053-3203
847.967.6666 • 800.246.0663 • fax: 847.967.6735 • www.emt.com

Report of Laboratory Analysis

CLIENT:	EPS Environmental Services, Inc.	**Client Sample ID:**	SB - 3/6'
Lab Order:	14040141	**Report Date:**	4/9/2014
Project:	3122 14th Ave., Kenosha, W	**Collection Date:**	3/31/2014 2:48:00 PM
Lab ID:	14040141-04	**Matrix:**	Soil

Analyses	Result	EMT Reporting Limit	Qual	Units	MDL	Date Analyzed	Batch	DF	Analyst
4-Bromofluorobenzene	110	80-130		%REC	0	4/5/14 04:23	88919	1.00	JL
d4-1,2-Dichlorobenzene	107	80-125		%REC	0	4/5/14 04:23	88919	1.00	JL
Dibromofluoromethane	101	80-125		%REC	0	4/5/14 04:23	88919	1.00	JL
Fluorobenzene	100	80-120		%REC	0	4/5/14 04:23	88919	1.00	JL
Toluene-d8	98.4	80-120		%REC	0	4/5/14 04:23	88919	1.00	JL

Qualifiers:

B - Analyte detected in the associated Method Blank
E - Estimated
H - Holding Time Exceeded
S - Spike Recovery outside accepted recovery limits
R - RPD outside accepted recovery limits
J - Analyte detected below quantitation limits

ENVIRONMENTAL MONITORING AND TECHNOLOGIES, INC.

8100 North Austin • Morton Grove, IL 60053-3203
847.967.6666 • 800.246.0663 • fax: 847.967.6735 • www.emt.com

Report of Laboratory Analysis

CLIENT:	EPS Environmental Services, Inc.	**Client Sample ID:**	SB - 4/6'
Lab Order:	14040141	**Report Date:**	4/9/2014
Project:	3122 14th Ave., Kenosha, W	**Collection Date:**	4/1/2014 8:30:00 AM
Lab ID:	14040141-05	**Matrix:**	Soil

Analyses	Result	EMT Reporting Limit	Qual	Units	MDL	Date Analyzed	Batch	DF	Analyst
Percent Moisture		**Method:**		**SM2540G**					
Percent Moisture	21.2	0.100		% (Percent)	0.0150	4/4/14 16:15	R200091	1.00	TB2
Polynuclear Aromatic Hydrocarbons		**Method:**		**SW8310 / SW3540C**					
Acenaphthene	< 5.37	31.0		µg/Kg-dry	5.37	4/7/14	88852	1.00	RYL
Acenaphthylene	< 3.71	155		µg/Kg-dry	3.71	4/7/14	88852	1.00	RYL
Anthracene	< 3.74	31.0		µg/Kg-dry	3.74	4/7/14	88852	1.00	RYL
Benz(a)anthracene	< 3.69	31.0		µg/Kg-dry	3.69	4/7/14	88852	1.00	RYL
Benzo(a)pyrene	< 3.2	31.0		µg/Kg-dry	3.20	4/7/14	88852	1.00	RYL
Benzo(b)fluoranthene	< 3.43	31.0		µg/Kg-dry	3.43	4/7/14	88852	1.00	RYL
Benzo(g,h,i)perylene	< 3.9	31.0		µg/Kg-dry	3.90	4/7/14	88852	1.00	RYL
Benzo(k)fluoranthene	< 2.93	31.0		µg/Kg-dry	2.93	4/7/14	88852	1.00	RYL
Chrysene	< 3.08	31.0		µg/Kg-dry	3.08	4/7/14	88852	1.00	RYL
Dibenz(a,h)anthracene	< 4.59	31.0		µg/Kg-dry	4.59	4/7/14	88852	1.00	RYL
Fluoranthene	< 2.85	31.0		µg/Kg-dry	2.85	4/7/14	88852	1.00	RYL
Fluorene	< 8.84	31.0		µg/Kg-dry	8.84	4/7/14	88852	1.00	RYL
Indeno(1,2,3-cd)pyrene	< 4.96	31.0		µg/Kg-dry	4.96	4/7/14	88852	1.00	RYL
Naphthalene	< 4.37	31.0		µg/Kg-dry	4.37	4/7/14	88852	1.00	RYL
Phenanthrene	< 6.45	31.0		µg/Kg-dry	6.45	4/7/14	88852	1.00	RYL
Pyrene	< 4.75	31.0		µg/Kg-dry	4.75	4/7/14	88852	1.00	RYL
Surrogates:									
4-Terphenyl-d14	67.1	47.1-125		%REC	0	4/7/14	88852	1.00	RYL
Volatile Organic Compounds by GC/MS		**Method:**		**SW8260B / WDNR: PUBL-FW-140**					
1,1,1-Trichloroethane	< 25	48.		µg/Kg	16.0	4/5/14 04:55	88919	1.00	JL
1,1,2,2-Tetrachloroethane	< 25	46.8		µg/Kg	15.6	4/5/14 04:55	88919	1.00	JL
1,1,2-Trichloroethane	< 25.2	75.6		µg/Kg	25.2	4/5/14 04:55	88919	1.00	JL
1,1-Dichloroethane	< 25	61.8		µg/Kg	20.6	4/5/14 04:55	88919	1.00	JL
1,1-Dichloroethene	< 25	60.9		µg/Kg	20.3	4/5/14 04:55	88919	1.00	JL
1,2-Dibromo-3-chloropropane	< 110	330.		µg/Kg	110	4/5/14 04:55	88919	1.00	JL
1,2-Dibromoethane	< 25	45.3		µg/Kg	15.1	4/5/14 04:55	88919	1.00	JL
1,2-Dichloroethane	< 25	41.4		µg/Kg	13.8	4/5/14 04:55	88919	1.00	JL
1,2-Dichloropropane	< 29.8	89.4		µg/Kg	29.8	4/5/14 04:55	88919	1.00	JL
1-Butanol	< 1500	4500.		µg/Kg	1,500	4/5/14 04:55	88919	1.00	JL

Qualifiers:

B - Analyte detected in the associated Method Blank
E - Estimated
H - Holding Time Exceeded
S - Spike Recovery outside accepted recovery limits
R - RPD outside accepted recovery limits
J - Analyte detected below quantitation limits

ENVIRONMENTAL MONITORING AND TECHNOLOGIES, INC.

8100 North Austin • Morton Grove, IL 60053-3203
847.967.6666 • 800.246.0663 • fax: 847.967.6735 • www.emt.com

Report of Laboratory Analysis

CLIENT:	EPS Environmental Services, Inc.	**Client Sample ID:**	SB - 4/6'
Lab Order:	14040141	**Report Date:**	4/9/2014
Project:	3122 14th Ave., Kenosha, W	**Collection Date:**	4/1/2014 8:30:00 AM
Lab ID:	14040141-05	**Matrix:**	Soil

Analyses	Result	EMT Reporting Limit	Qual	Units	MDL	Date Analyzed	Batch	DF	Analyst
2-Butanone	< 306	918.		µg/Kg	306	4/5/14 04:55	88919	1.00	JL
2-Hexanone	< 37.6	113.		µg/Kg	37.6	4/5/14 04:55	88919	1.00	JL
4-Methyl-2-pentanone	< 136	408.		µg/Kg	136	4/5/14 04:55	88919	1.00	JL
Acetone	< 360	1080.		µg/Kg	360	4/5/14 04:55	88919	1.00	JL
Acrylonitrile	< 116	348.		µg/Kg	116	4/5/14 04:55	88919	1.00	JL
Benzene	< 25	41.7		µg/Kg	13.9	4/5/14 04:55	88919	1.00	JL
Bromodichloromethane	< 25	51.9		µg/Kg	17.3	4/5/14 04:55	88919	1.00	JL
Bromoform	< 25	70.2		µg/Kg	23.4	4/5/14 04:55	88919	1.00	JL
Bromomethane	< 36	108.		µg/Kg	36.0	4/5/14 04:55	88919	1.00	JL
Carbon disulfide	< 25	51.3		µg/Kg	17.1	4/5/14 04:55	88919	1.00	JL
Carbon tetrachloride	< 25	57.3		µg/Kg	19.1	4/5/14 04:55	88919	1.00	JL
Chlorobenzene	< 25	22.7		µg/Kg	7.56	4/5/14 04:55	88919	1.00	JL
Chloroethane	< 30.2	90.6		µg/Kg	30.2	4/5/14 04:55	88919	1.00	JL
Chloroform	< 25	30.9		µg/Kg	10.3	4/5/14 04:55	88919	1.00	JL
Chloromethane	< 41.7	125.		µg/Kg	41.7	4/5/14 04:55	88919	1.00	JL
cis-1,2-Dichloroethene	< 25	39.9		µg/Kg	13.3	4/5/14 04:55	88919	1.00	JL
Dibromochloromethane	< 25	43.2		µg/Kg	14.4	4/5/14 04:55	88919	1.00	JL
Ethylbenzene	< 25	70.2		µg/Kg	23.4	4/5/14 04:55	88919	1.00	JL
m,p-Xylene	< 58.9	177.		µg/Kg	58.9	4/5/14 04:55	88919	1.00	JL
Methyl tert-butyl ether	< 25	57.9		µg/Kg	19.3	4/5/14 04:55	88919	1.00	JL
Methylene chloride	< 32.3	96.9		µg/Kg	32.3	4/5/14 04:55	88919	1.00	JL
o-Xylene	< 25.8	77.4		µg/Kg	25.8	4/5/14 04:55	88919	1.00	JL
Styrene	< 25	34.2		µg/Kg	11.4	4/5/14 04:55	88919	1.00	JL
Tetrachloroethene	< 25	64.8		µg/Kg	21.6	4/5/14 04:55	88919	1.00	JL
Toluene	< 28.4	85.2		µg/Kg	28.4	4/5/14 04:55	88919	1.00	JL
trans-1,2-Dichloroethene	< 25	66.9		µg/Kg	22.3	4/5/14 04:55	88919	1.00	JL
Trichloroethene	< 25	56.7		µg/Kg	18.9	4/5/14 04:55	88919	1.00	JL
Vinyl acetate	< 25	32.1		µg/Kg	10.7	4/5/14 04:55	88919	1.00	JL
Vinyl chloride	< 25	25.5		µg/Kg	8.50	4/5/14 04:55	88919	1.00	JL
1,3-Dichloropropene, Total	< 50	90.9		µg/Kg	30.3	4/5/14 04:55	88919	1.00	JL
Xylenes, Total	< 84.7	254.		µg/Kg	84.7	4/5/14 04:55	88919	1.00	JL
Surrogates:									
1,2-Dichloroethane-d4	94.4	70-140		%REC	0	4/5/14 04:55	88919	1.00	JL

Qualifiers:

B - Analyte detected in the associated Method Blank
E - Estimated
H - Holding Time Exceeded
S - Spike Recovery outside accepted recovery limits
R - RPD outside accepted recovery limits
J - Analyte detected below quantitation limits

ENVIRONMENTAL MONITORING AND TECHNOLOGIES, INC.

8100 North Austin • Morton Grove, IL 60053-3203
847.967.6666 • 800.246.0663 • fax: 847.967.6735 • www.emt.com

Report of Laboratory Analysis

CLIENT:	EPS Environmental Services, Inc.	**Client Sample ID:**	SB - 4/6'
Lab Order:	14040141	**Report Date:**	4/9/2014
Project:	3122 14th Ave., Kenosha, W	**Collection Date:**	4/1/2014 8:30:00 AM
Lab ID:	14040141-05	**Matrix:**	Soil

Analyses	Result	EMT Reporting Limit	Qual	Units	MDL	Date Analyzed	Batch	DF	Analyst
4-Bromofluorobenzene	114	80-130		%REC	0	4/5/14 04:55	88919	1.00	JL
d4-1,2-Dichlorobenzene	111	80-125		%REC	0	4/5/14 04:55	88919	1.00	JL
Dibromofluoromethane	101	80-125		%REC	0	4/5/14 04:55	88919	1.00	JL
Fluorobenzene	99.0	80-120		%REC	0	4/5/14 04:55	88919	1.00	JL
Toluene-d8	102	80-120		%REC	0	4/5/14 04:55	88919	1.00	JL

Qualifiers:

B - Analyte detected in the associated Method Blank
E - Estimated
H - Holding Time Exceeded
S - Spike Recovery outside accepted recovery limits
R - RPD outside accepted recovery limits
J - Analyte detected below quantitation limits

ENVIRONMENTAL MONITORING AND TECHNOLOGIES, INC.

8100 North Austin • Morton Grove, IL 60053-3203
847.967.6666 • 800.246.0663 • fax: 847.967.6735 • www.emt.com

Report of Laboratory Analysis

CLIENT:	EPS Environmental Services, Inc.	**Client Sample ID:**	SB - 4/15'
Lab Order:	14040141	**Report Date:**	4/9/2014
Project:	3122 14th Ave., Kenosha, W	**Collection Date:**	4/1/2014 9:00:00 AM
Lab ID:	14040141-06	**Matrix:**	Soil

Analyses	Result	EMT Reporting Limit	Qual	Units	MDL	Date Analyzed	Batch	DF	Analyst
Percent Moisture		**Method:**		**SM2540G**					
Percent Moisture	14.1	0.100		% (Percent)	0.0150	4/7/14 10:00	R200150	1.00	TB2
Polynuclear Aromatic Hydrocarbons		**Method:**		**SW8310 / SW3540C**					
Acenaphthene	< 4.94	28.5		µg/Kg-dry	4.94	4/8/14	88852	1.00	RYL
Acenaphthylene	< 3.41	142		µg/Kg-dry	3.41	4/8/14	88852	1.00	RYL
Anthracene	< 3.43	28.5		µg/Kg-dry	3.43	4/8/14	88852	1.00	RYL
Benz(a)anthracene	< 3.39	28.5		µg/Kg-dry	3.39	4/8/14	88852	1.00	RYL
Benzo(a)pyrene	< 2.94	28.5		µg/Kg-dry	2.94	4/8/14	88852	1.00	RYL
Benzo(b)fluoranthene	< 3.15	28.5		µg/Kg-dry	3.15	4/8/14	88852	1.00	RYL
Benzo(g,h,i)perylene	< 3.58	28.5		µg/Kg-dry	3.58	4/8/14	88852	1.00	RYL
Benzo(k)fluoranthene	< 2.69	28.5		µg/Kg-dry	2.69	4/8/14	88852	1.00	RYL
Chrysene	< 2.83	28.5		µg/Kg-dry	2.83	4/8/14	88852	1.00	RYL
Dibenz(a,h)anthracene	< 4.22	28.5		µg/Kg-dry	4.22	4/8/14	88852	1.00	RYL
Fluoranthene	< 2.62	28.5		µg/Kg-dry	2.62	4/8/14	88852	1.00	RYL
Fluorene	< 8.12	28.5		µg/Kg-dry	8.12	4/8/14	88852	1.00	RYL
Indeno(1,2,3-cd)pyrene	< 4.56	28.5		µg/Kg-dry	4.56	4/8/14	88852	1.00	RYL
Naphthalene	< 4.01	28.5		µg/Kg-dry	4.01	4/8/14	88852	1.00	RYL
Phenanthrene	< 5.93	28.5		µg/Kg-dry	5.93	4/8/14	88852	1.00	RYL
Pyrene	< 4.37	28.5		µg/Kg-dry	4.37	4/8/14	88852	1.00	RYL
Surrogates:									
4-Terphenyl-d14	82.5	47.1-125		%REC	0	4/8/14	88852	1.00	RYL
Volatile Organic Compounds by GC/MS		**Method:**		**SW8260B / WDNR: PUBL-FW-140**					
1,1,1-Trichloroethane	< 25	50.		µg/Kg	16.7	4/5/14 05:27	88919	1.00	JL
1,1,2,2-Tetrachloroethane	< 25	48.7		µg/Kg	16.2	4/5/14 05:27	88919	1.00	JL
1,1,2-Trichloroethane	< 26.2	78.7		µg/Kg	26.2	4/5/14 05:27	88919	1.00	JL
1,1-Dichloroethane	< 25	64.4		µg/Kg	21.5	4/5/14 05:27	88919	1.00	JL
1,1-Dichloroethene	< 25	63.4		µg/Kg	21.1	4/5/14 05:27	88919	1.00	JL
1,2-Dibromo-3-chloropropane	< 115	344.		µg/Kg	115	4/5/14 05:27	88919	1.00	JL
1,2-Dibromoethane	< 25	47.2		µg/Kg	15.7	4/5/14 05:27	88919	1.00	JL
1,2-Dichloroethane	< 25	43.1		µg/Kg	14.4	4/5/14 05:27	88919	1.00	JL
1,2-Dichloropropane	< 31	93.1		µg/Kg	31.0	4/5/14 05:27	88919	1.00	JL
1-Butanol	< 1560	4690.		µg/Kg	1,560	4/5/14 05:27	88919	1.00	JL

Qualifiers:

B - Analyte detected in the associated Method Blank
E - Estimated
H - Holding Time Exceeded
S - Spike Recovery outside accepted recovery limits
R - RPD outside accepted recovery limits
J - Analyte detected below quantitation limits

ENVIRONMENTAL MONITORING AND TECHNOLOGIES, INC.

8100 North Austin • Morton Grove, IL 60053-3203
847.967.6666 • 800.246.0663 • fax: 847.967.6735 • www.emt.com

Report of Laboratory Analysis

CLIENT:	EPS Environmental Services, Inc.	**Client Sample ID:**	SB - 4/15'
Lab Order:	14040141	**Report Date:**	4/9/2014
Project:	3122 14th Ave., Kenosha, W	**Collection Date:**	4/1/2014 9:00:00 AM
Lab ID:	14040141-06	**Matrix:**	Soil

Analyses	Result	EMT Reporting Limit	Qual	Units	MDL	Date Analyzed	Batch	DF	Analyst
2-Butanone	< 319	956.		µg/Kg	319	4/5/14 05:27	88919	1.00	JL
2-Hexanone	< 39.2	118.		µg/Kg	39.2	4/5/14 05:27	88919	1.00	JL
4-Methyl-2-pentanone	< 142	425.		µg/Kg	142	4/5/14 05:27	88919	1.00	JL
Acetone	< 375	1120.		µg/Kg	375	4/5/14 05:27	88919	1.00	JL
Acrylonitrile	< 121	362.		µg/Kg	121	4/5/14 05:27	88919	1.00	JL
Benzene	< 25	43.4		µg/Kg	14.5	4/5/14 05:27	88919	1.00	JL
Bromodichloromethane	< 25	54.1		µg/Kg	18.0	4/5/14 05:27	88919	1.00	JL
Bromoform	< 25	73.1		µg/Kg	24.4	4/5/14 05:27	88919	1.00	JL
Bromomethane	< 37.5	112.		µg/Kg	37.5	4/5/14 05:27	88919	1.00	JL
Carbon disulfide	< 25	53.4		µg/Kg	17.8	4/5/14 05:27	88919	1.00	JL
Carbon tetrachloride	< 25	59.7		µg/Kg	19.9	4/5/14 05:27	88919	1.00	JL
Chlorobenzene	< 25	23.6		µg/Kg	7.87	4/5/14 05:27	88919	1.00	JL
Chloroethane	< 31.5	94.4		µg/Kg	31.5	4/5/14 05:27	88919	1.00	JL
Chloroform	< 25	32.2		µg/Kg	10.7	4/5/14 05:27	88919	1.00	JL
Chloromethane	< 43.4	130.		µg/Kg	43.4	4/5/14 05:27	88919	1.00	JL
cis-1,2-Dichloroethene	< 25	41.6		µg/Kg	13.9	4/5/14 05:27	88919	1.00	JL
Dibromochloromethane	< 25	45.		µg/Kg	15.0	4/5/14 05:27	88919	1.00	JL
Ethylbenzene	< 25	73.1		µg/Kg	24.4	4/5/14 05:27	88919	1.00	JL
m,p-Xylene	< 61.4	184.		µg/Kg	61.4	4/5/14 05:27	88919	1.00	JL
Methyl tert-butyl ether	< 25	60.3		µg/Kg	20.1	4/5/14 05:27	88919	1.00	JL
Methylene chloride	< 33.6	101.		µg/Kg	33.6	4/5/14 05:27	88919	1.00	JL
o-Xylene	< 26.9	80.6		µg/Kg	26.9	4/5/14 05:27	88919	1.00	JL
Styrene	< 25	35.6		µg/Kg	11.9	4/5/14 05:27	88919	1.00	JL
Tetrachloroethene	< 25	67.5		µg/Kg	22.5	4/5/14 05:27	88919	1.00	JL
Toluene	< 29.6	88.8		µg/Kg	29.6	4/5/14 05:27	88919	1.00	JL
trans-1,2-Dichloroethene	< 25	69.7		µg/Kg	23.2	4/5/14 05:27	88919	1.00	JL
Trichloroethene	< 25	59.1		µg/Kg	19.7	4/5/14 05:27	88919	1.00	JL
Vinyl acetate	< 25	33.4		µg/Kg	11.1	4/5/14 05:27	88919	1.00	JL
Vinyl chloride	< 25	26.6		µg/Kg	8.85	4/5/14 05:27	88919	1.00	JL
1,3-Dichloropropene, Total	< 50	94.7		µg/Kg	31.6	4/5/14 05:27	88919	1.00	JL
Xylenes, Total	< 88.2	265.		µg/Kg	88.2	4/5/14 05:27	88919	1.00	JL
Surrogates:									
1,2-Dichloroethane-d4	97.7	70-140		%REC	0	4/5/14 05:27	88919	1.00	JL

Qualifiers:

B - Analyte detected in the associated Method Blank
E - Estimated
H - Holding Time Exceeded
S - Spike Recovery outside accepted recovery limits
R - RPD outside accepted recovery limits
J - Analyte detected below quantitation limits

ENVIRONMENTAL MONITORING AND TECHNOLOGIES, INC.

8100 North Austin • Morton Grove, IL 60053-3203
847.967.6666 • 800.246.0663 • fax: 847.967.6735 • www.emt.com

Report of Laboratory Analysis

CLIENT:	EPS Environmental Services, Inc.	**Client Sample ID:**	SB - 4/15'
Lab Order:	14040141	**Report Date:**	4/9/2014
Project:	3122 14th Ave., Kenosha, W	**Collection Date:**	4/1/2014 9:00:00 AM
Lab ID:	14040141-06	**Matrix:**	Soil

Analyses	Result	EMT Reporting Limit	Qual	Units	MDL	Date Analyzed	Batch	DF	Analyst
4-Bromofluorobenzene	115	80-130		%REC	0	4/5/14 05:27	88919	1.00	JL
d4-1,2-Dichlorobenzene	110	80-125		%REC	0	4/5/14 05:27	88919	1.00	JL
Dibromofluoromethane	100	80-125		%REC	0	4/5/14 05:27	88919	1.00	JL
Fluorobenzene	99.3	80-120		%REC	0	4/5/14 05:27	88919	1.00	JL
Toluene-d8	97.9	80-120		%REC	0	4/5/14 05:27	88919	1.00	JL

Qualifiers:

B - Analyte detected in the associated Method Blank
E - Estimated
H - Holding Time Exceeded
S - Spike Recovery outside accepted recovery limits
R - RPD outside accepted recovery limits
J - Analyte detected below quantitation limits

ENVIRONMENTAL MONITORING AND TECHNOLOGIES, INC.

8100 North Austin • Morton Grove, IL 60053-3203
847.967.6666 • 800.246.0663 • fax: 847.967.6735 • www.emt.com

Report of Laboratory Analysis

CLIENT:	EPS Environmental Services, Inc.	**Client Sample ID:**	SB - 5/4'
Lab Order:	14040141	**Report Date:**	4/9/2014
Project:	3122 14th Ave., Kenosha, W	**Collection Date:**	4/1/2014 9:49:00 AM
Lab ID:	14040141-07	**Matrix:**	Soil

Analyses	Result	EMT Reporting Limit	Qual	Units	MDL	Date Analyzed	Batch	DF	Analyst
Percent Moisture		**Method:**		**SM2540G**					
Percent Moisture	11.2	0.100		% (Percent)	0.0150	4/7/14 10:00	R200150	1.00	TB2
Polynuclear Aromatic Hydrocarbons		**Method:**		**SW8310 / SW3540C**					
Acenaphthene	< 4.8	27.7		µg/Kg-dry	4.80	4/8/14	88852	1.00	RYL
Acenaphthylene	< 3.31	138		µg/Kg-dry	3.31	4/8/14	88852	1.00	RYL
Anthracene	< 3.33	27.7		µg/Kg-dry	3.33	4/8/14	88852	1.00	RYL
Benz(a)anthracene	< 3.29	27.7		µg/Kg-dry	3.29	4/8/14	88852	1.00	RYL
Benzo(a)pyrene	< 2.86	27.7		µg/Kg-dry	2.86	4/8/14	88852	1.00	RYL
Benzo(b)fluoranthene	< 3.06	27.7		µg/Kg-dry	3.06	4/8/14	88852	1.00	RYL
Benzo(g,h,i)perylene	< 3.48	27.7		µg/Kg-dry	3.48	4/8/14	88852	1.00	RYL
Benzo(k)fluoranthene	< 2.61	27.7		µg/Kg-dry	2.61	4/8/14	88852	1.00	RYL
Chrysene	< 2.75	27.7		µg/Kg-dry	2.75	4/8/14	88852	1.00	RYL
Dibenz(a,h)anthracene	< 4.1	27.7		µg/Kg-dry	4.10	4/8/14	88852	1.00	RYL
Fluoranthene	< 2.55	27.7		µg/Kg-dry	2.55	4/8/14	88852	1.00	RYL
Fluorene	< 7.89	27.7		µg/Kg-dry	7.89	4/8/14	88852	1.00	RYL
Indeno(1,2,3-cd)pyrene	< 4.43	27.7		µg/Kg-dry	4.43	4/8/14	88852	1.00	RYL
Naphthalene	< 3.9	27.7		µg/Kg-dry	3.90	4/8/14	88852	1.00	RYL
Phenanthrene	< 5.76	27.7		µg/Kg-dry	5.76	4/8/14	88852	1.00	RYL
Pyrene	< 4.24	27.7		µg/Kg-dry	4.24	4/8/14	88852	1.00	RYL
Surrogates:									
4-Terphenyl-d14	84.8	47.1-125		%REC	0	4/8/14	88852	1.00	RYL
Volatile Organic Compounds by GC/MS		**Method:**		**SW8260B / WDNR: PUBL-FW-140**					
1,1,1-Trichloroethane	< 25	54.5		µg/Kg	18.2	4/5/14 05:59	88919	1.00	JL
1,1,2,2-Tetrachloroethane	< 25	53.2		µg/Kg	17.7	4/5/14 05:59	88919	1.00	JL
1,1,2-Trichloroethane	< 28.6	85.9		µg/Kg	28.6	4/5/14 05:59	88919	1.00	JL
1,1-Dichloroethane	< 25	70.2		µg/Kg	23.4	4/5/14 05:59	88919	1.00	JL
1,1-Dichloroethene	< 25	69.2		µg/Kg	23.1	4/5/14 05:59	88919	1.00	JL
1,2-Dibromo-3-chloropropane	< 125	375.		µg/Kg	125	4/5/14 05:59	88919	1.00	JL
1,2-Dibromoethane	< 25	51.5		µg/Kg	17.2	4/5/14 05:59	88919	1.00	JL
1,2-Dichloroethane	< 25	47.		µg/Kg	15.7	4/5/14 05:59	88919	1.00	JL
1,2-Dichloropropane	< 33.9	102.		µg/Kg	33.9	4/5/14 05:59	88919	1.00	JL
1-Butanol	< 1700	5110.		µg/Kg	1,700	4/5/14 05:59	88919	1.00	JL

Qualifiers:

B - Analyte detected in the associated Method Blank
E - Estimated
H - Holding Time Exceeded
S - Spike Recovery outside accepted recovery limits
R - RPD outside accepted recovery limits
J - Analyte detected below quantitation limits

ENVIRONMENTAL MONITORING AND TECHNOLOGIES, INC.

8100 North Austin • Morton Grove, IL 60053-3203
847.967.6666 • 800.246.0663 • fax: 847.967.6735 • www.emt.com

Report of Laboratory Analysis

CLIENT:	EPS Environmental Services, Inc.	**Client Sample ID:**	SB - 5/4'
Lab Order:	14040141	**Report Date:**	4/9/2014
Project:	3122 14th Ave., Kenosha, W	**Collection Date:**	4/1/2014 9:49:00 AM
Lab ID:	14040141-07	**Matrix:**	Soil

Analyses	Result	EMT Reporting Limit	Qual	Units	MDL	Date Analyzed	Batch	DF	Analyst
2-Butanone	< 348	1040.		µg/Kg	348	4/5/14 05:59	88919	1.00	JL
2-Hexanone	< 42.7	128.		µg/Kg	42.7	4/5/14 05:59	88919	1.00	JL
4-Methyl-2-pentanone	< 155	464.		µg/Kg	155	4/5/14 05:59	88919	1.00	JL
Acetone	< 409	1230.		µg/Kg	409	4/5/14 05:59	88919	1.00	JL
Acrylonitrile	< 132	395.		µg/Kg	132	4/5/14 05:59	88919	1.00	JL
Benzene	< 25	47.4		µg/Kg	15.8	4/5/14 05:59	88919	1.00	JL
Bromodichloromethane	< 25	59.		µg/Kg	19.7	4/5/14 05:59	88919	1.00	JL
Bromoform	< 26.6	79.8		µg/Kg	26.6	4/5/14 05:59	88919	1.00	JL
Bromomethane	< 40.9	123.		µg/Kg	40.9	4/5/14 05:59	88919	1.00	JL
Carbon disulfide	< 25	58.3		µg/Kg	19.4	4/5/14 05:59	88919	1.00	JL
Carbon tetrachloride	< 25	65.1		µg/Kg	21.7	4/5/14 05:59	88919	1.00	JL
Chlorobenzene	< 25	25.8		µg/Kg	8.59	4/5/14 05:59	88919	1.00	JL
Chloroethane	< 34.3	103.		µg/Kg	34.3	4/5/14 05:59	88919	1.00	JL
Chloroform	< 25	35.1		µg/Kg	11.7	4/5/14 05:59	88919	1.00	JL
Chloromethane	< 47.4	142.		µg/Kg	47.4	4/5/14 05:59	88919	1.00	JL
cis-1,2-Dichloroethene	< 25	45.3		µg/Kg	15.1	4/5/14 05:59	88919	1.00	JL
Dibromochloromethane	< 25	49.1		µg/Kg	16.4	4/5/14 05:59	88919	1.00	JL
Ethylbenzene	< 26.6	79.8		µg/Kg	26.6	4/5/14 05:59	88919	1.00	JL
m,p-Xylene	< 66.9	201.		µg/Kg	66.9	4/5/14 05:59	88919	1.00	JL
Methyl tert-butyl ether	< 25	65.8		µg/Kg	21.9	4/5/14 05:59	88919	1.00	JL
Methylene chloride	< 36.7	110.		µg/Kg	36.7	4/5/14 05:59	88919	1.00	JL
o-Xylene	< 29.3	88.		µg/Kg	29.3	4/5/14 05:59	88919	1.00	JL
Styrene	< 25	38.9		µg/Kg	13.0	4/5/14 05:59	88919	1.00	JL
Tetrachloroethene	< 25	73.6		µg/Kg	24.5	4/5/14 05:59	88919	1.00	JL
Toluene	< 32.3	96.8		µg/Kg	32.3	4/5/14 05:59	88919	1.00	JL
trans-1,2-Dichloroethene	< 25.3	76.		µg/Kg	25.3	4/5/14 05:59	88919	1.00	JL
Trichloroethene	< 25	64.4		µg/Kg	21.5	4/5/14 05:59	88919	1.00	JL
Vinyl acetate	< 25	36.5		µg/Kg	12.2	4/5/14 05:59	88919	1.00	JL
Vinyl chloride	< 25	29.		µg/Kg	9.66	4/5/14 05:59	88919	1.00	JL
1,3-Dichloropropene, Total	< 50	103.		µg/Kg	34.4	4/5/14 05:59	88919	1.00	JL
Xylenes, Total	< 96.2	289.		µg/Kg	96.2	4/5/14 05:59	88919	1.00	JL
Surrogates:									
1,2-Dichloroethane-d4	96.5	70-140		%REC	0	4/5/14 05:59	88919	1.00	JL

Qualifiers:

B - Analyte detected in the associated Method Blank
E - Estimated
H - Holding Time Exceeded
S - Spike Recovery outside accepted recovery limits
R - RPD outside accepted recovery limits
J - Analyte detected below quantitation limits

ENVIRONMENTAL MONITORING AND TECHNOLOGIES, INC.

8100 North Austin • Morton Grove, IL 60053-3203
847.967.6666 • 800.246.0663 • fax: 847.967.6735 • www.emt.com

Report of Laboratory Analysis

CLIENT:	EPS Environmental Services, Inc.	**Client Sample ID:**	SB - 5/4'
Lab Order:	14040141	**Report Date:**	4/9/2014
Project:	3122 14th Ave., Kenosha, W	**Collection Date:**	4/1/2014 9:49:00 AM
Lab ID:	14040141-07	**Matrix:**	Soil

Analyses	Result	EMT Reporting Limit	Qual	Units	MDL	Date Analyzed	Batch	DF	Analyst
4-Bromofluorobenzene	106	80-130		%REC	0	4/5/14 05:59	88919	1.00	JL
d4-1,2-Dichlorobenzene	104	80-125		%REC	0	4/5/14 05:59	88919	1.00	JL
Dibromofluoromethane	98.4	80-125		%REC	0	4/5/14 05:59	88919	1.00	JL
Fluorobenzene	98.1	80-120		%REC	0	4/5/14 05:59	88919	1.00	JL
Toluene-d8	101	80-120		%REC	0	4/5/14 05:59	88919	1.00	JL

Qualifiers:

B - Analyte detected in the associated Method Blank
E - Estimated
H - Holding Time Exceeded
S - Spike Recovery outside accepted recovery limits
R - RPD outside accepted recovery limits
J - Analyte detected below quantitation limits

ENVIRONMENTAL MONITORING AND TECHNOLOGIES, INC.

8100 North Austin • Morton Grove, IL 60053-3203
847.967.6666 • 800.246.0663 • fax: 847.967.6735 • www.emt.com

Report of Laboratory Analysis

CLIENT:	EPS Environmental Services, Inc.	**Client Sample ID:**	SB - 5/16'
Lab Order:	14040141	**Report Date:**	4/9/2014
Project:	3122 14th Ave., Kenosha, W	**Collection Date:**	4/1/2014 10:05:00 AM
Lab ID:	14040141-08	**Matrix:**	Soil

Analyses	Result	EMT Reporting Limit	Qual	Units	MDL	Date Analyzed	Batch	DF	Analyst
Percent Moisture		**Method:**		**SM2540G**					
Percent Moisture	15.0	0.100		% (Percent)	0.0150	4/7/14 10:00	R200150	1.00	TB2
Polynuclear Aromatic Hydrocarbons		**Method:**		**SW8310 / SW3540C**					
Acenaphthene	< 5.02	29.0		µg/Kg-dry	5.02	4/8/14	88852	1.00	RYL
Acenaphthylene	< 3.47	145		µg/Kg-dry	3.47	4/8/14	88852	1.00	RYL
Anthracene	< 3.49	29.0		µg/Kg-dry	3.49	4/8/14	88852	1.00	RYL
Benz(a)anthracene	< 3.44	29.0		µg/Kg-dry	3.44	4/8/14	88852	1.00	RYL
Benzo(a)pyrene	< 2.99	29.0		µg/Kg-dry	2.99	4/8/14	88852	1.00	RYL
Benzo(b)fluoranthene	< 3.2	29.0		µg/Kg-dry	3.20	4/8/14	88852	1.00	RYL
Benzo(g,h,i)perylene	< 3.64	29.0		µg/Kg-dry	3.64	4/8/14	88852	1.00	RYL
Benzo(k)fluoranthene	< 2.74	29.0		µg/Kg-dry	2.74	4/8/14	88852	1.00	RYL
Chrysene	< 2.87	29.0		µg/Kg-dry	2.87	4/8/14	88852	1.00	RYL
Dibenz(a,h)anthracene	< 4.29	29.0		µg/Kg-dry	4.29	4/8/14	88852	1.00	RYL
Fluoranthene	< 2.67	29.0		µg/Kg-dry	2.67	4/8/14	88852	1.00	RYL
Fluorene	< 8.25	29.0		µg/Kg-dry	8.25	4/8/14	88852	1.00	RYL
Indeno(1,2,3-cd)pyrene	< 4.64	29.0		µg/Kg-dry	4.64	4/8/14	88852	1.00	RYL
Naphthalene	< 4.08	29.0		µg/Kg-dry	4.08	4/8/14	88852	1.00	RYL
Phenanthrene	< 6.03	29.0		µg/Kg-dry	6.03	4/8/14	88852	1.00	RYL
Pyrene	< 4.44	29.0		µg/Kg-dry	4.44	4/8/14	88852	1.00	RYL
Surrogates:									
4-Terphenyl-d14	83.3	47.1-125		%REC	0	4/8/14	88852	1.00	RYL
Volatile Organic Compounds by GC/MS		**Method:**		**SW8260B / WDNR: PUBL-FW-140**					
1,1,1-Trichloroethane	< 25	50.		µg/Kg	16.7	4/5/14 06:31	88919	1.00	JL
1,1,2,2-Tetrachloroethane	< 25	48.7		µg/Kg	16.2	4/5/14 06:31	88919	1.00	JL
1,1,2-Trichloroethane	< 26.2	78.7		µg/Kg	26.2	4/5/14 06:31	88919	1.00	JL
1,1-Dichloroethane	< 25	64.4		µg/Kg	21.5	4/5/14 06:31	88919	1.00	JL
1,1-Dichloroethene	< 25	63.4		µg/Kg	21.1	4/5/14 06:31	88919	1.00	JL
1,2-Dibromo-3-chloropropane	< 115	344.		µg/Kg	115	4/5/14 06:31	88919	1.00	JL
1,2-Dibromoethane	< 25	47.2		µg/Kg	15.7	4/5/14 06:31	88919	1.00	JL
1,2-Dichloroethane	< 25	43.1		µg/Kg	14.4	4/5/14 06:31	88919	1.00	JL
1,2-Dichloropropane	< 31	93.1		µg/Kg	31.0	4/5/14 06:31	88919	1.00	JL
1-Butanol	< 1560	4690.		µg/Kg	1,560	4/5/14 06:31	88919	1.00	JL

Qualifiers:
B - Analyte detected in the associated Method Blank
E - Estimated
H - Holding Time Exceeded
S - Spike Recovery outside accepted recovery limits
R - RPD outside accepted recovery limits
J - Analyte detected below quantitation limits

ENVIRONMENTAL MONITORING AND TECHNOLOGIES, INC.

8100 North Austin • Morton Grove, IL 60053-3203
847.967.6666 • 800.246.0663 • fax: 847.967.6735 • www.emt.com

Report of Laboratory Analysis

CLIENT:	EPS Environmental Services, Inc.	**Client Sample ID:**	SB - 5/16'
Lab Order:	14040141	**Report Date:**	4/9/2014
Project:	3122 14th Ave., Kenosha, W	**Collection Date:**	4/1/2014 10:05:00 AM
Lab ID:	14040141-08	**Matrix:**	Soil

Analyses	Result	EMT Reporting Limit	Qual	Units	MDL	Date Analyzed	Batch	DF	Analyst
2-Butanone	< 319	956.		µg/Kg	319	4/5/14 06:31	88919	1.00	JL
2-Hexanone	< 39.2	118.		µg/Kg	39.2	4/5/14 06:31	88919	1.00	JL
4-Methyl-2-pentanone	< 142	425.		µg/Kg	142	4/5/14 06:31	88919	1.00	JL
Acetone	< 375	1120.		µg/Kg	375	4/5/14 06:31	88919	1.00	JL
Acrylonitrile	< 121	362.		µg/Kg	121	4/5/14 06:31	88919	1.00	JL
Benzene	< 25	43.4		µg/Kg	14.5	4/5/14 06:31	88919	1.00	JL
Bromodichloromethane	< 25	54.1		µg/Kg	18.0	4/5/14 06:31	88919	1.00	JL
Bromoform	< 25	73.1		µg/Kg	24.4	4/5/14 06:31	88919	1.00	JL
Bromomethane	< 37.5	112.		µg/Kg	37.5	4/5/14 06:31	88919	1.00	JL
Carbon disulfide	< 25	53.4		µg/Kg	17.8	4/5/14 06:31	88919	1.00	JL
Carbon tetrachloride	< 25	59.7		µg/Kg	19.9	4/5/14 06:31	88919	1.00	JL
Chlorobenzene	< 25	23.6		µg/Kg	7.87	4/5/14 06:31	88919	1.00	JL
Chloroethane	< 31.5	94.4		µg/Kg	31.5	4/5/14 06:31	88919	1.00	JL
Chloroform	< 25	32.2		µg/Kg	10.7	4/5/14 06:31	88919	1.00	JL
Chloromethane	< 43.4	130.		µg/Kg	43.4	4/5/14 06:31	88919	1.00	JL
cis-1,2-Dichloroethene	< 25	41.6		µg/Kg	13.9	4/5/14 06:31	88919	1.00	JL
Dibromochloromethane	< 25	45.		µg/Kg	15.0	4/5/14 06:31	88919	1.00	JL
Ethylbenzene	< 25	73.1		µg/Kg	24.4	4/5/14 06:31	88919	1.00	JL
m,p-Xylene	< 61.4	184.		µg/Kg	61.4	4/5/14 06:31	88919	1.00	JL
Methyl tert-butyl ether	< 25	60.3		µg/Kg	20.1	4/5/14 06:31	88919	1.00	JL
Methylene chloride	< 33.6	101.		µg/Kg	33.6	4/5/14 06:31	88919	1.00	JL
o-Xylene	< 26.9	80.6		µg/Kg	26.9	4/5/14 06:31	88919	1.00	JL
Styrene	< 25	35.6		µg/Kg	11.9	4/5/14 06:31	88919	1.00	JL
Tetrachloroethene	< 25	67.5		µg/Kg	22.5	4/5/14 06:31	88919	1.00	JL
Toluene	< 29.6	88.8		µg/Kg	29.6	4/5/14 06:31	88919	1.00	JL
trans-1,2-Dichloroethene	< 25	69.7		µg/Kg	23.2	4/5/14 06:31	88919	1.00	JL
Trichloroethene	< 25	59.1		µg/Kg	19.7	4/5/14 06:31	88919	1.00	JL
Vinyl acetate	< 25	33.4		µg/Kg	11.1	4/5/14 06:31	88919	1.00	JL
Vinyl chloride	< 25	26.6		µg/Kg	8.85	4/5/14 06:31	88919	1.00	JL
1,3-Dichloropropene, Total	< 50	94.7		µg/Kg	31.6	4/5/14 06:31	88919	1.00	JL
Xylenes, Total	< 88.2	265.		µg/Kg	88.2	4/5/14 06:31	88919	1.00	JL
Surrogates:									
1,2-Dichloroethane-d4	106	70-140		%REC	0	4/5/14 06:31	88919	1.00	JL

Qualifiers:

B - Analyte detected in the associated Method Blank
E - Estimated
H - Holding Time Exceeded
S - Spike Recovery outside accepted recovery limits
R - RPD outside accepted recovery limits
J - Analyte detected below quantitation limits

ENVIRONMENTAL MONITORING AND TECHNOLOGIES, INC.

8100 North Austin • Morton Grove, IL 60053-3203
847.967.6666 • 800.246.0663 • fax: 847.967.6735 • www.emt.com

Report of Laboratory Analysis

CLIENT:	EPS Environmental Services, Inc.	**Client Sample ID:**	SB - 5/16'
Lab Order:	14040141	**Report Date:**	4/9/2014
Project:	3122 14th Ave., Kenosha, W	**Collection Date:**	4/1/2014 10:05:00 AM
Lab ID:	14040141-08	**Matrix:**	Soil

Analyses	Result	EMT Reporting Limit	Qual	Units	MDL	Date Analyzed	Batch	DF	Analyst
4-Bromofluorobenzene	112	80-130		%REC	0	4/5/14 06:31	88919	1.00	JL
d4-1,2-Dichlorobenzene	110	80-125		%REC	0	4/5/14 06:31	88919	1.00	JL
Dibromofluoromethane	101	80-125		%REC	0	4/5/14 06:31	88919	1.00	JL
Fluorobenzene	99.4	80-120		%REC	0	4/5/14 06:31	88919	1.00	JL
Toluene-d8	99.9	80-120		%REC	0	4/5/14 06:31	88919	1.00	JL

Qualifiers:

B - Analyte detected in the associated Method Blank
E - Estimated
H - Holding Time Exceeded
S - Spike Recovery outside accepted recovery limits
R - RPD outside accepted recovery limits
J - Analyte detected below quantitation limits

ENVIRONMENTAL MONITORING AND TECHNOLOGIES, INC.

8100 North Austin • Morton Grove, IL 60053-3203
847.967.6666 • 800.246.0663 • fax: 847.967.6735 • www.emt.com

Report of Laboratory Analysis

CLIENT:	EPS Environmental Services, Inc.	**Client Sample ID:**	SB - 6/8'
Lab Order:	14040141	**Report Date:**	4/9/2014
Project:	3122 14th Ave., Kenosha, W	**Collection Date:**	4/1/2014 11:15:00 AM
Lab ID:	14040141-09	**Matrix:**	Soil

Analyses	Result	EMT Reporting Limit	Qual	Units	MDL	Date Analyzed	Batch	DF	Analyst
Percent Moisture		**Method:**		**SM2540G**					
Percent Moisture	15.2	0.100		% (Percent)	0.0150	4/7/14 10:00	R200150	1.00	TB2
Polynuclear Aromatic Hydrocarbons		**Method:**		**SW8310 / SW3540C**					
Acenaphthene	< 5.08	29.4		µg/Kg-dry	5.08	4/8/14	88852	1.00	RYL
Acenaphthylene	< 3.51	147		µg/Kg-dry	3.51	4/8/14	88852	1.00	RYL
Anthracene	< 3.53	29.4		µg/Kg-dry	3.53	4/8/14	88852	1.00	RYL
Benz(a)anthracene	< 3.49	29.4		µg/Kg-dry	3.49	4/8/14	88852	1.00	RYL
Benzo(a)pyrene	< 3.03	29.4		µg/Kg-dry	3.03	4/8/14	88852	1.00	RYL
Benzo(b)fluoranthene	< 3.24	29.4		µg/Kg-dry	3.24	4/8/14	88852	1.00	RYL
Benzo(g,h,i)perylene	< 3.69	29.4		µg/Kg-dry	3.69	4/8/14	88852	1.00	RYL
Benzo(k)fluoranthene	< 2.77	29.4		µg/Kg-dry	2.77	4/8/14	88852	1.00	RYL
Chrysene	< 2.91	29.4		µg/Kg-dry	2.91	4/8/14	88852	1.00	RYL
Dibenz(a,h)anthracene	< 4.34	29.4		µg/Kg-dry	4.34	4/8/14	88852	1.00	RYL
Fluoranthene	< 2.7	29.4		µg/Kg-dry	2.70	4/8/14	88852	1.00	RYL
Fluorene	< 8.36	29.4		µg/Kg-dry	8.36	4/8/14	88852	1.00	RYL
Indeno(1,2,3-cd)pyrene	< 4.7	29.4		µg/Kg-dry	4.70	4/8/14	88852	1.00	RYL
Naphthalene	< 4.13	29.4		µg/Kg-dry	4.13	4/8/14	88852	1.00	RYL
Phenanthrene	< 6.11	29.4		µg/Kg-dry	6.11	4/8/14	88852	1.00	RYL
Pyrene	< 4.5	29.4		µg/Kg-dry	4.50	4/8/14	88852	1.00	RYL
Surrogates:									
4-Terphenyl-d14	71.3	47.1-125		%REC	0	4/8/14	88852	1.00	RYL
Volatile Organic Compounds by GC/MS		**Method:**		**SW8260B / WDNR: PUBL-FW-140**					
1,1,1-Trichloroethane	< 25	63.2		µg/Kg	21.1	4/5/14 07:03	88919	1.00	JL
1,1,2,2-Tetrachloroethane	< 25	61.6		µg/Kg	20.5	4/5/14 07:03	88919	1.00	JL
1,1,2-Trichloroethane	< 33.2	99.5		µg/Kg	33.2	4/5/14 07:03	88919	1.00	JL
1,1-Dichloroethane	< 27.1	81.3		µg/Kg	27.1	4/5/14 07:03	88919	1.00	JL
1,1-Dichloroethene	< 26.7	80.1		µg/Kg	26.7	4/5/14 07:03	88919	1.00	JL
1,2-Dibromo-3-chloropropane	< 145	434.		µg/Kg	145	4/5/14 07:03	88919	1.00	JL
1,2-Dibromoethane	< 25	59.6		µg/Kg	19.9	4/5/14 07:03	88919	1.00	JL
1,2-Dichloroethane	< 25	54.5		µg/Kg	18.2	4/5/14 07:03	88919	1.00	JL
1,2-Dichloropropane	< 39.2	118.		µg/Kg	39.2	4/5/14 07:03	88919	1.00	JL
1-Butanol	< 1970	5920.		µg/Kg	1,970	4/5/14 07:03	88919	1.00	JL

Qualifiers:

B - Analyte detected in the associated Method Blank
E - Estimated
H - Holding Time Exceeded
S - Spike Recovery outside accepted recovery limits
R - RPD outside accepted recovery limits
J - Analyte detected below quantitation limits

ENVIRONMENTAL MONITORING AND TECHNOLOGIES, INC.

8100 North Austin • Morton Grove, IL 60053-3203
847.967.6666 • 800.246.0663 • fax: 847.967.6735 • www.emt.com

Report of Laboratory Analysis

CLIENT:	EPS Environmental Services, Inc.	**Client Sample ID:**	SB - 6/8'
Lab Order:	14040141	**Report Date:**	4/9/2014
Project:	3122 14th Ave., Kenosha, W	**Collection Date:**	4/1/2014 11:15:00 AM
Lab ID:	14040141-09	**Matrix:**	Soil

Analyses	Result	EMT Reporting Limit	Qual	Units	MDL	Date Analyzed	Batch	DF	Analyst
2-Butanone	< 403	1210.		µg/Kg	403	4/5/14 07:03	88919	1.00	JL
2-Hexanone	< 49.5	149.		µg/Kg	49.5	4/5/14 07:03	88919	1.00	JL
4-Methyl-2-pentanone	< 179	537.		µg/Kg	179	4/5/14 07:03	88919	1.00	JL
Acetone	< 474	1420.		µg/Kg	474	4/5/14 07:03	88919	1.00	JL
Acrylonitrile	< 153	458.		µg/Kg	153	4/5/14 07:03	88919	1.00	JL
Benzene	< 25	54.9		µg/Kg	18.3	4/5/14 07:03	88919	1.00	JL
Bromodichloromethane	< 25	68.3		µg/Kg	22.8	4/5/14 07:03	88919	1.00	JL
Bromoform	< 30.8	92.4		µg/Kg	30.8	4/5/14 07:03	88919	1.00	JL
Bromomethane	< 47.4	142.		µg/Kg	47.4	4/5/14 07:03	88919	1.00	JL
Carbon disulfide	< 25	67.5		µg/Kg	22.5	4/5/14 07:03	88919	1.00	JL
Carbon tetrachloride	< 25.1	75.4		µg/Kg	25.1	4/5/14 07:03	88919	1.00	JL
Chlorobenzene	< 25	29.9		µg/Kg	9.95	4/5/14 07:03	88919	1.00	JL
Chloroethane	< 39.7	119.		µg/Kg	39.7	4/5/14 07:03	88919	1.00	JL
Chloroform	< 25	40.7		µg/Kg	13.6	4/5/14 07:03	88919	1.00	JL
Chloromethane	< 54.9	164.		µg/Kg	54.9	4/5/14 07:03	88919	1.00	JL
cis-1,2-Dichloroethene	< 25	52.5		µg/Kg	17.5	4/5/14 07:03	88919	1.00	JL
Dibromochloromethane	< 25	56.8		µg/Kg	18.9	4/5/14 07:03	88919	1.00	JL
Ethylbenzene	< 30.8	92.4		µg/Kg	30.8	4/5/14 07:03	88919	1.00	JL
m,p-Xylene	< 77.5	232.		µg/Kg	77.5	4/5/14 07:03	88919	1.00	JL
Methyl tert-butyl ether	< 25.4	76.2		µg/Kg	25.4	4/5/14 07:03	88919	1.00	JL
Methylene chloride	86.	127.	J	µg/Kg-dry	42.5	4/5/14 07:03	88919	1.00	JL
o-Xylene	< 33.9	102.		µg/Kg	33.9	4/5/14 07:03	88919	1.00	JL
Styrene	< 25	45.		µg/Kg	15.0	4/5/14 07:03	88919	1.00	JL
Tetrachloroethene	< 28.4	85.3		µg/Kg	28.4	4/5/14 07:03	88919	1.00	JL
Toluene	< 37.4	112.		µg/Kg	37.4	4/5/14 07:03	88919	1.00	JL
trans-1,2-Dichloroethene	< 29.3	88.		µg/Kg	29.3	4/5/14 07:03	88919	1.00	JL
Trichloroethene	< 25	74.6		µg/Kg	24.9	4/5/14 07:03	88919	1.00	JL
Vinyl acetate	< 25	42.2		µg/Kg	14.1	4/5/14 07:03	88919	1.00	JL
Vinyl chloride	< 25	33.6		µg/Kg	11.2	4/5/14 07:03	88919	1.00	JL
1,3-Dichloropropene, Total	< 50	120.		µg/Kg	39.9	4/5/14 07:03	88919	1.00	JL
Xylenes, Total	< 111	334.		µg/Kg	111	4/5/14 07:03	88919	1.00	JL
Surrogates:									
1,2-Dichloroethane-d4	99.5	70-140		%REC	0	4/5/14 07:03	88919	1.00	JL

Qualifiers:

B - Analyte detected in the associated Method Blank
E - Estimated
H - Holding Time Exceeded
S - Spike Recovery outside accepted recovery limits
R - RPD outside accepted recovery limits
J - Analyte detected below quantitation limits

ENVIRONMENTAL MONITORING AND TECHNOLOGIES, INC.

8100 North Austin • Morton Grove, IL 60053-3203
847.967.6666 • 800.246.0663 • fax: 847.967.6735 • www.emt.com

Report of Laboratory Analysis

CLIENT:	EPS Environmental Services, Inc.	**Client Sample ID:**	SB - 6/8'
Lab Order:	14040141	**Report Date:**	4/9/2014
Project:	3122 14th Ave., Kenosha, W	**Collection Date:**	4/1/2014 11:15:00 AM
Lab ID:	14040141-09	**Matrix:**	Soil

Analyses	Result	EMT Reporting Limit	Qual	Units	MDL	Date Analyzed	Batch	DF	Analyst
4-Bromofluorobenzene	121	80-130		%REC	0	4/5/14 07:03	88919	1.00	JL
d4-1,2-Dichlorobenzene	110	80-125		%REC	0	4/5/14 07:03	88919	1.00	JL
Dibromofluoromethane	100	80-125		%REC	0	4/5/14 07:03	88919	1.00	JL
Fluorobenzene	100	80-120		%REC	0	4/5/14 07:03	88919	1.00	JL
Toluene-d8	101	80-120		%REC	0	4/5/14 07:03	88919	1.00	JL

Qualifiers:

B - Analyte detected in the associated Method Blank
E - Estimated
H - Holding Time Exceeded
S - Spike Recovery outside accepted recovery limits
R - RPD outside accepted recovery limits
J - Analyte detected below quantitation limits

ENVIRONMENTAL MONITORING AND TECHNOLOGIES, INC.

8100 North Austin • Morton Grove, IL 60053-3203
847.967.6666 • 800.246.0663 • fax: 847.967.6735 • www.emt.com

Report of Laboratory Analysis

CLIENT:	EPS Environmental Services, Inc.	**Client Sample ID:**	SB - 7/4'
Lab Order:	14040141	**Report Date:**	4/9/2014
Project:	3122 14th Ave., Kenosha, W	**Collection Date:**	4/1/2014 11:45:00 AM
Lab ID:	14040141-10	**Matrix:**	Soil

Analyses	Result	EMT Reporting Limit	Qual	Units	MDL	Date Analyzed	Batch	DF	Analyst
Percent Moisture		**Method:**		**SM2540G**					
Percent Moisture	13.7	0.100		% (Percent)	0.0150	4/7/14 10:00	R200150	1.00	TB2
Polynuclear Aromatic Hydrocarbons		**Method:**		**SW8310 / SW3540C**					
Acenaphthene	< 4.93	28.5		µg/Kg-dry	4.93	4/8/14	88852	1.00	RYL
Acenaphthylene	< 3.4	142		µg/Kg-dry	3.40	4/8/14	88852	1.00	RYL
Anthracene	< 3.43	28.5		µg/Kg-dry	3.43	4/8/14	88852	1.00	RYL
Benz(a)anthracene	< 3.38	28.5		µg/Kg-dry	3.38	4/8/14	88852	1.00	RYL
Benzo(a)pyrene	< 2.94	28.5		µg/Kg-dry	2.94	4/8/14	88852	1.00	RYL
Benzo(b)fluoranthene	< 3.14	28.5		µg/Kg-dry	3.14	4/8/14	88852	1.00	RYL
Benzo(g,h,i)perylene	< 3.58	28.5		µg/Kg-dry	3.58	4/8/14	88852	1.00	RYL
Benzo(k)fluoranthene	< 2.69	28.5		µg/Kg-dry	2.69	4/8/14	88852	1.00	RYL
Chrysene	< 2.82	28.5		µg/Kg-dry	2.82	4/8/14	88852	1.00	RYL
Dibenz(a,h)anthracene	< 4.21	28.5		µg/Kg-dry	4.21	4/8/14	88852	1.00	RYL
Fluoranthene	< 2.62	28.5		µg/Kg-dry	2.62	4/8/14	88852	1.00	RYL
Fluorene	< 8.11	28.5		µg/Kg-dry	8.11	4/8/14	88852	1.00	RYL
Indeno(1,2,3-cd)pyrene	< 4.55	28.5		µg/Kg-dry	4.55	4/8/14	88852	1.00	RYL
Naphthalene	< 4.01	28.5		µg/Kg-dry	4.01	4/8/14	88852	1.00	RYL
Phenanthrene	< 5.92	28.5		µg/Kg-dry	5.92	4/8/14	88852	1.00	RYL
Pyrene	< 4.36	28.5		µg/Kg-dry	4.36	4/8/14	88852	1.00	RYL
Surrogates:									
4-Terphenyl-d14	89.3	47.1-125		%REC	0	4/8/14	88852	1.00	RYL
Volatile Organic Compounds by GC/MS		**Method:**		**SW8260B / WDNR: PUBL-FW-140**					
1,1,1-Trichloroethane	< 25	50.		µg/Kg	16.7	4/5/14 07:35	88919	1.00	JL
1,1,2,2-Tetrachloroethane	< 25	48.7		µg/Kg	16.2	4/5/14 07:35	88919	1.00	JL
1,1,2-Trichloroethane	< 26.2	78.7		µg/Kg	26.2	4/5/14 07:35	88919	1.00	JL
1,1-Dichloroethane	< 25	64.4		µg/Kg	21.5	4/5/14 07:35	88919	1.00	JL
1,1-Dichloroethene	< 25	63.4		µg/Kg	21.1	4/5/14 07:35	88919	1.00	JL
1,2-Dibromo-3-chloropropane	< 115	344.		µg/Kg	115	4/5/14 07:35	88919	1.00	JL
1,2-Dibromoethane	< 25	47.2		µg/Kg	15.7	4/5/14 07:35	88919	1.00	JL
1,2-Dichloroethane	< 25	43.1		µg/Kg	14.4	4/5/14 07:35	88919	1.00	JL
1,2-Dichloropropane	< 31	93.1		µg/Kg	31.0	4/5/14 07:35	88919	1.00	JL
1-Butanol	< 1560	4690.		µg/Kg	1,560	4/5/14 07:35	88919	1.00	JL

Qualifiers:

B - Analyte detected in the associated Method Blank
E - Estimated
H - Holding Time Exceeded
S - Spike Recovery outside accepted recovery limits
R - RPD outside accepted recovery limits
J - Analyte detected below quantitation limits

ENVIRONMENTAL MONITORING AND TECHNOLOGIES, INC.

8100 North Austin • Morton Grove, IL 60053-3203
847.967.6666 • 800.246.0663 • fax: 847.967.6735 • www.emt.com

Report of Laboratory Analysis

CLIENT:	EPS Environmental Services, Inc.	**Client Sample ID:**	SB - 7/4'
Lab Order:	14040141	**Report Date:**	4/9/2014
Project:	3122 14th Ave., Kenosha, W	**Collection Date:**	4/1/2014 11:45:00 AM
Lab ID:	14040141-10	**Matrix:**	Soil

Analyses	Result	EMT Reporting Limit	Qual	Units	MDL	Date Analyzed	Batch	DF	Analyst
2-Butanone	< 319	956.		µg/Kg	319	4/5/14 07:35	88919	1.00	JL
2-Hexanone	< 39.2	118.		µg/Kg	39.2	4/5/14 07:35	88919	1.00	JL
4-Methyl-2-pentanone	< 142	425.		µg/Kg	142	4/5/14 07:35	88919	1.00	JL
Acetone	< 375	1120.		µg/Kg	375	4/5/14 07:35	88919	1.00	JL
Acrylonitrile	< 121	362.		µg/Kg	121	4/5/14 07:35	88919	1.00	JL
Benzene	< 25	43.4		µg/Kg	14.5	4/5/14 07:35	88919	1.00	JL
Bromodichloromethane	< 25	54.1		µg/Kg	18.0	4/5/14 07:35	88919	1.00	JL
Bromoform	< 25	73.1		µg/Kg	24.4	4/5/14 07:35	88919	1.00	JL
Bromomethane	< 37.5	112.		µg/Kg	37.5	4/5/14 07:35	88919	1.00	JL
Carbon disulfide	< 25	53.4		µg/Kg	17.8	4/5/14 07:35	88919	1.00	JL
Carbon tetrachloride	< 25	59.7		µg/Kg	19.9	4/5/14 07:35	88919	1.00	JL
Chlorobenzene	< 25	23.6		µg/Kg	7.87	4/5/14 07:35	88919	1.00	JL
Chloroethane	< 31.5	94.4		µg/Kg	31.5	4/5/14 07:35	88919	1.00	JL
Chloroform	< 25	32.2		µg/Kg	10.7	4/5/14 07:35	88919	1.00	JL
Chloromethane	< 43.4	130.		µg/Kg	43.4	4/5/14 07:35	88919	1.00	JL
cis-1,2-Dichloroethene	< 25	41.6		µg/Kg	13.9	4/5/14 07:35	88919	1.00	JL
Dibromochloromethane	< 25	45.		µg/Kg	15.0	4/5/14 07:35	88919	1.00	JL
Ethylbenzene	< 25	73.1		µg/Kg	24.4	4/5/14 07:35	88919	1.00	JL
m,p-Xylene	< 61.4	184.		µg/Kg	61.4	4/5/14 07:35	88919	1.00	JL
Methyl tert-butyl ether	< 25	60.3		µg/Kg	20.1	4/5/14 07:35	88919	1.00	JL
Methylene chloride	< 33.6	101.		µg/Kg	33.6	4/5/14 07:35	88919	1.00	JL
o-Xylene	< 26.9	80.6		µg/Kg	26.9	4/5/14 07:35	88919	1.00	JL
Styrene	< 25	35.6		µg/Kg	11.9	4/5/14 07:35	88919	1.00	JL
Tetrachloroethene	< 25	67.5		µg/Kg	22.5	4/5/14 07:35	88919	1.00	JL
Toluene	< 29.6	88.8		µg/Kg	29.6	4/5/14 07:35	88919	1.00	JL
trans-1,2-Dichloroethene	< 25	69.7		µg/Kg	23.2	4/5/14 07:35	88919	1.00	JL
Trichloroethene	< 25	59.1		µg/Kg	19.7	4/5/14 07:35	88919	1.00	JL
Vinyl acetate	< 25	33.4		µg/Kg	11.1	4/5/14 07:35	88919	1.00	JL
Vinyl chloride	< 25	26.6		µg/Kg	8.85	4/5/14 07:35	88919	1.00	JL
1,3-Dichloropropene, Total	< 50	94.7		µg/Kg	31.6	4/5/14 07:35	88919	1.00	JL
Xylenes, Total	< 88.2	265.		µg/Kg	88.2	4/5/14 07:35	88919	1.00	JL
Surrogates:									
1,2-Dichloroethane-d4	97.7	70-140		%REC	0	4/5/14 07:35	88919	1.00	JL

Qualifiers:

B - Analyte detected in the associated Method Blank
E - Estimated
H - Holding Time Exceeded
S - Spike Recovery outside accepted recovery limits
R - RPD outside accepted recovery limits
J - Analyte detected below quantitation limits

ENVIRONMENTAL MONITORING AND TECHNOLOGIES, INC.

8100 North Austin • Morton Grove, IL 60053-3203
847.967.6666 • 800.246.0663 • fax: 847.967.6735 • www.emt.com

Report of Laboratory Analysis

CLIENT:	EPS Environmental Services, Inc.	**Client Sample ID:**	SB - 7/4'
Lab Order:	14040141	**Report Date:**	4/9/2014
Project:	3122 14th Ave., Kenosha, W	**Collection Date:**	4/1/2014 11:45:00 AM
Lab ID:	14040141-10	**Matrix:**	Soil

Analyses	Result	EMT Reporting Limit	Qual	Units	MDL	Date Analyzed	Batch	DF	Analyst
4-Bromofluorobenzene	106	80-130		%REC	0	4/5/14 07:35	88919	1.00	JL
d4-1,2-Dichlorobenzene	106	80-125		%REC	0	4/5/14 07:35	88919	1.00	JL
Dibromofluoromethane	101	80-125		%REC	0	4/5/14 07:35	88919	1.00	JL
Fluorobenzene	98.6	80-120		%REC	0	4/5/14 07:35	88919	1.00	JL
Toluene-d8	101	80-120		%REC	0	4/5/14 07:35	88919	1.00	JL

Qualifiers:

B - Analyte detected in the associated Method Blank
E - Estimated
H - Holding Time Exceeded
S - Spike Recovery outside accepted recovery limits
R - RPD outside accepted recovery limits
J - Analyte detected below quantitation limits

ENVIRONMENTAL MONITORING AND TECHNOLOGIES, INC.

8100 North Austin • Morton Grove, IL 60053-3203
847.967.6666 • 800.246.0663 • fax: 847.967.6735 • www.emt.com

Report of Laboratory Analysis

CLIENT:	EPS Environmental Services, Inc.	**Client Sample ID:**	SB - 8/6'
Lab Order:	14040141	**Report Date:**	4/9/2014
Project:	3122 14th Ave., Kenosha, W	**Collection Date:**	4/1/2014 12:35:00 PM
Lab ID:	14040141-11	**Matrix:**	Soil

Analyses	Result	EMT Reporting Limit	Qual	Units	MDL	Date Analyzed	Batch	DF	Analyst
Percent Moisture		**Method:**		**SM2540G**					
Percent Moisture	14.6	0.100		% (Percent)	0.0150	4/7/14 10:00	R200150	1.00	TB2
Polynuclear Aromatic Hydrocarbons		**Method:**		**SW8310 / SW3540C**					
Acenaphthene	< 4.86	28.0		µg/Kg-dry	4.86	4/8/14	88852	1.00	RYL
Acenaphthylene	< 3.35	140		µg/Kg-dry	3.35	4/8/14	88852	1.00	RYL
Anthracene	< 3.38	28.0		µg/Kg-dry	3.38	4/8/14	88852	1.00	RYL
Benz(a)anthracene	< 3.33	28.0		µg/Kg-dry	3.33	4/8/14	88852	1.00	RYL
Benzo(a)pyrene	< 2.89	28.0		µg/Kg-dry	2.89	4/8/14	88852	1.00	RYL
Benzo(b)fluoranthene	< 3.09	28.0		µg/Kg-dry	3.09	4/8/14	88852	1.00	RYL
Benzo(g,h,i)perylene	< 3.52	28.0		µg/Kg-dry	3.52	4/8/14	88852	1.00	RYL
Benzo(k)fluoranthene	< 2.65	28.0		µg/Kg-dry	2.65	4/8/14	88852	1.00	RYL
Chrysene	< 2.78	28.0		µg/Kg-dry	2.78	4/8/14	88852	1.00	RYL
Dibenz(a,h)anthracene	< 4.15	28.0		µg/Kg-dry	4.15	4/8/14	88852	1.00	RYL
Fluoranthene	< 2.58	28.0		µg/Kg-dry	2.58	4/8/14	88852	1.00	RYL
Fluorene	< 7.98	28.0		µg/Kg-dry	7.98	4/8/14	88852	1.00	RYL
Indeno(1,2,3-cd)pyrene	< 4.49	28.0		µg/Kg-dry	4.49	4/8/14	88852	1.00	RYL
Naphthalene	< 3.95	28.0		µg/Kg-dry	3.95	4/8/14	88852	1.00	RYL
Phenanthrene	11	28.0	J	µg/Kg-dry	5.83	4/8/14	88852	1.00	RYL
Pyrene	< 4.29	28.0		µg/Kg-dry	4.29	4/8/14	88852	1.00	RYL
Surrogates:									
4-Terphenyl-d14	63.9	47.1-125		%REC	0	4/8/14	88852	1.00	RYL
Volatile Organic Compounds by GC/MS		**Method:**		**SW8260B / WDNR: PUBL-FW-140**					
1,1,1-Trichloroethane	< 25	50.		µg/Kg	16.7	4/5/14 08:07	88919	1.00	JL
1,1,2,2-Tetrachloroethane	< 25	48.7		µg/Kg	16.2	4/5/14 08:07	88919	1.00	JL
1,1,2-Trichloroethane	< 26.2	78.7		µg/Kg	26.2	4/5/14 08:07	88919	1.00	JL
1,1-Dichloroethane	< 25	64.4		µg/Kg	21.5	4/5/14 08:07	88919	1.00	JL
1,1-Dichloroethene	< 25	63.4		µg/Kg	21.1	4/5/14 08:07	88919	1.00	JL
1,2-Dibromo-3-chloropropane	< 115	344.		µg/Kg	115	4/5/14 08:07	88919	1.00	JL
1,2-Dibromoethane	< 25	47.2		µg/Kg	15.7	4/5/14 08:07	88919	1.00	JL
1,2-Dichloroethane	< 25	43.1		µg/Kg	14.4	4/5/14 08:07	88919	1.00	JL
1,2-Dichloropropane	< 31	93.1		µg/Kg	31.0	4/5/14 08:07	88919	1.00	JL
1-Butanol	< 1560	4690.		µg/Kg	1,560	4/5/14 08:07	88919	1.00	JL

Qualifiers:
B - Analyte detected in the associated Method Blank
E - Estimated
H - Holding Time Exceeded
S - Spike Recovery outside accepted recovery limits
R - RPD outside accepted recovery limits
J - Analyte detected below quantitation limits

ENVIRONMENTAL MONITORING AND TECHNOLOGIES, INC.

8100 North Austin • Morton Grove, IL 60053-3203
847.967.6666 • 800.246.0663 • fax: 847.967.6735 • www.emt.com

Report of Laboratory Analysis

CLIENT:	EPS Environmental Services, Inc.	**Client Sample ID:**	SB - 8/6'
Lab Order:	14040141	**Report Date:**	4/9/2014
Project:	3122 14th Ave., Kenosha, W	**Collection Date:**	4/1/2014 12:35:00 PM
Lab ID:	14040141-11	**Matrix:**	Soil

Analyses	Result	EMT Reporting Limit	Qual	Units	MDL	Date Analyzed	Batch	DF	Analyst
2-Butanone	< 319	956.		µg/Kg	319	4/5/14 08:07	88919	1.00	JL
2-Hexanone	< 39.2	118.		µg/Kg	39.2	4/5/14 08:07	88919	1.00	JL
4-Methyl-2-pentanone	< 142	425.		µg/Kg	142	4/5/14 08:07	88919	1.00	JL
Acetone	< 375	1120.		µg/Kg	375	4/5/14 08:07	88919	1.00	JL
Acrylonitrile	< 121	362.		µg/Kg	121	4/5/14 08:07	88919	1.00	JL
Benzene	< 25	43.4		µg/Kg	14.5	4/5/14 08:07	88919	1.00	JL
Bromodichloromethane	< 25	54.1		µg/Kg	18.0	4/5/14 08:07	88919	1.00	JL
Bromoform	< 25	73.1		µg/Kg	24.4	4/5/14 08:07	88919	1.00	JL
Bromomethane	< 37.5	112.		µg/Kg	37.5	4/5/14 08:07	88919	1.00	JL
Carbon disulfide	< 25	53.4		µg/Kg	17.8	4/5/14 08:07	88919	1.00	JL
Carbon tetrachloride	< 25	59.7		µg/Kg	19.9	4/5/14 08:07	88919	1.00	JL
Chlorobenzene	< 25	23.6		µg/Kg	7.87	4/5/14 08:07	88919	1.00	JL
Chloroethane	< 31.5	94.4		µg/Kg	31.5	4/5/14 08:07	88919	1.00	JL
Chloroform	< 25	32.2		µg/Kg	10.7	4/5/14 08:07	88919	1.00	JL
Chloromethane	< 43.4	130.		µg/Kg	43.4	4/5/14 08:07	88919	1.00	JL
cis-1,2-Dichloroethene	< 25	41.6		µg/Kg	13.9	4/5/14 08:07	88919	1.00	JL
Dibromochloromethane	< 25	45.		µg/Kg	15.0	4/5/14 08:07	88919	1.00	JL
Ethylbenzene	< 25	73.1		µg/Kg	24.4	4/5/14 08:07	88919	1.00	JL
m,p-Xylene	< 61.4	184.		µg/Kg	61.4	4/5/14 08:07	88919	1.00	JL
Methyl tert-butyl ether	< 25	60.3		µg/Kg	20.1	4/5/14 08:07	88919	1.00	JL
Methylene chloride	< 33.6	101.		µg/Kg	33.6	4/5/14 08:07	88919	1.00	JL
o-Xylene	< 26.9	80.6		µg/Kg	26.9	4/5/14 08:07	88919	1.00	JL
Styrene	< 25	35.6		µg/Kg	11.9	4/5/14 08:07	88919	1.00	JL
Tetrachloroethene	< 25	67.5		µg/Kg	22.5	4/5/14 08:07	88919	1.00	JL
Toluene	< 29.6	88.8		µg/Kg	29.6	4/5/14 08:07	88919	1.00	JL
trans-1,2-Dichloroethene	< 25	69.7		µg/Kg	23.2	4/5/14 08:07	88919	1.00	JL
Trichloroethene	< 25	59.1		µg/Kg	19.7	4/5/14 08:07	88919	1.00	JL
Vinyl acetate	< 25	33.4		µg/Kg	11.1	4/5/14 08:07	88919	1.00	JL
Vinyl chloride	< 25	26.6		µg/Kg	8.85	4/5/14 08:07	88919	1.00	JL
1,3-Dichloropropene, Total	< 50	94.7		µg/Kg	31.6	4/5/14 08:07	88919	1.00	JL
Xylenes, Total	< 88.2	265.		µg/Kg	88.2	4/5/14 08:07	88919	1.00	JL
Surrogates:									
1,2-Dichloroethane-d4	105	70-140		%REC	0	4/5/14 08:07	88919	1.00	JL

Qualifiers:

B - Analyte detected in the associated Method Blank
E - Estimated
H - Holding Time Exceeded
S - Spike Recovery outside accepted recovery limits
R - RPD outside accepted recovery limits
J - Analyte detected below quantitation limits

ENVIRONMENTAL MONITORING AND TECHNOLOGIES, INC.

8100 North Austin • Morton Grove, IL 60053-3203
847.967.6666 • 800.246.0663 • fax: 847.967.6735 • www.emt.com

Report of Laboratory Analysis

CLIENT:	EPS Environmental Services, Inc.	**Client Sample ID:**	SB - 8/6'
Lab Order:	14040141	**Report Date:**	4/9/2014
Project:	3122 14th Ave., Kenosha, W	**Collection Date:**	4/1/2014 12:35:00 PM
Lab ID:	14040141-11	**Matrix:**	Soil

Analyses	Result	EMT Reporting Limit	Qual	Units	MDL	Date Analyzed	Batch	DF	Analyst
4-Bromofluorobenzene	109	80-130		%REC	0	4/5/14 08:07	88919	1.00	JL
d4-1,2-Dichlorobenzene	110	80-125		%REC	0	4/5/14 08:07	88919	1.00	JL
Dibromofluoromethane	99.6	80-125		%REC	0	4/5/14 08:07	88919	1.00	JL
Fluorobenzene	99.1	80-120		%REC	0	4/5/14 08:07	88919	1.00	JL
Toluene-d8	99.8	80-120		%REC	0	4/5/14 08:07	88919	1.00	JL

Qualifiers:

B - Analyte detected in the associated Method Blank
E - Estimated
H - Holding Time Exceeded
S - Spike Recovery outside accepted recovery limits
R - RPD outside accepted recovery limits
J - Analyte detected below quantitation limits

ENVIRONMENTAL MONITORING AND TECHNOLOGIES, INC.

8100 North Austin • Morton Grove, IL 60053-3203
847.967.6666 • 800.246.0663 • fax: 847.967.6735 • www.emt.com

Report of Laboratory Analysis

CLIENT:	EPS Environmental Services, Inc.	**Client Sample ID:**	SB - 9/10'
Lab Order:	14040141	**Report Date:**	4/9/2014
Project:	3122 14th Ave., Kenosha, W	**Collection Date:**	4/1/2014 1:04:00 PM
Lab ID:	14040141-12	**Matrix:**	Soil

Analyses	Result	EMT Reporting Limit	Qual	Units	MDL	Date Analyzed	Batch	DF	Analyst
Percent Moisture		**Method:**		**SM2540G**					
Percent Moisture	14.0	0.100		% (Percent)	0.0150	4/7/14 10:00	R200150	1.00	TB2
Polynuclear Aromatic Hydrocarbons		**Method:**		**SW8310 / SW3540C**					
Acenaphthene	< 5.01	28.9		µg/Kg-dry	5.01	4/8/14	88852	1.00	RYL
Acenaphthylene	< 3.46	145		µg/Kg-dry	3.46	4/8/14	88852	1.00	RYL
Anthracene	< 3.48	28.9		µg/Kg-dry	3.48	4/8/14	88852	1.00	RYL
Benz(a)anthracene	< 3.43	28.9		µg/Kg-dry	3.43	4/8/14	88852	1.00	RYL
Benzo(a)pyrene	< 2.98	28.9		µg/Kg-dry	2.98	4/8/14	88852	1.00	RYL
Benzo(b)fluoranthene	< 3.19	28.9		µg/Kg-dry	3.19	4/8/14	88852	1.00	RYL
Benzo(g,h,i)perylene	< 3.63	28.9		µg/Kg-dry	3.63	4/8/14	88852	1.00	RYL
Benzo(k)fluoranthene	< 2.73	28.9		µg/Kg-dry	2.73	4/8/14	88852	1.00	RYL
Chrysene	< 2.87	28.9		µg/Kg-dry	2.87	4/8/14	88852	1.00	RYL
Dibenz(a,h)anthracene	< 4.28	28.9		µg/Kg-dry	4.28	4/8/14	88852	1.00	RYL
Fluoranthene	< 2.66	28.9		µg/Kg-dry	2.66	4/8/14	88852	1.00	RYL
Fluorene	< 8.23	28.9		µg/Kg-dry	8.23	4/8/14	88852	1.00	RYL
Indeno(1,2,3-cd)pyrene	< 4.62	28.9		µg/Kg-dry	4.62	4/8/14	88852	1.00	RYL
Naphthalene	< 4.07	28.9		µg/Kg-dry	4.07	4/8/14	88852	1.00	RYL
Phenanthrene	38.7	28.9		µg/Kg-dry	6.01	4/8/14	88852	1.00	RYL
Pyrene	< 4.43	28.9		µg/Kg-dry	4.43	4/8/14	88852	1.00	RYL
Surrogates:									
4-Terphenyl-d14	62.2	47.1-125		%REC	0	4/8/14	88852	1.00	RYL
Volatile Organic Compounds by GC/MS		**Method:**		**SW8260B / WDNR: PUBL-FW-140**					
1,1,1-Trichloroethane	< 25	50.		µg/Kg	16.7	4/5/14 08:39	88919	1.00	JL
1,1,2,2-Tetrachloroethane	< 25	48.7		µg/Kg	16.2	4/5/14 08:39	88919	1.00	JL
1,1,2-Trichloroethane	< 26.2	78.7		µg/Kg	26.2	4/5/14 08:39	88919	1.00	JL
1,1-Dichloroethane	< 25	64.4		µg/Kg	21.5	4/5/14 08:39	88919	1.00	JL
1,1-Dichloroethene	< 25	63.4		µg/Kg	21.1	4/5/14 08:39	88919	1.00	JL
1,2-Dibromo-3-chloropropane	< 115	344.		µg/Kg	115	4/5/14 08:39	88919	1.00	JL
1,2-Dibromoethane	< 25	47.2		µg/Kg	15.7	4/5/14 08:39	88919	1.00	JL
1,2-Dichloroethane	< 25	43.1		µg/Kg	14.4	4/5/14 08:39	88919	1.00	JL
1,2-Dichloropropane	< 31	93.1		µg/Kg	31.0	4/5/14 08:39	88919	1.00	JL
1-Butanol	< 1560	4690.		µg/Kg	1,560	4/5/14 08:39	88919	1.00	JL

Qualifiers:

B - Analyte detected in the associated Method Blank
E - Estimated
H - Holding Time Exceeded
S - Spike Recovery outside accepted recovery limits
R - RPD outside accepted recovery limits
J - Analyte detected below quantitation limits

ENVIRONMENTAL MONITORING AND TECHNOLOGIES, INC.

8100 North Austin • Morton Grove, IL 60053-3203
847.967.6666 • 800.246.0663 • fax: 847.967.6735 • www.emt.com

Report of Laboratory Analysis

CLIENT:	EPS Environmental Services, Inc.	**Client Sample ID:**	SB - 9/10'
Lab Order:	14040141	**Report Date:**	4/9/2014
Project:	3122 14th Ave., Kenosha, W	**Collection Date:**	4/1/2014 1:04:00 PM
Lab ID:	14040141-12	**Matrix:**	Soil

Analyses	Result	EMT Reporting Limit	Qual	Units	MDL	Date Analyzed	Batch	DF	Analyst
2-Butanone	< 319	956.		µg/Kg	319	4/5/14 08:39	88919	1.00	JL
2-Hexanone	< 39.2	118.		µg/Kg	39.2	4/5/14 08:39	88919	1.00	JL
4-Methyl-2-pentanone	< 142	425.		µg/Kg	142	4/5/14 08:39	88919	1.00	JL
Acetone	< 375	1120.		µg/Kg	375	4/5/14 08:39	88919	1.00	JL
Acrylonitrile	< 121	362.		µg/Kg	121	4/5/14 08:39	88919	1.00	JL
Benzene	< 25	43.4		µg/Kg	14.5	4/5/14 08:39	88919	1.00	JL
Bromodichloromethane	< 25	54.1		µg/Kg	18.0	4/5/14 08:39	88919	1.00	JL
Bromoform	< 25	73.1		µg/Kg	24.4	4/5/14 08:39	88919	1.00	JL
Bromomethane	< 37.5	112.		µg/Kg	37.5	4/5/14 08:39	88919	1.00	JL
Carbon disulfide	< 25	53.4		µg/Kg	17.8	4/5/14 08:39	88919	1.00	JL
Carbon tetrachloride	< 25	59.7		µg/Kg	19.9	4/5/14 08:39	88919	1.00	JL
Chlorobenzene	< 25	23.6		µg/Kg	7.87	4/5/14 08:39	88919	1.00	JL
Chloroethane	< 31.5	94.4		µg/Kg	31.5	4/5/14 08:39	88919	1.00	JL
Chloroform	< 25	32.2		µg/Kg	10.7	4/5/14 08:39	88919	1.00	JL
Chloromethane	< 43.4	130.		µg/Kg	43.4	4/5/14 08:39	88919	1.00	JL
cis-1,2-Dichloroethene	< 25	41.6		µg/Kg	13.9	4/5/14 08:39	88919	1.00	JL
Dibromochloromethane	< 25	45.		µg/Kg	15.0	4/5/14 08:39	88919	1.00	JL
Ethylbenzene	< 25	73.1		µg/Kg	24.4	4/5/14 08:39	88919	1.00	JL
m,p-Xylene	< 61.4	184.		µg/Kg	61.4	4/5/14 08:39	88919	1.00	JL
Methyl tert-butyl ether	< 25	60.3		µg/Kg	20.1	4/5/14 08:39	88919	1.00	JL
Methylene chloride	< 33.6	101.		µg/Kg	33.6	4/5/14 08:39	88919	1.00	JL
o-Xylene	< 26.9	80.6		µg/Kg	26.9	4/5/14 08:39	88919	1.00	JL
Styrene	< 25	35.6		µg/Kg	11.9	4/5/14 08:39	88919	1.00	JL
Tetrachloroethene	< 25	67.5		µg/Kg	22.5	4/5/14 08:39	88919	1.00	JL
Toluene	< 29.6	88.8		µg/Kg	29.6	4/5/14 08:39	88919	1.00	JL
trans-1,2-Dichloroethene	< 25	69.7		µg/Kg	23.2	4/5/14 08:39	88919	1.00	JL
Trichloroethene	< 25	59.1		µg/Kg	19.7	4/5/14 08:39	88919	1.00	JL
Vinyl acetate	< 25	33.4		µg/Kg	11.1	4/5/14 08:39	88919	1.00	JL
Vinyl chloride	< 25	26.6		µg/Kg	8.85	4/5/14 08:39	88919	1.00	JL
1,3-Dichloropropene, Total	< 50	94.7		µg/Kg	31.6	4/5/14 08:39	88919	1.00	JL
Xylenes, Total	< 88.2	265.		µg/Kg	88.2	4/5/14 08:39	88919	1.00	JL
Surrogates:									
1,2-Dichloroethane-d4	103	70-140		%REC	0	4/5/14 08:39	88919	1.00	JL

Qualifiers:

B - Analyte detected in the associated Method Blank
E - Estimated
H - Holding Time Exceeded
S - Spike Recovery outside accepted recovery limits
R - RPD outside accepted recovery limits
J - Analyte detected below quantitation limits

ENVIRONMENTAL MONITORING AND TECHNOLOGIES, INC.

8100 North Austin • Morton Grove, IL 60053-3203
847.967.6666 • 800.246.0663 • fax: 847.967.6735 • www.emt.com

Report of Laboratory Analysis

CLIENT:	EPS Environmental Services, Inc.	**Client Sample ID:**	SB - 9/10'
Lab Order:	14040141	**Report Date:**	4/9/2014
Project:	3122 14th Ave., Kenosha, W	**Collection Date:**	4/1/2014 1:04:00 PM
Lab ID:	14040141-12	**Matrix:**	Soil

Analyses	Result	EMT Reporting Limit	Qual	Units	MDL	Date Analyzed	Batch	DF	Analyst
4-Bromofluorobenzene	111	80-130		%REC	0	4/5/14 08:39	88919	1.00	JL
d4-1,2-Dichlorobenzene	107	80-125		%REC	0	4/5/14 08:39	88919	1.00	JL
Dibromofluoromethane	104	80-125		%REC	0	4/5/14 08:39	88919	1.00	JL
Fluorobenzene	98.6	80-120		%REC	0	4/5/14 08:39	88919	1.00	JL
Toluene-d8	95.5	80-120		%REC	0	4/5/14 08:39	88919	1.00	JL

Qualifiers:

B - Analyte detected in the associated Method Blank
E - Estimated
H - Holding Time Exceeded
S - Spike Recovery outside accepted recovery limits
R - RPD outside accepted recovery limits
J - Analyte detected below quantitation limits

ENVIRONMENTAL MONITORING AND TECHNOLOGIES, INC.

8100 North Austin • Morton Grove, IL 60053-3203
847.967.6666 • 800.246.0663 • fax: 847.967.6735 • www.emt.com

Report of Laboratory Analysis

CLIENT:	EPS Environmental Services, Inc.	**Client Sample ID:**	SB - 9/16'
Lab Order:	14040141	**Report Date:**	4/9/2014
Project:	3122 14th Ave., Kenosha, W	**Collection Date:**	4/1/2014 1:30:00 PM
Lab ID:	14040141-13	**Matrix:**	Soil

Analyses	Result	EMT Reporting Limit	Qual	Units	MDL	Date Analyzed	Batch	DF	Analyst
Percent Moisture		**Method:**		**SM2540G**					
Percent Moisture	16.0	0.100		% (Percent)	0.0150	4/7/14 10:00	R200150	1.00	TB2
Polynuclear Aromatic Hydrocarbons		**Method:**		**SW8310 / SW3540C**					
Acenaphthene	< 4.98	28.8		µg/Kg-dry	4.98	4/8/14	88852	1.00	RYL
Acenaphthylene	< 3.44	144		µg/Kg-dry	3.44	4/8/14	88852	1.00	RYL
Anthracene	< 3.46	28.8		µg/Kg-dry	3.46	4/8/14	88852	1.00	RYL
Benz(a)anthracene	< 3.42	28.8		µg/Kg-dry	3.42	4/8/14	88852	1.00	RYL
Benzo(a)pyrene	< 2.97	28.8		µg/Kg-dry	2.97	4/8/14	88852	1.00	RYL
Benzo(b)fluoranthene	< 3.17	28.8		µg/Kg-dry	3.17	4/8/14	88852	1.00	RYL
Benzo(g,h,i)perylene	< 3.61	28.8		µg/Kg-dry	3.61	4/8/14	88852	1.00	RYL
Benzo(k)fluoranthene	< 2.71	28.8		µg/Kg-dry	2.71	4/8/14	88852	1.00	RYL
Chrysene	< 2.85	28.8		µg/Kg-dry	2.85	4/8/14	88852	1.00	RYL
Dibenz(a,h)anthracene	< 4.26	28.8		µg/Kg-dry	4.26	4/8/14	88852	1.00	RYL
Fluoranthene	< 2.65	28.8		µg/Kg-dry	2.65	4/8/14	88852	1.00	RYL
Fluorene	< 8.19	28.8		µg/Kg-dry	8.19	4/8/14	88852	1.00	RYL
Indeno(1,2,3-cd)pyrene	< 4.6	28.8		µg/Kg-dry	4.60	4/8/14	88852	1.00	RYL
Naphthalene	< 4.05	28.8		µg/Kg-dry	4.05	4/8/14	88852	1.00	RYL
Phenanthrene	< 5.98	28.8		µg/Kg-dry	5.98	4/8/14	88852	1.00	RYL
Pyrene	< 4.41	28.8		µg/Kg-dry	4.41	4/8/14	88852	1.00	RYL
Surrogates:									
4-Terphenyl-d14	78.5	47.1-125		%REC	0	4/8/14	88852	1.00	RYL
Volatile Organic Compounds by GC/MS		**Method:**		**SW8260B / WDNR: PUBL-FW-140**					
1,1,1-Trichloroethane	< 25	48.		µg/Kg	16.0	4/5/14 09:11	88919	1.00	JL
1,1,2,2-Tetrachloroethane	< 25	46.8		µg/Kg	15.6	4/5/14 09:11	88919	1.00	JL
1,1,2-Trichloroethane	< 25.2	75.6		µg/Kg	25.2	4/5/14 09:11	88919	1.00	JL
1,1-Dichloroethane	< 25	61.8		µg/Kg	20.6	4/5/14 09:11	88919	1.00	JL
1,1-Dichloroethene	< 25	60.9		µg/Kg	20.3	4/5/14 09:11	88919	1.00	JL
1,2-Dibromo-3-chloropropane	< 110	330.		µg/Kg	110	4/5/14 09:11	88919	1.00	JL
1,2-Dibromoethane	< 25	45.3		µg/Kg	15.1	4/5/14 09:11	88919	1.00	JL
1,2-Dichloroethane	< 25	41.4		µg/Kg	13.8	4/5/14 09:11	88919	1.00	JL
1,2-Dichloropropane	< 29.8	89.4		µg/Kg	29.8	4/5/14 09:11	88919	1.00	JL
1-Butanol	< 1500	4500.		µg/Kg	1,500	4/5/14 09:11	88919	1.00	JL

Qualifiers:

B - Analyte detected in the associated Method Blank
E - Estimated
H - Holding Time Exceeded
S - Spike Recovery outside accepted recovery limits
R - RPD outside accepted recovery limits
J - Analyte detected below quantitation limits

ENVIRONMENTAL MONITORING AND TECHNOLOGIES, INC.

8100 North Austin • Morton Grove, IL 60053-3203
847.967.6666 • 800.246.0663 • fax: 847.967.6735 • www.emt.com

Report of Laboratory Analysis

CLIENT:	EPS Environmental Services, Inc.	**Client Sample ID:**	SB - 9/16'
Lab Order:	14040141	**Report Date:**	4/9/2014
Project:	3122 14th Ave., Kenosha, W	**Collection Date:**	4/1/2014 1:30:00 PM
Lab ID:	14040141-13	**Matrix:**	Soil

Analyses	Result	EMT Reporting Limit	Qual	Units	MDL	Date Analyzed	Batch	DF	Analyst
2-Butanone	< 306	918.		µg/Kg	306	4/5/14 09:11	88919	1.00	JL
2-Hexanone	< 37.6	113.		µg/Kg	37.6	4/5/14 09:11	88919	1.00	JL
4-Methyl-2-pentanone	< 136	408.		µg/Kg	136	4/5/14 09:11	88919	1.00	JL
Acetone	< 360	1080.		µg/Kg	360	4/5/14 09:11	88919	1.00	JL
Acrylonitrile	< 116	348.		µg/Kg	116	4/5/14 09:11	88919	1.00	JL
Benzene	< 25	41.7		µg/Kg	13.9	4/5/14 09:11	88919	1.00	JL
Bromodichloromethane	< 25	51.9		µg/Kg	17.3	4/5/14 09:11	88919	1.00	JL
Bromoform	< 25	70.2		µg/Kg	23.4	4/5/14 09:11	88919	1.00	JL
Bromomethane	< 36	108.		µg/Kg	36.0	4/5/14 09:11	88919	1.00	JL
Carbon disulfide	< 25	51.3		µg/Kg	17.1	4/5/14 09:11	88919	1.00	JL
Carbon tetrachloride	< 25	57.3		µg/Kg	19.1	4/5/14 09:11	88919	1.00	JL
Chlorobenzene	< 25	22.7		µg/Kg	7.56	4/5/14 09:11	88919	1.00	JL
Chloroethane	< 30.2	90.6		µg/Kg	30.2	4/5/14 09:11	88919	1.00	JL
Chloroform	< 25	30.9		µg/Kg	10.3	4/5/14 09:11	88919	1.00	JL
Chloromethane	< 41.7	125.		µg/Kg	41.7	4/5/14 09:11	88919	1.00	JL
cis-1,2-Dichloroethene	< 25	39.9		µg/Kg	13.3	4/5/14 09:11	88919	1.00	JL
Dibromochloromethane	< 25	43.2		µg/Kg	14.4	4/5/14 09:11	88919	1.00	JL
Ethylbenzene	< 25	70.2		µg/Kg	23.4	4/5/14 09:11	88919	1.00	JL
m,p-Xylene	< 58.9	177.		µg/Kg	58.9	4/5/14 09:11	88919	1.00	JL
Methyl tert-butyl ether	< 25	57.9		µg/Kg	19.3	4/5/14 09:11	88919	1.00	JL
Methylene chloride	< 32.3	96.9		µg/Kg	32.3	4/5/14 09:11	88919	1.00	JL
o-Xylene	< 25.8	77.4		µg/Kg	25.8	4/5/14 09:11	88919	1.00	JL
Styrene	< 25	34.2		µg/Kg	11.4	4/5/14 09:11	88919	1.00	JL
Tetrachloroethene	< 25	64.8		µg/Kg	21.6	4/5/14 09:11	88919	1.00	JL
Toluene	< 28.4	85.2		µg/Kg	28.4	4/5/14 09:11	88919	1.00	JL
trans-1,2-Dichloroethene	< 25	66.9		µg/Kg	22.3	4/5/14 09:11	88919	1.00	JL
Trichloroethene	< 25	56.7		µg/Kg	18.9	4/5/14 09:11	88919	1.00	JL
Vinyl acetate	< 25	32.1		µg/Kg	10.7	4/5/14 09:11	88919	1.00	JL
Vinyl chloride	< 25	25.5		µg/Kg	8.50	4/5/14 09:11	88919	1.00	JL
1,3-Dichloropropene, Total	< 50	90.9		µg/Kg	30.3	4/5/14 09:11	88919	1.00	JL
Xylenes, Total	< 84.7	254.		µg/Kg	84.7	4/5/14 09:11	88919	1.00	JL
Surrogates:									
1,2-Dichloroethane-d4	94.7	70-140		%REC	0	4/5/14 09:11	88919	1.00	JL

Qualifiers:

B - Analyte detected in the associated Method Blank
E - Estimated
H - Holding Time Exceeded
S - Spike Recovery outside accepted recovery limits
R - RPD outside accepted recovery limits
J - Analyte detected below quantitation limits

ENVIRONMENTAL MONITORING AND TECHNOLOGIES, INC.

8100 North Austin • Morton Grove, IL 60053-3203
847.967.6666 • 800.246.0663 • fax: 847.967.6735 • www.emt.com

Report of Laboratory Analysis

CLIENT:	EPS Environmental Services, Inc.	**Client Sample ID:**	SB - 9/16'
Lab Order:	14040141	**Report Date:**	4/9/2014
Project:	3122 14th Ave., Kenosha, W	**Collection Date:**	4/1/2014 1:30:00 PM
Lab ID:	14040141-13	**Matrix:**	Soil

Analyses	Result	EMT Reporting Limit	Qual	Units	MDL	Date Analyzed	Batch	DF	Analyst
4-Bromofluorobenzene	114	80-130		%REC	0	4/5/14 09:11	88919	1.00	JL
d4-1,2-Dichlorobenzene	107	80-125		%REC	0	4/5/14 09:11	88919	1.00	JL
Dibromofluoromethane	96.8	80-125		%REC	0	4/5/14 09:11	88919	1.00	JL
Fluorobenzene	100	80-120		%REC	0	4/5/14 09:11	88919	1.00	JL
Toluene-d8	99.1	80-120		%REC	0	4/5/14 09:11	88919	1.00	JL

Qualifiers:

B - Analyte detected in the associated Method Blank
E - Estimated
H - Holding Time Exceeded
S - Spike Recovery outside accepted recovery limits
R - RPD outside accepted recovery limits
J - Analyte detected below quantitation limits

ENVIRONMENTAL MONITORING AND TECHNOLOGIES, INC.

8100 North Austin • Morton Grove, IL 60053-3203
847.967.6666 • 800.246.0663 • fax: 847.967.6735 • www.emt.com

Report of Laboratory Analysis

CLIENT:	EPS Environmental Services, Inc.	**Client Sample ID:**	SB - 10/6'
Lab Order:	14040141	**Report Date:**	4/9/2014
Project:	3122 14th Ave., Kenosha, W	**Collection Date:**	4/1/2014 1:52:00 PM
Lab ID:	14040141-14	**Matrix:**	Soil

Analyses	Result	EMT Reporting Limit	Qual	Units	MDL	Date Analyzed	Batch	DF	Analyst
Percent Moisture		**Method:**		**SM2540G**					
Percent Moisture	12.7	0.100		% (Percent)	0.0150	4/7/14 10:00	R200150	1.00	TB2
Polynuclear Aromatic Hydrocarbons		**Method:**		**SW8310 / SW3540C**					
Acenaphthene	< 4.91	28.3		µg/Kg-dry	4.91	4/8/14	88852	1.00	RYL
Acenaphthylene	< 3.39	142		µg/Kg-dry	3.39	4/8/14	88852	1.00	RYL
Anthracene	< 3.41	28.3		µg/Kg-dry	3.41	4/8/14	88852	1.00	RYL
Benz(a)anthracene	< 3.37	28.3		µg/Kg-dry	3.37	4/8/14	88852	1.00	RYL
Benzo(a)pyrene	< 2.92	28.3		µg/Kg-dry	2.92	4/8/14	88852	1.00	RYL
Benzo(b)fluoranthene	< 3.13	28.3		µg/Kg-dry	3.13	4/8/14	88852	1.00	RYL
Benzo(g,h,i)perylene	< 3.56	28.3		µg/Kg-dry	3.56	4/8/14	88852	1.00	RYL
Benzo(k)fluoranthene	< 2.67	28.3		µg/Kg-dry	2.67	4/8/14	88852	1.00	RYL
Chrysene	< 2.81	28.3		µg/Kg-dry	2.81	4/8/14	88852	1.00	RYL
Dibenz(a,h)anthracene	< 4.19	28.3		µg/Kg-dry	4.19	4/8/14	88852	1.00	RYL
Fluoranthene	< 2.61	28.3		µg/Kg-dry	2.61	4/8/14	88852	1.00	RYL
Fluorene	< 8.07	28.3		µg/Kg-dry	8.07	4/8/14	88852	1.00	RYL
Indeno(1,2,3-cd)pyrene	< 4.53	28.3		µg/Kg-dry	4.53	4/8/14	88852	1.00	RYL
Naphthalene	< 3.99	28.3		µg/Kg-dry	3.99	4/8/14	88852	1.00	RYL
Phenanthrene	18	28.3	J	µg/Kg-dry	5.89	4/8/14	88852	1.00	RYL
Pyrene	< 4.34	28.3		µg/Kg-dry	4.34	4/8/14	88852	1.00	RYL
Surrogates:									
4-Terphenyl-d14	77.0	47.1-125		%REC	0	4/8/14	88852	1.00	RYL
Volatile Organic Compounds by GC/MS		**Method:**		**SW8260B / WDNR: PUBL-FW-140**					
1,1,1-Trichloroethane	< 25	50.		µg/Kg	16.7	4/5/14 12:54	88920	1.00	JL
1,1,2,2-Tetrachloroethane	< 25	48.7		µg/Kg	16.2	4/5/14 12:54	88920	1.00	JL
1,1,2-Trichloroethane	< 26.2	78.7		µg/Kg	26.2	4/5/14 12:54	88920	1.00	JL
1,1-Dichloroethane	< 25	64.4		µg/Kg	21.5	4/5/14 12:54	88920	1.00	JL
1,1-Dichloroethene	< 25	63.4		µg/Kg	21.1	4/5/14 12:54	88920	1.00	JL
1,2-Dibromo-3-chloropropane	< 115	344.		µg/Kg	115	4/5/14 12:54	88920	1.00	JL
1,2-Dibromoethane	< 25	47.2		µg/Kg	15.7	4/5/14 12:54	88920	1.00	JL
1,2-Dichloroethane	< 25	43.1		µg/Kg	14.4	4/5/14 12:54	88920	1.00	JL
1,2-Dichloropropane	< 31	93.1		µg/Kg	31.0	4/5/14 12:54	88920	1.00	JL
1-Butanol	< 1560	4690.		µg/Kg	1,560	4/5/14 12:54	88920	1.00	JL

Qualifiers:

B - Analyte detected in the associated Method Blank
E - Estimated
H - Holding Time Exceeded
S - Spike Recovery outside accepted recovery limits
R - RPD outside accepted recovery limits
J - Analyte detected below quantitation limits

ENVIRONMENTAL MONITORING AND TECHNOLOGIES, INC.

8100 North Austin • Morton Grove, IL 60053-3203
847.967.6666 • 800.246.0663 • fax: 847.967.6735 • www.emt.com

Report of Laboratory Analysis

CLIENT:	EPS Environmental Services, Inc.	**Client Sample ID:**	SB - 10/6'
Lab Order:	14040141	**Report Date:**	4/9/2014
Project:	3122 14th Ave., Kenosha, W	**Collection Date:**	4/1/2014 1:52:00 PM
Lab ID:	14040141-14	**Matrix:**	Soil

Analyses	Result	EMT Reporting Limit	Qual	Units	MDL	Date Analyzed	Batch	DF	Analyst
2-Butanone	< 319	956.		µg/Kg	319	4/5/14 12:54	88920	1.00	JL
2-Hexanone	< 39.2	118.		µg/Kg	39.2	4/5/14 12:54	88920	1.00	JL
4-Methyl-2-pentanone	< 142	425.		µg/Kg	142	4/5/14 12:54	88920	1.00	JL
Acetone	< 375	1120.		µg/Kg	375	4/5/14 12:54	88920	1.00	JL
Acrylonitrile	< 121	362.		µg/Kg	121	4/5/14 12:54	88920	1.00	JL
Benzene	< 25	43.4		µg/Kg	14.5	4/5/14 12:54	88920	1.00	JL
Bromodichloromethane	< 25	54.1		µg/Kg	18.0	4/5/14 12:54	88920	1.00	JL
Bromoform	< 25	73.1		µg/Kg	24.4	4/5/14 12:54	88920	1.00	JL
Bromomethane	< 37.5	112.		µg/Kg	37.5	4/5/14 12:54	88920	1.00	JL
Carbon disulfide	< 25	53.4		µg/Kg	17.8	4/5/14 12:54	88920	1.00	JL
Carbon tetrachloride	< 25	59.7		µg/Kg	19.9	4/5/14 12:54	88920	1.00	JL
Chlorobenzene	< 25	23.6		µg/Kg	7.87	4/5/14 12:54	88920	1.00	JL
Chloroethane	< 31.5	94.4		µg/Kg	31.5	4/5/14 12:54	88920	1.00	JL
Chloroform	< 25	32.2		µg/Kg	10.7	4/5/14 12:54	88920	1.00	JL
Chloromethane	< 43.4	130.		µg/Kg	43.4	4/5/14 12:54	88920	1.00	JL
cis-1,2-Dichloroethene	< 25	41.6		µg/Kg	13.9	4/5/14 12:54	88920	1.00	JL
Dibromochloromethane	< 25	45.		µg/Kg	15.0	4/5/14 12:54	88920	1.00	JL
Ethylbenzene	< 25	73.1		µg/Kg	24.4	4/5/14 12:54	88920	1.00	JL
m,p-Xylene	< 61.4	184.		µg/Kg	61.4	4/5/14 12:54	88920	1.00	JL
Methyl tert-butyl ether	< 25	60.3		µg/Kg	20.1	4/5/14 12:54	88920	1.00	JL
Methylene chloride	< 33.6	101.		µg/Kg	33.6	4/5/14 12:54	88920	1.00	JL
o-Xylene	< 26.9	80.6		µg/Kg	26.9	4/5/14 12:54	88920	1.00	JL
Styrene	< 25	35.6		µg/Kg	11.9	4/5/14 12:54	88920	1.00	JL
Tetrachloroethene	< 25	67.5		µg/Kg	22.5	4/5/14 12:54	88920	1.00	JL
Toluene	< 29.6	88.8		µg/Kg	29.6	4/5/14 12:54	88920	1.00	JL
trans-1,2-Dichloroethene	< 25	69.7		µg/Kg	23.2	4/5/14 12:54	88920	1.00	JL
Trichloroethene	< 25	59.1		µg/Kg	19.7	4/5/14 12:54	88920	1.00	JL
Vinyl acetate	< 25	33.4		µg/Kg	11.1	4/5/14 12:54	88920	1.00	JL
Vinyl chloride	< 25	26.6		µg/Kg	8.85	4/5/14 12:54	88920	1.00	JL
1,3-Dichloropropene, Total	< 50	94.7		µg/Kg	31.6	4/5/14 12:54	88920	1.00	JL
Xylenes, Total	< 88.2	265.		µg/Kg	88.2	4/5/14 12:54	88920	1.00	JL
Surrogates:									
1,2-Dichloroethane-d4	98.5	70-140		%REC	0	4/5/14 12:54	88920	1.00	JL

Qualifiers:

B - Analyte detected in the associated Method Blank
E - Estimated
H - Holding Time Exceeded
S - Spike Recovery outside accepted recovery limits
R - RPD outside accepted recovery limits
J - Analyte detected below quantitation limits

ENVIRONMENTAL MONITORING AND TECHNOLOGIES, INC.

8100 North Austin • Morton Grove, IL 60053-3203
847.967.6666 • 800.246.0663 • fax: 847.967.6735 • www.emt.com

Report of Laboratory Analysis

CLIENT:	EPS Environmental Services, Inc.	**Client Sample ID:**	SB - 10/6'
Lab Order:	14040141	**Report Date:**	4/9/2014
Project:	3122 14th Ave., Kenosha, W	**Collection Date:**	4/1/2014 1:52:00 PM
Lab ID:	14040141-14	**Matrix:**	Soil

Analyses	Result	EMT Reporting Limit	Qual	Units	MDL	Date Analyzed	Batch	DF	Analyst
4-Bromofluorobenzene	114	80-130		%REC	0	4/5/14 12:54	88920	1.00	JL
d4-1,2-Dichlorobenzene	110	80-125		%REC	0	4/5/14 12:54	88920	1.00	JL
Dibromofluoromethane	101	80-125		%REC	0	4/5/14 12:54	88920	1.00	JL
Fluorobenzene	99.3	80-120		%REC	0	4/5/14 12:54	88920	1.00	JL
Toluene-d8	101	80-120		%REC	0	4/5/14 12:54	88920	1.00	JL

Qualifiers:

B - Analyte detected in the associated Method Blank
E - Estimated
H - Holding Time Exceeded
S - Spike Recovery outside accepted recovery limits
R - RPD outside accepted recovery limits
J - Analyte detected below quantitation limits

ENVIRONMENTAL MONITORING AND TECHNOLOGIES, INC.

8100 North Austin • Morton Grove, IL 60053-3203
847.967.6666 • 800.246.0663 • fax: 847.967.6735 • www.emt.com

Report of Laboratory Analysis

CLIENT:	EPS Environmental Services, Inc.	**Client Sample ID:**	GW-1
Lab Order:	14040141	**Report Date:**	4/9/2014
Project:	3122 14th Ave., Kenosha, W	**Collection Date:**	4/1/2014 2:09:00 PM
Lab ID:	14040141-15	**Matrix:**	Groundwater

Analyses	Result	EMT Reporting Limit	Qual	Units	MDL	Date Analyzed	Batch	DF	Analyst
Polynuclear Aromatic Hydrocarbons		**Method:**		**SW8310 / SW3510C**					
Acenaphthene	< 0.051	0.102		µg/L	0.0510	4/4/14	88873	1.00	RYL
Acenaphthylene	< 0.51	0.510		µg/L	0.510	4/4/14	88873	1.00	RYL
Anthracene	< 0.051	0.102		µg/L	0.0510	4/4/14	88873	1.00	RYL
Benz(a)anthracene	< 0.051	0.102		µg/L	0.0510	4/4/14	88873	1.00	RYL
Benzo(a)pyrene	< 0.051	0.102		µg/L	0.0510	4/4/14	88873	1.00	RYL
Benzo(b)fluoranthene	< 0.051	0.102		µg/L	0.0510	4/4/14	88873	1.00	RYL
Benzo(g,h,i)perylene	< 0.051	0.102		µg/L	0.0510	4/4/14	88873	1.00	RYL
Benzo(k)fluoranthene	< 0.051	0.102		µg/L	0.0510	4/4/14	88873	1.00	RYL
Chrysene	< 0.051	0.102		µg/L	0.0510	4/4/14	88873	1.00	RYL
Dibenz(a,h)anthracene	< 0.051	0.102		µg/L	0.0510	4/4/14	88873	1.00	RYL
Fluoranthene	< 0.051	0.102		µg/L	0.0510	4/4/14	88873	1.00	RYL
Fluorene	< 0.051	0.102		µg/L	0.0510	4/4/14	88873	1.00	RYL
Indeno(1,2,3-cd)pyrene	< 0.051	0.102		µg/L	0.0510	4/4/14	88873	1.00	RYL
Naphthalene	< 0.051	0.102		µg/L	0.0510	4/4/14	88873	1.00	RYL
Phenanthrene	< 0.051	0.102		µg/L	0.0510	4/4/14	88873	1.00	RYL
Pyrene	< 0.051	0.102		µg/L	0.0510	4/4/14	88873	1.00	RYL
Surrogates:									
4-Terphenyl-d14	78.4	60-115		%REC	0	4/4/14	88873	1.00	RYL
Volatile Organic Compounds by GC/MS		**Method:**		**SW8260B / SW5030A**					
1,1,1-Trichloroethane	< 0.349	2.00		µg/L	0.349	4/4/14 18:15	88915	1.00	JL
1,1,2,2-Tetrachloroethane	< 0.291	2.00		µg/L	0.291	4/4/14 18:15	88915	1.00	JL
1,1,2-Trichloroethane	< 0.264	2.00		µg/L	0.264	4/4/14 18:15	88915	1.00	JL
1,1-Dichloroethane	< 1.94	8.00		µg/L	1.94	4/4/14 18:15	88915	1.00	JL
1,1-Dichloroethene	< 1.02	4.00		µg/L	1.02	4/4/14 18:15	88915	1.00	JL
1,2-Dibromo-3-chloropropane	< 0.488	2.00		µg/L	0.488	4/4/14 18:15	88915	1.00	JL
1,2-Dibromoethane	< 0.32	2.00		µg/L	0.320	4/4/14 18:15	88915	1.00	JL
1,2-Dichloroethane	< 0.274	2.00		µg/L	0.274	4/4/14 18:15	88915	1.00	JL
1,2-Dichloropropane	< 1.11	4.00		µg/L	1.11	4/4/14 18:15	88915	1.00	JL
1-Butanol	< 6.69	90.0		µg/L	6.69	4/4/14 18:15	88915	1.00	JL
2-Butanone	< 1.38	8.00		µg/L	1.38	4/4/14 18:15	88915	1.00	JL
2-Hexanone	< 1.04	8.00		µg/L	1.04	4/4/14 18:15	88915	1.00	JL

Qualifiers:

B - Analyte detected in the associated Method Blank
E - Estimated
H - Holding Time Exceeded
S - Spike Recovery outside accepted recovery limits
R - RPD outside accepted recovery limits
J - Analyte detected below quantitation limits

ENVIRONMENTAL MONITORING AND TECHNOLOGIES, INC.

8100 North Austin • Morton Grove, IL 60053-3203
847.967.6666 • 800.246.0663 • fax: 847.967.6735 • www.emt.com

Report of Laboratory Analysis

CLIENT:	EPS Environmental Services, Inc.	**Client Sample ID:**	GW-1
Lab Order:	14040141	**Report Date:**	4/9/2014
Project:	3122 14th Ave., Kenosha, W	**Collection Date:**	4/1/2014 2:09:00 PM
Lab ID:	14040141-15	**Matrix:**	Groundwater

Analyses	Result	EMT Reporting Limit	Qual	Units	MDL	Date Analyzed	Batch	DF	Analyst
4-Methyl-2-pentanone	< 0.659	28.0		µg/L	0.659	4/4/14 18:15	88915	1.00	JL
Acetone	< 3.75	28.0		µg/L	3.75	4/4/14 18:15	88915	1.00	JL
Acrylonitrile	< 0.742	4.00		µg/L	0.742	4/4/14 18:15	88915	1.00	JL
Benzene	< 0.37	2.00		µg/L	0.370	4/4/14 18:15	88915	1.00	JL
Bromodichloromethane	< 0.31	2.00		µg/L	0.310	4/4/14 18:15	88915	1.00	JL
Bromoform	< 0.254	2.00		µg/L	0.254	4/4/14 18:15	88915	1.00	JL
Bromomethane	< 3.3	20.0		µg/L	3.30	4/4/14 18:15	88915	1.00	JL
Carbon disulfide	< 0.259	2.00		µg/L	0.259	4/4/14 18:15	88915	1.00	JL
Carbon tetrachloride	< 0.39	2.00		µg/L	0.390	4/4/14 18:15	88915	1.00	JL
Chlorobenzene	< 0.358	2.00		µg/L	0.358	4/4/14 18:15	88915	1.00	JL
Chloroethane	< 0.907	4.00		µg/L	0.907	4/4/14 18:15	88915	1.00	JL
Chloroform	< 0.397	2.00		µg/L	0.397	4/4/14 18:15	88915	1.00	JL
Chloromethane	< 2.23	8.00		µg/L	2.23	4/4/14 18:15	88915	1.00	JL
cis-1,2-Dichloroethene	< 0.421	2.00		µg/L	0.421	4/4/14 18:15	88915	1.00	JL
Dibromochloromethane	< 0.492	2.00		µg/L	0.492	4/4/14 18:15	88915	1.00	JL
Ethylbenzene	< 0.431	2.00		µg/L	0.431	4/4/14 18:15	88915	1.00	JL
m,p-Xylene	< 0.31	4.00		µg/L	0.310	4/4/14 18:15	88915	1.00	JL
Methyl tert-butyl ether	< 0.322	2.00		µg/L	0.322	4/4/14 18:15	88915	1.00	JL
Methylene chloride	0.61	2.00	J	µg/L	0.358	4/4/14 18:15	88915	1.00	JL
o-Xylene	< 0.349	2.00		µg/L	0.349	4/4/14 18:15	88915	1.00	JL
Styrene	< 0.534	4.00		µg/L	0.534	4/4/14 18:15	88915	1.00	JL
Tetrachloroethene	< 0.4	2.00		µg/L	0.400	4/4/14 18:15	88915	1.00	JL
Toluene	< 0.299	2.00		µg/L	0.299	4/4/14 18:15	88915	1.00	JL
trans-1,2-Dichloroethene	< 0.433	2.00		µg/L	0.433	4/4/14 18:15	88915	1.00	JL
Trichloroethene	< 0.439	2.00		µg/L	0.439	4/4/14 18:15	88915	1.00	JL
Vinyl acetate	< 1.01	8.00		µg/L	1.01	4/4/14 18:15	88915	1.00	JL
Vinyl chloride	< 0.316	2.00		µg/L	0.316	4/4/14 18:15	88915	1.00	JL
1,3-Dichloropropene, Total	< 0.592	4.00		µg/L	0.592	4/4/14 18:15	88915	1.00	JL
Xylenes, Total	< 0.66	6.00		µg/L	0.660	4/4/14 18:15	88915	1.00	JL
Surrogates:									
1,2-Dichloroethane-d4	100	81-118		%REC	1.51	4/4/14 18:15	88915	1.00	JL
4-Bromofluorobenzene	117	85-114	S	%REC	0.809	4/4/14 18:15	88915	1.00	JL
d4-1,2-Dichlorobenzene	116	80-120		%REC	1.18	4/4/14 18:15	88915	1.00	JL

Qualifiers:

B - Analyte detected in the associated Method Blank
E - Estimated
H - Holding Time Exceeded
S - Spike Recovery outside accepted recovery limits
R - RPD outside accepted recovery limits
J - Analyte detected below quantitation limits

ENVIRONMENTAL MONITORING AND TECHNOLOGIES, INC.

8100 North Austin • Morton Grove, IL 60053-3203
847.967.6666 • 800.246.0663 • fax: 847.967.6735 • www.emt.com

Report of Laboratory Analysis

CLIENT:	EPS Environmental Services, Inc.	**Client Sample ID:**	GW-1
Lab Order:	14040141	**Report Date:**	4/9/2014
Project:	3122 14th Ave., Kenosha, W	**Collection Date:**	4/1/2014 2:09:00 PM
Lab ID:	14040141-15	**Matrix:**	Groundwater

Analyses	Result	EMT Reporting Limit	Qual	Units	MDL	Date Analyzed	Batch	DF	Analyst
Dibromofluoromethane	104	80-119		%REC	1.06	4/4/14 18:15	88915	1.00	JL
Fluorobenzene	99.1	80-116	J	%REC	0.680	4/4/14 18:15	88915	1.00	JL
Toluene-d8	99.2	89-112	J	%REC	1.10	4/4/14 18:15	88915	1.00	JL

Qualifiers:

B - Analyte detected in the associated Method Blank
E - Estimated
H - Holding Time Exceeded
S - Spike Recovery outside accepted recovery limits
R - RPD outside accepted recovery limits
J - Analyte detected below quantitation limits

ENVIRONMENTAL MONITORING AND TECHNOLOGIES, INC.

8100 North Austin • Morton Grove, IL 60053-3203
847.967.6666 • 800.246.0663 • fax: 847.967.6735 • www.emt.com

Report of Laboratory Analysis

CLIENT:	EPS Environmental Services, Inc.	**Client Sample ID:**	GW - 3
Lab Order:	14040141	**Report Date:**	4/9/2014
Project:	3122 14th Ave., Kenosha, W	**Collection Date:**	4/1/2014 2:30:00 PM
Lab ID:	14040141-16	**Matrix:**	Groundwater

Analyses	Result	EMT Reporting Limit	Qual	Units	MDL	Date Analyzed	Batch	DF	Analyst
Polynuclear Aromatic Hydrocarbons		**Method:**		**SW8310 / SW3510C**					
Acenaphthene	< 0.0528	0.106		µg/L	0.0528	4/4/14	88873	1.00	RYL
Acenaphthylene	< 0.528	0.528		µg/L	0.528	4/4/14	88873	1.00	RYL
Anthracene	< 0.0528	0.106		µg/L	0.0528	4/4/14	88873	1.00	RYL
Benz(a)anthracene	< 0.0528	0.106		µg/L	0.0528	4/4/14	88873	1.00	RYL
Benzo(a)pyrene	< 0.0528	0.106		µg/L	0.0528	4/4/14	88873	1.00	RYL
Benzo(b)fluoranthene	< 0.0528	0.106		µg/L	0.0528	4/4/14	88873	1.00	RYL
Benzo(g,h,i)perylene	< 0.0528	0.106		µg/L	0.0528	4/4/14	88873	1.00	RYL
Benzo(k)fluoranthene	< 0.0528	0.106		µg/L	0.0528	4/4/14	88873	1.00	RYL
Chrysene	< 0.0528	0.106		µg/L	0.0528	4/4/14	88873	1.00	RYL
Dibenz(a,h)anthracene	< 0.0528	0.106		µg/L	0.0528	4/4/14	88873	1.00	RYL
Fluoranthene	< 0.0528	0.106		µg/L	0.0528	4/4/14	88873	1.00	RYL
Fluorene	< 0.0528	0.106		µg/L	0.0528	4/4/14	88873	1.00	RYL
Indeno(1,2,3-cd)pyrene	< 0.0528	0.106		µg/L	0.0528	4/4/14	88873	1.00	RYL
Naphthalene	< 0.0528	0.106		µg/L	0.0528	4/4/14	88873	1.00	RYL
Phenanthrene	< 0.0528	0.106		µg/L	0.0528	4/4/14	88873	1.00	RYL
Pyrene	< 0.0528	0.106		µg/L	0.0528	4/4/14	88873	1.00	RYL
Surrogates:									
4-Terphenyl-d14	87.4	60-115		%REC	0	4/4/14	88873	1.00	RYL
Volatile Organic Compounds by GC/MS		**Method:**		**SW8260B / SW5030A**					
1,1,1-Trichloroethane	< 0.349	2.00		µg/L	0.349	4/4/14 18:47	88915	1.00	JL
1,1,2,2-Tetrachloroethane	< 0.291	2.00		µg/L	0.291	4/4/14 18:47	88915	1.00	JL
1,1,2-Trichloroethane	< 0.264	2.00		µg/L	0.264	4/4/14 18:47	88915	1.00	JL
1,1-Dichloroethane	< 1.94	8.00		µg/L	1.94	4/4/14 18:47	88915	1.00	JL
1,1-Dichloroethene	< 1.02	4.00		µg/L	1.02	4/4/14 18:47	88915	1.00	JL
1,2-Dibromo-3-chloropropane	< 0.488	2.00		µg/L	0.488	4/4/14 18:47	88915	1.00	JL
1,2-Dibromoethane	< 0.32	2.00		µg/L	0.320	4/4/14 18:47	88915	1.00	JL
1,2-Dichloroethane	< 0.274	2.00		µg/L	0.274	4/4/14 18:47	88915	1.00	JL
1,2-Dichloropropane	< 1.11	4.00		µg/L	1.11	4/4/14 18:47	88915	1.00	JL
1-Butanol	< 6.69	90.0		µg/L	6.69	4/4/14 18:47	88915	1.00	JL
2-Butanone	< 1.38	8.00		µg/L	1.38	4/4/14 18:47	88915	1.00	JL
2-Hexanone	< 1.04	8.00		µg/L	1.04	4/4/14 18:47	88915	1.00	JL

Qualifiers:

B - Analyte detected in the associated Method Blank
E - Estimated
H - Holding Time Exceeded
S - Spike Recovery outside accepted recovery limits
R - RPD outside accepted recovery limits
J - Analyte detected below quantitation limits

ENVIRONMENTAL MONITORING AND TECHNOLOGIES, INC.

8100 North Austin • Morton Grove, IL 60053-3203
847.967.6666 • 800.246.0663 • fax: 847.967.6735 • www.emt.com

Report of Laboratory Analysis

CLIENT: EPS Environmental Services, Inc.
Lab Order: 14040141
Project: 3122 14th Ave., Kenosha, W
Lab ID: 14040141-16

Client Sample ID: GW - 3
Report Date: 4/9/2014
Collection Date: 4/1/2014 2:30:00 PM
Matrix: Groundwater

Analyses	Result	EMT Reporting Limit	Qual	Units	MDL	Date Analyzed	Batch	DF	Analyst
4-Methyl-2-pentanone	< 0.659	28.0		µg/L	0.659	4/4/14 18:47	88915	1.00	JL
Acetone	< 3.75	28.0		µg/L	3.75	4/4/14 18:47	88915	1.00	JL
Acrylonitrile	< 0.742	4.00		µg/L	0.742	4/4/14 18:47	88915	1.00	JL
Benzene	< 0.37	2.00		µg/L	0.370	4/4/14 18:47	88915	1.00	JL
Bromodichloromethane	< 0.31	2.00		µg/L	0.310	4/4/14 18:47	88915	1.00	JL
Bromoform	< 0.254	2.00		µg/L	0.254	4/4/14 18:47	88915	1.00	JL
Bromomethane	< 3.3	20.0		µg/L	3.30	4/4/14 18:47	88915	1.00	JL
Carbon disulfide	< 0.259	2.00		µg/L	0.259	4/4/14 18:47	88915	1.00	JL
Carbon tetrachloride	< 0.39	2.00		µg/L	0.390	4/4/14 18:47	88915	1.00	JL
Chlorobenzene	< 0.358	2.00		µg/L	0.358	4/4/14 18:47	88915	1.00	JL
Chloroethane	< 0.907	4.00		µg/L	0.907	4/4/14 18:47	88915	1.00	JL
Chloroform	< 0.397	2.00		µg/L	0.397	4/4/14 18:47	88915	1.00	JL
Chloromethane	< 2.23	8.00		µg/L	2.23	4/4/14 18:47	88915	1.00	JL
cis-1,2-Dichloroethene	< 0.421	2.00		µg/L	0.421	4/4/14 18:47	88915	1.00	JL
Dibromochloromethane	< 0.492	2.00		µg/L	0.492	4/4/14 18:47	88915	1.00	JL
Ethylbenzene	< 0.431	2.00		µg/L	0.431	4/4/14 18:47	88915	1.00	JL
m,p-Xylene	< 0.31	4.00		µg/L	0.310	4/4/14 18:47	88915	1.00	JL
Methyl tert-butyl ether	< 0.322	2.00		µg/L	0.322	4/4/14 18:47	88915	1.00	JL
Methylene chloride	0.53	2.00	J	µg/L	0.358	4/4/14 18:47	88915	1.00	JL
o-Xylene	< 0.349	2.00		µg/L	0.349	4/4/14 18:47	88915	1.00	JL
Styrene	< 0.534	4.00		µg/L	0.534	4/4/14 18:47	88915	1.00	JL
Tetrachloroethene	< 0.4	2.00		µg/L	0.400	4/4/14 18:47	88915	1.00	JL
Toluene	< 0.299	2.00		µg/L	0.299	4/4/14 18:47	88915	1.00	JL
trans-1,2-Dichloroethene	< 0.433	2.00		µg/L	0.433	4/4/14 18:47	88915	1.00	JL
Trichloroethene	< 0.439	2.00		µg/L	0.439	4/4/14 18:47	88915	1.00	JL
Vinyl acetate	< 1.01	8.00		µg/L	1.01	4/4/14 18:47	88915	1.00	JL
Vinyl chloride	< 0.316	2.00		µg/L	0.316	4/4/14 18:47	88915	1.00	JL
1,3-Dichloropropene, Total	< 0.592	4.00		µg/L	0.592	4/4/14 18:47	88915	1.00	JL
Xylenes, Total	< 0.66	6.00		µg/L	0.660	4/4/14 18:47	88915	1.00	JL
Surrogates:									
1,2-Dichloroethane-d4	99.3	81-118	J	%REC	1.51	4/4/14 18:47	88915	1.00	JL
4-Bromofluorobenzene	108	85-114		%REC	0.809	4/4/14 18:47	88915	1.00	JL
d4-1,2-Dichlorobenzene	114	80-120		%REC	1.18	4/4/14 18:47	88915	1.00	JL

Qualifiers:
B - Analyte detected in the associated Method Blank
E - Estimated
H - Holding Time Exceeded
S - Spike Recovery outside accepted recovery limits
R - RPD outside accepted recovery limits
J - Analyte detected below quantitation limits

ENVIRONMENTAL MONITORING AND TECHNOLOGIES, INC.

8100 North Austin • Morton Grove, IL 60053-3203
847.967.6666 • 800.246.0663 • fax: 847.967.6735 • www.emt.com

Report of Laboratory Analysis

CLIENT:	EPS Environmental Services, Inc.	**Client Sample ID:**	GW - 3
Lab Order:	14040141	**Report Date:**	4/9/2014
Project:	3122 14th Ave., Kenosha, W	**Collection Date:**	4/1/2014 2:30:00 PM
Lab ID:	14040141-16	**Matrix:**	Groundwater

Analyses	Result	EMT Reporting Limit	Qual	Units	MDL	Date Analyzed	Batch	DF	Analyst
Dibromofluoromethane	102	80-119		%REC	1.06	4/4/14 18:47	88915	1.00	JL
Fluorobenzene	98.6	80-116	J	%REC	0.680	4/4/14 18:47	88915	1.00	JL
Toluene-d8	101	89-112		%REC	1.10	4/4/14 18:47	88915	1.00	JL

Qualifiers:

B - Analyte detected in the associated Method Blank
E - Estimated
H - Holding Time Exceeded
S - Spike Recovery outside accepted recovery limits
R - RPD outside accepted recovery limits
J - Analyte detected below quantitation limits

ENVIRONMENTAL MONITORING AND TECHNOLOGIES, INC.

8100 North Austin • Morton Grove, IL 60053-3203
847.967.6666 • 800.246.0663 • fax: 847.967.6735 • www.emt.com

Report of Laboratory Analysis

CLIENT:	EPS Environmental Services, Inc.	**Client Sample ID:**	GW - 6
Lab Order:	14040141	**Report Date:**	4/9/2014
Project:	3122 14th Ave., Kenosha, W	**Collection Date:**	4/1/2014 2:50:00 PM
Lab ID:	14040141-17	**Matrix:**	Groundwater

Analyses	Result	EMT Reporting Limit	Qual	Units	MDL	Date Analyzed	Batch	DF	Analyst
Polynuclear Aromatic Hydrocarbons		**Method:**		**SW8310 / SW3510C**					
Acenaphthene	< 0.056	0.112		µg/L	0.0560	4/7/14	88873	1.00	RYL
Acenaphthylene	< 0.56	0.560		µg/L	0.560	4/7/14	88873	1.00	RYL
Anthracene	< 0.056	0.112		µg/L	0.0560	4/7/14	88873	1.00	RYL
Benz(a)anthracene	< 0.056	0.112		µg/L	0.0560	4/7/14	88873	1.00	RYL
Benzo(a)pyrene	0.086	0.112	J	µg/L	0.0560	4/7/14	88873	1.00	RYL
Benzo(b)fluoranthene	< 0.056	0.112		µg/L	0.0560	4/7/14	88873	1.00	RYL
Benzo(g,h,i)perylene	0.065	0.112	J	µg/L	0.0560	4/7/14	88873	1.00	RYL
Benzo(k)fluoranthene	< 0.056	0.112		µg/L	0.0560	4/7/14	88873	1.00	RYL
Chrysene	0.058	0.112	J	µg/L	0.0560	4/7/14	88873	1.00	RYL
Dibenz(a,h)anthracene	< 0.056	0.112		µg/L	0.0560	4/7/14	88873	1.00	RYL
Fluoranthene	0.121	0.112		µg/L	0.0560	4/7/14	88873	1.00	RYL
Fluorene	< 0.056	0.112		µg/L	0.0560	4/7/14	88873	1.00	RYL
Indeno(1,2,3-cd)pyrene	< 0.056	0.112		µg/L	0.0560	4/7/14	88873	1.00	RYL
Naphthalene	< 0.056	0.112		µg/L	0.0560	4/7/14	88873	1.00	RYL
Phenanthrene	0.10	0.112	J	µg/L	0.0560	4/7/14	88873	1.00	RYL
Pyrene	0.11	0.112	J	µg/L	0.0560	4/7/14	88873	1.00	RYL
Surrogates:									
4-Terphenyl-d14	87.2	60-115		%REC	0	4/7/14	88873	1.00	RYL
Volatile Organic Compounds by GC/MS		**Method:**		**SW8260B / SW5030A**					
1,1,1-Trichloroethane	< 0.349	2.00		µg/L	0.349	4/4/14 19:19	88915	1.00	JL
1,1,2,2-Tetrachloroethane	< 0.291	2.00		µg/L	0.291	4/4/14 19:19	88915	1.00	JL
1,1,2-Trichloroethane	< 0.264	2.00		µg/L	0.264	4/4/14 19:19	88915	1.00	JL
1,1-Dichloroethane	< 1.94	8.00		µg/L	1.94	4/4/14 19:19	88915	1.00	JL
1,1-Dichloroethene	< 1.02	4.00		µg/L	1.02	4/4/14 19:19	88915	1.00	JL
1,2-Dibromo-3-chloropropane	< 0.488	2.00		µg/L	0.488	4/4/14 19:19	88915	1.00	JL
1,2-Dibromoethane	< 0.32	2.00		µg/L	0.320	4/4/14 19:19	88915	1.00	JL
1,2-Dichloroethane	< 0.274	2.00		µg/L	0.274	4/4/14 19:19	88915	1.00	JL
1,2-Dichloropropane	< 1.11	4.00		µg/L	1.11	4/4/14 19:19	88915	1.00	JL
1-Butanol	< 6.69	90.0		µg/L	6.69	4/4/14 19:19	88915	1.00	JL
2-Butanone	< 1.38	8.00		µg/L	1.38	4/4/14 19:19	88915	1.00	JL
2-Hexanone	< 1.04	8.00		µg/L	1.04	4/4/14 19:19	88915	1.00	JL

Qualifiers:

B - Analyte detected in the associated Method Blank
E - Estimated
H - Holding Time Exceeded
S - Spike Recovery outside accepted recovery limits
R - RPD outside accepted recovery limits
J - Analyte detected below quantitation limits

ENVIRONMENTAL MONITORING AND TECHNOLOGIES, INC.

8100 North Austin • Morton Grove, IL 60053-3203
847.967.6666 • 800.246.0663 • fax: 847.967.6735 • www.emt.com

Report of Laboratory Analysis

CLIENT:	EPS Environmental Services, Inc.	**Client Sample ID:**	GW - 6
Lab Order:	14040141	**Report Date:**	4/9/2014
Project:	3122 14th Ave., Kenosha, W	**Collection Date:**	4/1/2014 2:50:00 PM
Lab ID:	14040141-17	**Matrix:**	Groundwater

Analyses	Result	EMT Reporting Limit	Qual	Units	MDL	Date Analyzed	Batch	DF	Analyst
4-Methyl-2-pentanone	< 0.659	28.0		µg/L	0.659	4/4/14 19:19	88915	1.00	JL
Acetone	11	28.0	J	µg/L	3.75	4/4/14 19:19	88915	1.00	JL
Acrylonitrile	< 0.742	4.00		µg/L	0.742	4/4/14 19:19	88915	1.00	JL
Benzene	< 0.37	2.00		µg/L	0.370	4/4/14 19:19	88915	1.00	JL
Bromodichloromethane	< 0.31	2.00		µg/L	0.310	4/4/14 19:19	88915	1.00	JL
Bromoform	< 0.254	2.00		µg/L	0.254	4/4/14 19:19	88915	1.00	JL
Bromomethane	< 3.3	20.0		µg/L	3.30	4/4/14 19:19	88915	1.00	JL
Carbon disulfide	< 0.259	2.00		µg/L	0.259	4/4/14 19:19	88915	1.00	JL
Carbon tetrachloride	< 0.39	2.00		µg/L	0.390	4/4/14 19:19	88915	1.00	JL
Chlorobenzene	< 0.358	2.00		µg/L	0.358	4/4/14 19:19	88915	1.00	JL
Chloroethane	< 0.907	4.00		µg/L	0.907	4/4/14 19:19	88915	1.00	JL
Chloroform	< 0.397	2.00		µg/L	0.397	4/4/14 19:19	88915	1.00	JL
Chloromethane	< 2.23	8.00		µg/L	2.23	4/4/14 19:19	88915	1.00	JL
cis-1,2-Dichloroethene	< 0.421	2.00		µg/L	0.421	4/4/14 19:19	88915	1.00	JL
Dibromochloromethane	< 0.492	2.00		µg/L	0.492	4/4/14 19:19	88915	1.00	JL
Ethylbenzene	< 0.431	2.00		µg/L	0.431	4/4/14 19:19	88915	1.00	JL
m,p-Xylene	< 0.31	4.00		µg/L	0.310	4/4/14 19:19	88915	1.00	JL
Methyl tert-butyl ether	< 0.322	2.00		µg/L	0.322	4/4/14 19:19	88915	1.00	JL
Methylene chloride	0.37	2.00	J	µg/L	0.358	4/4/14 19:19	88915	1.00	JL
o-Xylene	< 0.349	2.00		µg/L	0.349	4/4/14 19:19	88915	1.00	JL
Styrene	< 0.534	4.00		µg/L	0.534	4/4/14 19:19	88915	1.00	JL
Tetrachloroethene	< 0.4	2.00		µg/L	0.400	4/4/14 19:19	88915	1.00	JL
Toluene	< 0.299	2.00		µg/L	0.299	4/4/14 19:19	88915	1.00	JL
trans-1,2-Dichloroethene	< 0.433	2.00		µg/L	0.433	4/4/14 19:19	88915	1.00	JL
Trichloroethene	< 0.439	2.00		µg/L	0.439	4/4/14 19:19	88915	1.00	JL
Vinyl acetate	< 1.01	8.00		µg/L	1.01	4/4/14 19:19	88915	1.00	JL
Vinyl chloride	< 0.316	2.00		µg/L	0.316	4/4/14 19:19	88915	1.00	JL
1,3-Dichloropropene, Total	< 0.592	4.00		µg/L	0.592	4/4/14 19:19	88915	1.00	JL
Xylenes, Total	< 0.66	6.00		µg/L	0.660	4/4/14 19:19	88915	1.00	JL
Surrogates:									
1,2-Dichloroethane-d4	93.2	81-118	J	%REC	1.51	4/4/14 19:19	88915	1.00	JL
4-Bromofluorobenzene	110	85-114		%REC	0.809	4/4/14 19:19	88915	1.00	JL
d4-1,2-Dichlorobenzene	113	80-120		%REC	1.18	4/4/14 19:19	88915	1.00	JL

Qualifiers:

B - Analyte detected in the associated Method Blank
E - Estimated
H - Holding Time Exceeded
S - Spike Recovery outside accepted recovery limits
R - RPD outside accepted recovery limits
J - Analyte detected below quantitation limits

ENVIRONMENTAL MONITORING AND TECHNOLOGIES, INC.

8100 North Austin • Morton Grove, IL 60053-3203
847.967.6666 • 800.246.0663 • fax: 847.967.6735 • www.emt.com

Report of Laboratory Analysis

CLIENT:	EPS Environmental Services, Inc.	**Client Sample ID:**	GW - 6
Lab Order:	14040141	**Report Date:**	4/9/2014
Project:	3122 14th Ave., Kenosha, W	**Collection Date:**	4/1/2014 2:50:00 PM
Lab ID:	14040141-17	**Matrix:**	Groundwater

Analyses	Result	EMT Reporting Limit	Qual	Units	MDL	Date Analyzed	Batch	DF	Analyst
Dibromofluoromethane	101	80-119		%REC	1.06	4/4/14 19:19	88915	1.00	JL
Fluorobenzene	101	80-116		%REC	0.680	4/4/14 19:19	88915	1.00	JL
Toluene-d8	102	89-112		%REC	1.10	4/4/14 19:19	88915	1.00	JL

Qualifiers:

B - Analyte detected in the associated Method Blank
E - Estimated
H - Holding Time Exceeded
S - Spike Recovery outside accepted recovery limits
R - RPD outside accepted recovery limits
J - Analyte detected below quantitation limits

ENVIRONMENTAL MONITORING AND TECHNOLOGIES, INC.

8100 North Austin • Morton Grove, IL 60053-3203
847.967.6666 • 800.246.0663 • fax: 847.967.6735 • www.emt.com

Report of Laboratory Analysis

CLIENT:	EPS Environmental Services, Inc.	**Client Sample ID:**	GW - 7
Lab Order:	14040141	**Report Date:**	4/9/2014
Project:	3122 14th Ave., Kenosha, W	**Collection Date:**	4/1/2014 3:10:00 PM
Lab ID:	14040141-18	**Matrix:**	Groundwater

Analyses	Result	EMT Reporting Limit	Qual	Units	MDL	Date Analyzed	Batch	DF	Analyst
Polynuclear Aromatic Hydrocarbons		**Method:**		**SW8310 / SW3510C**					
Acenaphthene	< 0.0534	0.107		µg/L	0.0534	4/7/14	88873	1.00	RYL
Acenaphthylene	< 0.534	0.534		µg/L	0.534	4/7/14	88873	1.00	RYL
Anthracene	< 0.0534	0.107		µg/L	0.0534	4/7/14	88873	1.00	RYL
Benz(a)anthracene	< 0.0534	0.107		µg/L	0.0534	4/7/14	88873	1.00	RYL
Benzo(a)pyrene	< 0.0534	0.107		µg/L	0.0534	4/7/14	88873	1.00	RYL
Benzo(b)fluoranthene	< 0.0534	0.107		µg/L	0.0534	4/7/14	88873	1.00	RYL
Benzo(g,h,i)perylene	< 0.0534	0.107		µg/L	0.0534	4/7/14	88873	1.00	RYL
Benzo(k)fluoranthene	< 0.0534	0.107		µg/L	0.0534	4/7/14	88873	1.00	RYL
Chrysene	< 0.0534	0.107		µg/L	0.0534	4/7/14	88873	1.00	RYL
Dibenz(a,h)anthracene	< 0.0534	0.107		µg/L	0.0534	4/7/14	88873	1.00	RYL
Fluoranthene	< 0.0534	0.107		µg/L	0.0534	4/7/14	88873	1.00	RYL
Fluorene	< 0.0534	0.107		µg/L	0.0534	4/7/14	88873	1.00	RYL
Indeno(1,2,3-cd)pyrene	< 0.0534	0.107		µg/L	0.0534	4/7/14	88873	1.00	RYL
Naphthalene	< 0.0534	0.107		µg/L	0.0534	4/7/14	88873	1.00	RYL
Phenanthrene	0.110	0.107		µg/L	0.0534	4/7/14	88873	1.00	RYL
Pyrene	< 0.0534	0.107		µg/L	0.0534	4/7/14	88873	1.00	RYL
Surrogates:									
4-Terphenyl-d14	91.8	60-115		%REC	0	4/7/14	88873	1.00	RYL
Volatile Organic Compounds by GC/MS		**Method:**		**SW8260B / SW5030A**					
1,1,1-Trichloroethane	< 0.349	2.00		µg/L	0.349	4/4/14 19:51	88915	1.00	JL
1,1,2,2-Tetrachloroethane	< 0.291	2.00		µg/L	0.291	4/4/14 19:51	88915	1.00	JL
1,1,2-Trichloroethane	< 0.264	2.00		µg/L	0.264	4/4/14 19:51	88915	1.00	JL
1,1-Dichloroethane	< 1.94	8.00		µg/L	1.94	4/4/14 19:51	88915	1.00	JL
1,1-Dichloroethene	< 1.02	4.00		µg/L	1.02	4/4/14 19:51	88915	1.00	JL
1,2-Dibromo-3-chloropropane	< 0.488	2.00		µg/L	0.488	4/4/14 19:51	88915	1.00	JL
1,2-Dibromoethane	< 0.32	2.00		µg/L	0.320	4/4/14 19:51	88915	1.00	JL
1,2-Dichloroethane	< 0.274	2.00		µg/L	0.274	4/4/14 19:51	88915	1.00	JL
1,2-Dichloropropane	< 1.11	4.00		µg/L	1.11	4/4/14 19:51	88915	1.00	JL
1-Butanol	< 6.69	90.0		µg/L	6.69	4/4/14 19:51	88915	1.00	JL
2-Butanone	< 1.38	8.00		µg/L	1.38	4/4/14 19:51	88915	1.00	JL
2-Hexanone	< 1.04	8.00		µg/L	1.04	4/4/14 19:51	88915	1.00	JL

Qualifiers:

B - Analyte detected in the associated Method Blank
E - Estimated
H - Holding Time Exceeded
S - Spike Recovery outside accepted recovery limits
R - RPD outside accepted recovery limits
J - Analyte detected below quantitation limits

ENVIRONMENTAL MONITORING AND TECHNOLOGIES, INC.

8100 North Austin • Morton Grove, IL 60053-3203
847.967.6666 • 800.246.0663 • fax: 847.967.6735 • www.emt.com

Report of Laboratory Analysis

CLIENT:	EPS Environmental Services, Inc.	**Client Sample ID:**	GW - 7
Lab Order:	14040141	**Report Date:**	4/9/2014
Project:	3122 14th Ave., Kenosha, W	**Collection Date:**	4/1/2014 3:10:00 PM
Lab ID:	14040141-18	**Matrix:**	Groundwater

Analyses	Result	EMT Reporting Limit	Qual	Units	MDL	Date Analyzed	Batch	DF	Analyst
4-Methyl-2-pentanone	< 0.659	28.0		µg/L	0.659	4/4/14 19:51	88915	1.00	JL
Acetone	< 3.75	28.0		µg/L	3.75	4/4/14 19:51	88915	1.00	JL
Acrylonitrile	< 0.742	4.00		µg/L	0.742	4/4/14 19:51	88915	1.00	JL
Benzene	< 0.37	2.00		µg/L	0.370	4/4/14 19:51	88915	1.00	JL
Bromodichloromethane	< 0.31	2.00		µg/L	0.310	4/4/14 19:51	88915	1.00	JL
Bromoform	< 0.254	2.00		µg/L	0.254	4/4/14 19:51	88915	1.00	JL
Bromomethane	< 3.3	20.0		µg/L	3.30	4/4/14 19:51	88915	1.00	JL
Carbon disulfide	< 0.259	2.00		µg/L	0.259	4/4/14 19:51	88915	1.00	JL
Carbon tetrachloride	< 0.39	2.00		µg/L	0.390	4/4/14 19:51	88915	1.00	JL
Chlorobenzene	< 0.358	2.00		µg/L	0.358	4/4/14 19:51	88915	1.00	JL
Chloroethane	< 0.907	4.00		µg/L	0.907	4/4/14 19:51	88915	1.00	JL
Chloroform	< 0.397	2.00		µg/L	0.397	4/4/14 19:51	88915	1.00	JL
Chloromethane	< 2.23	8.00		µg/L	2.23	4/4/14 19:51	88915	1.00	JL
cis-1,2-Dichloroethene	< 0.421	2.00		µg/L	0.421	4/4/14 19:51	88915	1.00	JL
Dibromochloromethane	< 0.492	2.00		µg/L	0.492	4/4/14 19:51	88915	1.00	JL
Ethylbenzene	< 0.431	2.00		µg/L	0.431	4/4/14 19:51	88915	1.00	JL
m,p-Xylene	< 0.31	4.00		µg/L	0.310	4/4/14 19:51	88915	1.00	JL
Methyl tert-butyl ether	< 0.322	2.00		µg/L	0.322	4/4/14 19:51	88915	1.00	JL
Methylene chloride	< 0.358	2.00		µg/L	0.358	4/4/14 19:51	88915	1.00	JL
o-Xylene	< 0.349	2.00		µg/L	0.349	4/4/14 19:51	88915	1.00	JL
Styrene	< 0.534	4.00		µg/L	0.534	4/4/14 19:51	88915	1.00	JL
Tetrachloroethene	< 0.4	2.00		µg/L	0.400	4/4/14 19:51	88915	1.00	JL
Toluene	< 0.299	2.00		µg/L	0.299	4/4/14 19:51	88915	1.00	JL
trans-1,2-Dichloroethene	< 0.433	2.00		µg/L	0.433	4/4/14 19:51	88915	1.00	JL
Trichloroethene	< 0.439	2.00		µg/L	0.439	4/4/14 19:51	88915	1.00	JL
Vinyl acetate	< 1.01	8.00		µg/L	1.01	4/4/14 19:51	88915	1.00	JL
Vinyl chloride	< 0.316	2.00		µg/L	0.316	4/4/14 19:51	88915	1.00	JL
1,3-Dichloropropene, Total	< 0.592	4.00		µg/L	0.592	4/4/14 19:51	88915	1.00	JL
Xylenes, Total	< 0.66	6.00		µg/L	0.660	4/4/14 19:51	88915	1.00	JL
Surrogates:									
1,2-Dichloroethane-d4	98.3	81-118	J	%REC	1.51	4/4/14 19:51	88915	1.00	JL
4-Bromofluorobenzene	97.6	85-114	J	%REC	0.809	4/4/14 19:51	88915	1.00	JL
d4-1,2-Dichlorobenzene	110	80-120		%REC	1.18	4/4/14 19:51	88915	1.00	JL

Qualifiers:

B - Analyte detected in the associated Method Blank
E - Estimated
H - Holding Time Exceeded
S - Spike Recovery outside accepted recovery limits
R - RPD outside accepted recovery limits
J - Analyte detected below quantitation limits

ENVIRONMENTAL MONITORING AND TECHNOLOGIES, INC.

8100 North Austin • Morton Grove, IL 60053-3203
847.967.6666 • 800.246.0663 • fax: 847.967.6735 • www.emt.com

Report of Laboratory Analysis

CLIENT:	EPS Environmental Services, Inc.	**Client Sample ID:**	GW - 7
Lab Order:	14040141	**Report Date:**	4/9/2014
Project:	3122 14th Ave., Kenosha, W	**Collection Date:**	4/1/2014 3:10:00 PM
Lab ID:	14040141-18	**Matrix:**	Groundwater

Analyses	Result	EMT Reporting Limit	Qual	Units	MDL	Date Analyzed	Batch	DF	Analyst
Dibromofluoromethane	99.7	80-119	J	%REC	1.06	4/4/14 19:51	88915	1.00	JL
Fluorobenzene	98.4	80-116	J	%REC	0.680	4/4/14 19:51	88915	1.00	JL
Toluene-d8	98.8	89-112	J	%REC	1.10	4/4/14 19:51	88915	1.00	JL

Qualifiers:

B - Analyte detected in the associated Method Blank
E - Estimated
H - Holding Time Exceeded
S - Spike Recovery outside accepted recovery limits
R - RPD outside accepted recovery limits
J - Analyte detected below quantitation limits

ENVIRONMENTAL MONITORING AND TECHNOLOGIES, INC.

8100 North Austin • Morton Grove, IL 60053-3203
847.967.6666 • 800.246.0663 • fax: 847.967.6735 • www.emt.com

Report of Laboratory Analysis

CLIENT:	EPS Environmental Services, Inc.	**Client Sample ID:**	GW - 8
Lab Order:	14040141	**Report Date:**	4/9/2014
Project:	3122 14th Ave., Kenosha, W	**Collection Date:**	4/1/2014 3:20:00 PM
Lab ID:	14040141-19	**Matrix:**	Groundwater

Analyses	Result	EMT Reporting Limit	Qual	Units	MDL	Date Analyzed	Batch	DF	Analyst
Polynuclear Aromatic Hydrocarbons		**Method:**		**SW8310 / SW3510C**					
Acenaphthene	< 0.0515	0.103		µg/L	0.0515	4/7/14	88873	1.00	RYL
Acenaphthylene	< 0.515	0.515		µg/L	0.515	4/7/14	88873	1.00	RYL
Anthracene	< 0.0515	0.103		µg/L	0.0515	4/7/14	88873	1.00	RYL
Benz(a)anthracene	< 0.0515	0.103		µg/L	0.0515	4/7/14	88873	1.00	RYL
Benzo(a)pyrene	< 0.0515	0.103		µg/L	0.0515	4/7/14	88873	1.00	RYL
Benzo(b)fluoranthene	< 0.0515	0.103		µg/L	0.0515	4/7/14	88873	1.00	RYL
Benzo(g,h,i)perylene	< 0.0515	0.103		µg/L	0.0515	4/7/14	88873	1.00	RYL
Benzo(k)fluoranthene	< 0.0515	0.103		µg/L	0.0515	4/7/14	88873	1.00	RYL
Chrysene	< 0.0515	0.103		µg/L	0.0515	4/7/14	88873	1.00	RYL
Dibenz(a,h)anthracene	< 0.0515	0.103		µg/L	0.0515	4/7/14	88873	1.00	RYL
Fluoranthene	< 0.0515	0.103		µg/L	0.0515	4/7/14	88873	1.00	RYL
Fluorene	< 0.0515	0.103		µg/L	0.0515	4/7/14	88873	1.00	RYL
Indeno(1,2,3-cd)pyrene	< 0.0515	0.103		µg/L	0.0515	4/7/14	88873	1.00	RYL
Naphthalene	< 0.0515	0.103		µg/L	0.0515	4/7/14	88873	1.00	RYL
Phenanthrene	< 0.0515	0.103		µg/L	0.0515	4/7/14	88873	1.00	RYL
Pyrene	< 0.0515	0.103		µg/L	0.0515	4/7/14	88873	1.00	RYL
Surrogates:									
4-Terphenyl-d14	85.3	60-115		%REC	0	4/7/14	88873	1.00	RYL
Volatile Organic Compounds by GC/MS		**Method:**		**SW8260B / SW5030A**					
1,1,1-Trichloroethane	< 0.349	2.00		µg/L	0.349	4/4/14 20:23	88915	1.00	JL
1,1,2,2-Tetrachloroethane	< 0.291	2.00		µg/L	0.291	4/4/14 20:23	88915	1.00	JL
1,1,2-Trichloroethane	< 0.264	2.00		µg/L	0.264	4/4/14 20:23	88915	1.00	JL
1,1-Dichloroethane	< 1.94	8.00		µg/L	1.94	4/4/14 20:23	88915	1.00	JL
1,1-Dichloroethene	< 1.02	4.00		µg/L	1.02	4/4/14 20:23	88915	1.00	JL
1,2-Dibromo-3-chloropropane	< 0.488	2.00		µg/L	0.488	4/4/14 20:23	88915	1.00	JL
1,2-Dibromoethane	< 0.32	2.00		µg/L	0.320	4/4/14 20:23	88915	1.00	JL
1,2-Dichloroethane	< 0.274	2.00		µg/L	0.274	4/4/14 20:23	88915	1.00	JL
1,2-Dichloropropane	< 1.11	4.00		µg/L	1.11	4/4/14 20:23	88915	1.00	JL
1-Butanol	< 6.69	90.0		µg/L	6.69	4/4/14 20:23	88915	1.00	JL
2-Butanone	< 1.38	8.00		µg/L	1.38	4/4/14 20:23	88915	1.00	JL
2-Hexanone	< 1.04	8.00		µg/L	1.04	4/4/14 20:23	88915	1.00	JL

Qualifiers:

B - Analyte detected in the associated Method Blank
E - Estimated
H - Holding Time Exceeded
S - Spike Recovery outside accepted recovery limits
R - RPD outside accepted recovery limits
J - Analyte detected below quantitation limits

ENVIRONMENTAL MONITORING AND TECHNOLOGIES, INC.

8100 North Austin • Morton Grove, IL 60053-3203
847.967.6666 • 800.246.0663 • fax: 847.967.6735 • www.emt.com

Report of Laboratory Analysis

CLIENT:	EPS Environmental Services, Inc.	**Client Sample ID:**	GW - 8
Lab Order:	14040141	**Report Date:**	4/9/2014
Project:	3122 14th Ave., Kenosha, W	**Collection Date:**	4/1/2014 3:20:00 PM
Lab ID:	14040141-19	**Matrix:**	Groundwater

Analyses	Result	EMT Reporting Limit	Qual	Units	MDL	Date Analyzed	Batch	DF	Analyst
4-Methyl-2-pentanone	< 0.659	28.0		µg/L	0.659	4/4/14 20:23	88915	1.00	JL
Acetone	19	28.0	J	µg/L	3.75	4/4/14 20:23	88915	1.00	JL
Acrylonitrile	< 0.742	4.00		µg/L	0.742	4/4/14 20:23	88915	1.00	JL
Benzene	< 0.37	2.00		µg/L	0.370	4/4/14 20:23	88915	1.00	JL
Bromodichloromethane	< 0.31	2.00		µg/L	0.310	4/4/14 20:23	88915	1.00	JL
Bromoform	< 0.254	2.00		µg/L	0.254	4/4/14 20:23	88915	1.00	JL
Bromomethane	< 3.3	20.0		µg/L	3.30	4/4/14 20:23	88915	1.00	JL
Carbon disulfide	< 0.259	2.00		µg/L	0.259	4/4/14 20:23	88915	1.00	JL
Carbon tetrachloride	< 0.39	2.00		µg/L	0.390	4/4/14 20:23	88915	1.00	JL
Chlorobenzene	< 0.358	2.00		µg/L	0.358	4/4/14 20:23	88915	1.00	JL
Chloroethane	< 0.907	4.00		µg/L	0.907	4/4/14 20:23	88915	1.00	JL
Chloroform	< 0.397	2.00		µg/L	0.397	4/4/14 20:23	88915	1.00	JL
Chloromethane	< 2.23	8.00		µg/L	2.23	4/4/14 20:23	88915	1.00	JL
cis-1,2-Dichloroethene	< 0.421	2.00		µg/L	0.421	4/4/14 20:23	88915	1.00	JL
Dibromochloromethane	< 0.492	2.00		µg/L	0.492	4/4/14 20:23	88915	1.00	JL
Ethylbenzene	< 0.431	2.00		µg/L	0.431	4/4/14 20:23	88915	1.00	JL
m,p-Xylene	< 0.31	4.00		µg/L	0.310	4/4/14 20:23	88915	1.00	JL
Methyl tert-butyl ether	< 0.322	2.00		µg/L	0.322	4/4/14 20:23	88915	1.00	JL
Methylene chloride	0.45	2.00	J	µg/L	0.358	4/4/14 20:23	88915	1.00	JL
o-Xylene	< 0.349	2.00		µg/L	0.349	4/4/14 20:23	88915	1.00	JL
Styrene	< 0.534	4.00		µg/L	0.534	4/4/14 20:23	88915	1.00	JL
Tetrachloroethene	< 0.4	2.00		µg/L	0.400	4/4/14 20:23	88915	1.00	JL
Toluene	< 0.299	2.00		µg/L	0.299	4/4/14 20:23	88915	1.00	JL
trans-1,2-Dichloroethene	< 0.433	2.00		µg/L	0.433	4/4/14 20:23	88915	1.00	JL
Trichloroethene	< 0.439	2.00		µg/L	0.439	4/4/14 20:23	88915	1.00	JL
Vinyl acetate	< 1.01	8.00		µg/L	1.01	4/4/14 20:23	88915	1.00	JL
Vinyl chloride	< 0.316	2.00		µg/L	0.316	4/4/14 20:23	88915	1.00	JL
1,3-Dichloropropene, Total	< 0.592	4.00		µg/L	0.592	4/4/14 20:23	88915	1.00	JL
Xylenes, Total	< 0.66	6.00		µg/L	0.660	4/4/14 20:23	88915	1.00	JL
Surrogates:									
1,2-Dichloroethane-d4	83.5	81-118	J	%REC	1.51	4/4/14 20:23	88915	1.00	JL
4-Bromofluorobenzene	108	85-114		%REC	0.809	4/4/14 20:23	88915	1.00	JL
d4-1,2-Dichlorobenzene	106	80-120		%REC	1.18	4/4/14 20:23	88915	1.00	JL

Qualifiers:

B - Analyte detected in the associated Method Blank
E - Estimated
H - Holding Time Exceeded
S - Spike Recovery outside accepted recovery limits
R - RPD outside accepted recovery limits
J - Analyte detected below quantitation limits

ENVIRONMENTAL MONITORING AND TECHNOLOGIES, INC.

8100 North Austin • Morton Grove, IL 60053-3203
847.967.6666 • 800.246.0663 • fax: 847.967.6735 • www.emt.com

Report of Laboratory Analysis

CLIENT:	EPS Environmental Services, Inc.	**Client Sample ID:**	GW - 8
Lab Order:	14040141	**Report Date:**	4/9/2014
Project:	3122 14th Ave., Kenosha, W	**Collection Date:**	4/1/2014 3:20:00 PM
Lab ID:	14040141-19	**Matrix:**	Groundwater

Analyses	Result	EMT Reporting Limit	Qual	Units	MDL	Date Analyzed	Batch	DF	Analyst
Dibromofluoromethane	94.4	80-119	J	%REC	1.06	4/4/14 20:23	88915	1.00	JL
Fluorobenzene	97.2	80-116	J	%REC	0.680	4/4/14 20:23	88915	1.00	JL
Toluene-d8	103	89-112		%REC	1.10	4/4/14 20:23	88915	1.00	JL

Qualifiers:

B - Analyte detected in the associated Method Blank
E - Estimated
H - Holding Time Exceeded
S - Spike Recovery outside accepted recovery limits
R - RPD outside accepted recovery limits
J - Analyte detected below quantitation limits

ENVIRONMENTAL MONITORING AND TECHNOLOGIES, INC.

8100 North Austin • Morton Grove, IL 60053-3203
847.967.6666 • 800.246.0663 • fax: 847.967.6735 • www.emt.com

Report of Laboratory Analysis

CLIENT:	EPS Environmental Services, Inc.	**Client Sample ID:**	GW - 10
Lab Order:	14040141	**Report Date:**	4/9/2014
Project:	3122 14th Ave., Kenosha, W	**Collection Date:**	4/1/2014 3:45:00 PM
Lab ID:	14040141-20	**Matrix:**	Groundwater

Analyses	Result	EMT Reporting Limit	Qual	Units	MDL	Date Analyzed	Batch	DF	Analyst
Polynuclear Aromatic Hydrocarbons		**Method:**		**SW8310 / SW3510C**					
Acenaphthene	< 0.0565	0.113		µg/L	0.0565	4/7/14	88873	1.00	RYL
Acenaphthylene	< 0.565	0.565		µg/L	0.565	4/7/14	88873	1.00	RYL
Anthracene	< 0.0565	0.113		µg/L	0.0565	4/7/14	88873	1.00	RYL
Benz(a)anthracene	< 0.0565	0.113		µg/L	0.0565	4/7/14	88873	1.00	RYL
Benzo(a)pyrene	< 0.0565	0.113		µg/L	0.0565	4/7/14	88873	1.00	RYL
Benzo(b)fluoranthene	< 0.0565	0.113		µg/L	0.0565	4/7/14	88873	1.00	RYL
Benzo(g,h,i)perylene	< 0.0565	0.113		µg/L	0.0565	4/7/14	88873	1.00	RYL
Benzo(k)fluoranthene	< 0.0565	0.113		µg/L	0.0565	4/7/14	88873	1.00	RYL
Chrysene	< 0.0565	0.113		µg/L	0.0565	4/7/14	88873	1.00	RYL
Dibenz(a,h)anthracene	< 0.0565	0.113		µg/L	0.0565	4/7/14	88873	1.00	RYL
Fluoranthene	< 0.0565	0.113		µg/L	0.0565	4/7/14	88873	1.00	RYL
Fluorene	< 0.0565	0.113		µg/L	0.0565	4/7/14	88873	1.00	RYL
Indeno(1,2,3-cd)pyrene	< 0.0565	0.113		µg/L	0.0565	4/7/14	88873	1.00	RYL
Naphthalene	< 0.0565	0.113		µg/L	0.0565	4/7/14	88873	1.00	RYL
Phenanthrene	< 0.0565	0.113		µg/L	0.0565	4/7/14	88873	1.00	RYL
Pyrene	< 0.0565	0.113		µg/L	0.0565	4/7/14	88873	1.00	RYL
Surrogates:									
4-Terphenyl-d14	95.4	60-115		%REC	0	4/7/14	88873	1.00	RYL
Volatile Organic Compounds by GC/MS		**Method:**		**SW8260B / SW5030A**					
1,1,1-Trichloroethane	< 0.349	2.00		µg/L	0.349	4/4/14 20:55	88915	1.00	JL
1,1,2,2-Tetrachloroethane	< 0.291	2.00		µg/L	0.291	4/4/14 20:55	88915	1.00	JL
1,1,2-Trichloroethane	< 0.264	2.00		µg/L	0.264	4/4/14 20:55	88915	1.00	JL
1,1-Dichloroethane	< 1.94	8.00		µg/L	1.94	4/4/14 20:55	88915	1.00	JL
1,1-Dichloroethene	< 1.02	4.00		µg/L	1.02	4/4/14 20:55	88915	1.00	JL
1,2-Dibromo-3-chloropropane	< 0.488	2.00		µg/L	0.488	4/4/14 20:55	88915	1.00	JL
1,2-Dibromoethane	< 0.32	2.00		µg/L	0.320	4/4/14 20:55	88915	1.00	JL
1,2-Dichloroethane	< 0.274	2.00		µg/L	0.274	4/4/14 20:55	88915	1.00	JL
1,2-Dichloropropane	< 1.11	4.00		µg/L	1.11	4/4/14 20:55	88915	1.00	JL
1-Butanol	< 6.69	90.0		µg/L	6.69	4/4/14 20:55	88915	1.00	JL
2-Butanone	< 1.38	8.00		µg/L	1.38	4/4/14 20:55	88915	1.00	JL
2-Hexanone	< 1.04	8.00		µg/L	1.04	4/4/14 20:55	88915	1.00	JL

Qualifiers:

B - Analyte detected in the associated Method Blank
E - Estimated
H - Holding Time Exceeded
S - Spike Recovery outside accepted recovery limits
R - RPD outside accepted recovery limits
J - Analyte detected below quantitation limits

ENVIRONMENTAL MONITORING AND TECHNOLOGIES, INC.

8100 North Austin • Morton Grove, IL 60053-3203
847.967.6666 • 800.246.0663 • fax: 847.967.6735 • www.emt.com

Report of Laboratory Analysis

CLIENT:	EPS Environmental Services, Inc.	**Client Sample ID:**	GW - 10
Lab Order:	14040141	**Report Date:**	4/9/2014
Project:	3122 14th Ave., Kenosha, W	**Collection Date:**	4/1/2014 3:45:00 PM
Lab ID:	14040141-20	**Matrix:**	Groundwater

Analyses	Result	EMT Reporting Limit	Qual	Units	MDL	Date Analyzed	Batch	DF	Analyst
4-Methyl-2-pentanone	< 0.659	28.0		µg/L	0.659	4/4/14 20:55	88915	1.00	JL
Acetone	6.4	28.0	J	µg/L	3.75	4/4/14 20:55	88915	1.00	JL
Acrylonitrile	< 0.742	4.00		µg/L	0.742	4/4/14 20:55	88915	1.00	JL
Benzene	< 0.37	2.00		µg/L	0.370	4/4/14 20:55	88915	1.00	JL
Bromodichloromethane	< 0.31	2.00		µg/L	0.310	4/4/14 20:55	88915	1.00	JL
Bromoform	< 0.254	2.00		µg/L	0.254	4/4/14 20:55	88915	1.00	JL
Bromomethane	< 3.3	20.0		µg/L	3.30	4/4/14 20:55	88915	1.00	JL
Carbon disulfide	< 0.259	2.00		µg/L	0.259	4/4/14 20:55	88915	1.00	JL
Carbon tetrachloride	< 0.39	2.00		µg/L	0.390	4/4/14 20:55	88915	1.00	JL
Chlorobenzene	< 0.358	2.00		µg/L	0.358	4/4/14 20:55	88915	1.00	JL
Chloroethane	< 0.907	4.00		µg/L	0.907	4/4/14 20:55	88915	1.00	JL
Chloroform	< 0.397	2.00		µg/L	0.397	4/4/14 20:55	88915	1.00	JL
Chloromethane	< 2.23	8.00		µg/L	2.23	4/4/14 20:55	88915	1.00	JL
cis-1,2-Dichloroethene	< 0.421	2.00		µg/L	0.421	4/4/14 20:55	88915	1.00	JL
Dibromochloromethane	< 0.492	2.00		µg/L	0.492	4/4/14 20:55	88915	1.00	JL
Ethylbenzene	< 0.431	2.00		µg/L	0.431	4/4/14 20:55	88915	1.00	JL
m,p-Xylene	< 0.31	4.00		µg/L	0.310	4/4/14 20:55	88915	1.00	JL
Methyl tert-butyl ether	< 0.322	2.00		µg/L	0.322	4/4/14 20:55	88915	1.00	JL
Methylene chloride	< 0.358	2.00		µg/L	0.358	4/4/14 20:55	88915	1.00	JL
o-Xylene	< 0.349	2.00		µg/L	0.349	4/4/14 20:55	88915	1.00	JL
Styrene	< 0.534	4.00		µg/L	0.534	4/4/14 20:55	88915	1.00	JL
Tetrachloroethene	< 0.4	2.00		µg/L	0.400	4/4/14 20:55	88915	1.00	JL
Toluene	< 0.299	2.00		µg/L	0.299	4/4/14 20:55	88915	1.00	JL
trans-1,2-Dichloroethene	< 0.433	2.00		µg/L	0.433	4/4/14 20:55	88915	1.00	JL
Trichloroethene	< 0.439	2.00		µg/L	0.439	4/4/14 20:55	88915	1.00	JL
Vinyl acetate	< 1.01	8.00		µg/L	1.01	4/4/14 20:55	88915	1.00	JL
Vinyl chloride	< 0.316	2.00		µg/L	0.316	4/4/14 20:55	88915	1.00	JL
1,3-Dichloropropene, Total	< 0.592	4.00		µg/L	0.592	4/4/14 20:55	88915	1.00	JL
Xylenes, Total	< 0.66	6.00		µg/L	0.660	4/4/14 20:55	88915	1.00	JL
Surrogates:									
1,2-Dichloroethane-d4	88.2	81-118	J	%REC	1.51	4/4/14 20:55	88915	1.00	JL
4-Bromofluorobenzene	112	85-114		%REC	0.809	4/4/14 20:55	88915	1.00	JL
d4-1,2-Dichlorobenzene	119	80-120		%REC	1.18	4/4/14 20:55	88915	1.00	JL

Qualifiers:

B - Analyte detected in the associated Method Blank
E - Estimated
H - Holding Time Exceeded
S - Spike Recovery outside accepted recovery limits
R - RPD outside accepted recovery limits
J - Analyte detected below quantitation limits

ENVIRONMENTAL MONITORING AND TECHNOLOGIES, INC.

8100 North Austin • Morton Grove, IL 60053-3203
847.967.6666 • 800.246.0663 • fax: 847.967.6735 • www.emt.com

Report of Laboratory Analysis

CLIENT:	EPS Environmental Services, Inc.	**Client Sample ID:**	GW - 10
Lab Order:	14040141	**Report Date:**	4/9/2014
Project:	3122 14th Ave., Kenosha, W	**Collection Date:**	4/1/2014 3:45:00 PM
Lab ID:	14040141-20	**Matrix:**	Groundwater

Analyses	Result	EMT Reporting Limit	Qual	Units	MDL	Date Analyzed	Batch	DF	Analyst
Dibromofluoromethane	94.2	80-119	J	%REC	1.06	4/4/14 20:55	88915	1.00	JL
Fluorobenzene	98.7	80-116	J	%REC	0.680	4/4/14 20:55	88915	1.00	JL
Toluene-d8	100	89-112		%REC	1.10	4/4/14 20:55	88915	1.00	JL

Qualifiers:

B - Analyte detected in the associated Method Blank
E - Estimated
H - Holding Time Exceeded
S - Spike Recovery outside accepted recovery limits
R - RPD outside accepted recovery limits
J - Analyte detected below quantitation limits

ENVIRONMENTAL MONITORING AND TECHNOLOGIES, INC.

8100 North Austin • Morton Grove, IL 60053-3203
847.967.6666 • 800.246.0663 • fax: 847.967.6735 • www.emt.com

DATES REPORT

4/9/2014

Client: EPS Environmental Services, Inc.
Project: EPS WDNR
Lab Order: 14040141

Sample ID	Client Sample ID	Collection Date	Matrix	Test Name	TCLP Date	Prep Date	Analysis Date	Batch ID
14040141-01A	SB - 1/12'	3/31/14 13:15	Soil	Volatiles in Methanol by GC/MS		4/4/14 10:55	4/5/14 02:47	88919
14040141-01B				Percent Moisture			4/4/14 16:15	R200091
				Polynuclear Aromatic Hydrocarbons		4/3/14 16:30	4/7/14	88852
14040141-02A	SB - 2/12'	3/31/14 13:57		Volatiles in Methanol by GC/MS		4/4/14 10:55	4/5/14 03:19	88919
14040141-02B				Percent Moisture			4/4/14 16:15	R200091
				Polynuclear Aromatic Hydrocarbons		4/3/14 16:30	4/7/14	88852
14040141-03A	SB - 2/16'	3/31/14 14:05		Volatiles in Methanol by GC/MS		4/4/14 10:55	4/5/14 03:51	88919
14040141-03B				Percent Moisture			4/4/14 16:15	R200091
				Polynuclear Aromatic Hydrocarbons		4/3/14 16:30	4/7/14	88852
14040141-04A	SB - 3/6'	3/31/14 14:48		Volatiles in Methanol by GC/MS		4/4/14 10:55	4/5/14 04:23	88919
14040141-04B				Percent Moisture			4/4/14 16:15	R200091
				Polynuclear Aromatic Hydrocarbons		4/3/14 16:30	4/7/14	88852
14040141-05A	SB - 4/6'	4/1/14 08:30		Volatiles in Methanol by GC/MS		4/4/14 10:55	4/5/14 04:55	88919
14040141-05B				Percent Moisture			4/4/14 16:15	R200091
				Polynuclear Aromatic Hydrocarbons		4/3/14 16:30	4/7/14	88852
14040141-06A	SB - 4/15'	4/1/14 09:00		Volatiles in Methanol by GC/MS		4/4/14 10:55	4/5/14 05:27	88919
14040141-06B				Percent Moisture			4/7/14 10:00	R200150
				Polynuclear Aromatic Hydrocarbons		4/3/14 16:30	4/8/14	88852
14040141-07A	SB - 5/4'	4/1/14 09:49		Volatiles in Methanol by GC/MS		4/4/14 10:55	4/5/14 05:59	88919

ENVIRONMENTAL MONITORING AND TECHNOLOGIES, INC.

8100 North Austin • Morton Grove, IL 60053-3203
847.967.6666 • 800.246.0663 • fax: 847.967.6735 • www.emt.com

DATES REPORT

4/9/2014

Client: EPS Environmental Services, Inc.
Project: EPS WDNR
Lab Order: 14040141

Sample ID	Client Sample ID	Collection Date	Matrix	Test Name	TCLP Date	Prep Date	Analysis Date	Batch ID
14040141-07B	SB - 5/4'	4/1/14 09:49	Soil	Percent Moisture			4/7/14 10:00	R200150
				Polynuclear Aromatic Hydrocarbons		4/3/14 16:30	4/8/14	88852
14040141-08A	SB - 5/16'	4/1/14 10:05		Volatiles in Methanol by GC/MS		4/4/14 10:55	4/5/14 06:31	88919
14040141-08B				Percent Moisture			4/7/14 10:00	R200150
				Polynuclear Aromatic Hydrocarbons		4/3/14 16:30	4/8/14	88852
14040141-09A	SB - 6/8'	4/1/14 11:15		Volatiles in Methanol by GC/MS		4/4/14 10:55	4/5/14 07:03	88919
14040141-09B				Percent Moisture			4/7/14 10:00	R200150
				Polynuclear Aromatic Hydrocarbons		4/3/14 16:30	4/8/14	88852
14040141-10A	SB - 7/4'	4/1/14 11:45		Volatiles in Methanol by GC/MS		4/4/14 10:55	4/5/14 07:35	88919
14040141-10B				Percent Moisture			4/7/14 10:00	R200150
				Polynuclear Aromatic Hydrocarbons		4/3/14 16:30	4/8/14	88852
14040141-11A	SB - 8/6'	4/1/14 12:35		Volatiles in Methanol by GC/MS		4/4/14 10:55	4/5/14 08:07	88919
14040141-11B				Percent Moisture			4/7/14 10:00	R200150
				Polynuclear Aromatic Hydrocarbons		4/3/14 16:30	4/8/14	88852
14040141-12A	SB - 9/10'	4/1/14 13:04		Volatiles in Methanol by GC/MS		4/4/14 10:55	4/5/14 08:39	88919
14040141-12B				Percent Moisture			4/7/14 10:00	R200150
				Polynuclear Aromatic Hydrocarbons		4/3/14 16:30	4/8/14	88852
14040141-13A	SB - 9/16'	4/1/14 13:30		Volatiles in Methanol by GC/MS		4/4/14 10:55	4/5/14 09:11	88919
14040141-13B				Percent Moisture			4/7/14 10:00	R200150

ENVIRONMENTAL MONITORING AND TECHNOLOGIES, INC.

8100 North Austin • Morton Grove, IL 60053-3203
847.967.6666 • 800.246.0663 • fax: 847.967.6735 • www.emt.com

DATES REPORT

4/9/2014

Client: EPS Environmental Services, Inc.
Project: EPS WDNR
Lab Order: 14040141

Sample ID	Client Sample ID	Collection Date	Matrix	Test Name	TCLP Date	Prep Date	Analysis Date	Batch ID
14040141-13B	SB - 9/16'	4/1/14 13:30	Soil	Polynuclear Aromatic Hydrocarbons		4/3/14 16:30	4/8/14	88852
14040141-14A	SB - 10/6'	4/1/14 13:52		Volatiles in Methanol by GC/MS		4/4/14 10:15	4/5/14 12:54	88920
14040141-14B				Percent Moisture			4/7/14 10:00	R200150
				Polynuclear Aromatic Hydrocarbons		4/3/14 16:30	4/8/14	88852
14040141-15A	GW-1	4/1/14 14:09	Groundwater	Volatiles by GC/MS		4/4/14 10:26	4/4/14 18:15	88915
14040141-15B				Polynuclear Aromatic Hydrocarbons		4/4/14 10:04	4/4/14	88873
14040141-16A	GW - 3	4/1/14 14:30		Volatiles by GC/MS		4/4/14 10:26	4/4/14 18:47	88915
14040141-16B				Polynuclear Aromatic Hydrocarbons		4/4/14 10:04	4/4/14	88873
14040141-17A	GW - 6	4/1/14 14:50		Volatiles by GC/MS		4/4/14 10:26	4/4/14 19:19	88915
14040141-17B				Polynuclear Aromatic Hydrocarbons		4/4/14 10:04	4/7/14	88873
14040141-18A	GW - 7	4/1/14 15:10		Volatiles by GC/MS		4/4/14 10:26	4/4/14 19:51	88915
14040141-18B				Polynuclear Aromatic Hydrocarbons		4/4/14 10:04	4/7/14	88873
14040141-19A	GW - 8	4/1/14 15:20		Volatiles by GC/MS		4/4/14 10:26	4/4/14 20:23	88915
14040141-19B				Polynuclear Aromatic Hydrocarbons		4/4/14 10:04	4/7/14	88873
14040141-20A	GW - 10	4/1/14 15:45		Volatiles by GC/MS		4/4/14 10:26	4/4/14 20:55	88915
14040141-20B				Polynuclear Aromatic Hydrocarbons		4/4/14 10:04	4/7/14	88873

1 of 2

AP

ENVIRONMENTAL MONITORING AND TECHNOLOGIES, INC.

8100 North Austin Avenue
Morton Grove, Illinois 60053-3203

847-967-6666
FAX: 847-967-6735
www.emt.com

Chain of Custody Record

TURNARAOUND TIME:
☐ RUSH ___ day turnaround
☒ ROUTINE

Due Date: ___-___-___ COC #: 131407

Company: EPS Environmental Services, Inc.
Address: 7237 W. Devon Ave.
Chicago, IL 60631

Phone #: (773) 792-3090 Fax #: (773) 792-3091
P.O. #: Proj. #: 14022-0214C0#1
Client Contact: Nick Cuzzone
Project ID / Location: 3122 14th Ave., Kenosha, WI

Sample Type:
1. Waste Water 4. Sludge 7. Groundwater (filtered)
2. Drinking Water 5. Oil 8. Other
3. Soil 6. Groundwater

Container Type:
P - Plastic V - VOC Vial O - Other
G - Glass B - Tedlar Bag

Preservative:
1. None 4. NaOH 7. Zn Ace
2. H_2SO_4 5. HCl 8. Other
3. HNO_3 6. MeOH

Analyses

EMT USE ONLY 140024
EMT WORKORDER #14040141

Sample I.D.	Sample Type	Container Size	Container Type	Container No.	Sampling By	Sampling Date	Sampling Time	pH	Temp.	Preservation Field	Preservation Lab	VOC	PNA										
SB-1/12'	S	2oz/4oz	G	1/1	Kim	3/31/14	1315			1/6		X	X										01 A, B
SB-2/12'	↓	↓	↓	↓	↓	↓	1357			↓		X	X										02 A, B
SB-2/16'	↓	↓	↓	↓	↓	↓	1405			↓		X	X										03 A, B
SB-3/6'	↓	↓	↓	↓	↓	↓	1448			↓		X	X										04 A, B
SB-4/6'	↓	↓	↓	↓	↓	4/1/14	830			↓		X	X										05 A, B
SB-4/15'	↓	↓	↓	↓	↓	↓	900			↓		X	X										06 A, B
SB-5/4'	↓	↓	↓	↓	↓	↓	949			↓		X	X										07 A, B
SB-5/16	↓	↓	↓	↓	↓	↓	1005			↓		X	X										08 A, B
SB-6/8'	↓	↓	↓	↓	↓	↓	1115			↓		X	X										09 A, B
SB-7/4'	↓	↓	↓	↓	↓	↓	1145			↓		X	X										10 A, B

Relinquished By:	Date: 4-3-14 Time: 10:09	Received By: Armenta P. Perry	Date: 4-3-14 Time: 10:07	EMT USE ONLY Client Code: EPS	☑ SAMPLE RECEIVED ON ICE
Relinquished By: Armenta P. Perry	Date: 4-3-14 Time: 10:33	Received By:	Date: - - Time: :	EMT Project I.D. WDNR	☑ TEMPERATURE (Must be recorded if sampling was greater than 6 hrs. prior to sample receipt) 3
Relinquished By:	Date: - - Time: :	Received For Lab By:	Date: 4-3-14 Time: 10:33	Jar Lot No.	EMT SAMPLE RETURN POLICY ON BACK

SPECIAL INSTRUCTIONS:

AP

ENVIRONMENTAL MONITORING AND TECHNOLOGIES, INC.

8100 North Austin Avenue
Morton Grove, Illinois 60053-3203

847-967-6666
FAX: 847-967-6735
www.emt.com

Chain of Custody Record

TURNARAOUND TIME:
☐ RUSH
____ day turnaround
☒ ROUTINE

Due Date: ____-____-____ COC #: 131408

Company: EPS Environmental Services, Inc.
Address: 7237 W. Devon Ave.
Chicago, IL 60631

Phone #: (773) 792-3090 Fax #: (773) 792-3091
P.O. #: Proj.#: 14022-0214CO#1
Client Contact: Nick Cuzzone
Project ID / Location: 3122 14th Ave., Kenosha, WI

Sample Type:
1. Waste Water 4. Sludge 7. Groundwater (filtered)
2. Drinking Water 5. Oil 8. Other
3. Soil 6. Groundwater

Container Type:
P - Plastic V - VOC Vial O - Other
G - Glass B - Tedlar Bag

Preservative:
1. None 4. NaOH 7. Zn Ace
2. H_2SO_4 5. HCl 8. Other
3. HNO_3 6. MeOH

Analyses

EMT USE ONLY 140241
EMT WORKORDER # 1404041

Sample I.D.	Sample Type	Container Size	Container Type	Container No.	Sampling By	Sampling Date	Sampling Time	pH	Temp.	Preservation Field	Preservation Lab	VOC	PNA										EMT WORKORDER #
SB-8/6'	S	202/402	G	1/1	Kim	4/1/14	1235			1/6		X	X										11 A, B
SB-9/10'	↓	↓	↓	↓	↓	4/1/14	1304			↓		X	X										12 A, B
SB-9/16'	↓	↓	↓	↓	↓	↓	1330			↓		X	X										13 A, B
SB-10/6'	↓	↓	↓	↓	↓	↓	1352			↓		X	X										14 A, B
GW-1	GW	40mL/1L	↓	3/2	↓	↓	1409			1/5		X	X										15 A, B
GW-3	↓	↓	↓	↓	↓	↓	1430			↓		X	X										16 A, B
GW-6	↓	↓	↓	↓	↓	↓	1450			↓		X	X										17 A, B
GW-7	↓	↓	↓	↓	↓	↓	1510			↓		X	X										18 A, B
GW-8	↓	↓	↓	↓	↓	↓	1520			↓		X	X										19 A, B
GW-10	↓	↓	↓	↓	↓	↓	1545			↓		X	X										20 A, B

Relinquished By: [signature]	Date: 4-3-14 Time: 10:09	Received By: Armenta P. Price	Date: 4-3-14 Time: 10:09	EMT USE ONLY
Relinquished By: Armenta P. Price	Date: 4-3-14 Time: 10:33	Received By:	Date: - - Time: :	Client Code:
Relinquished By:	Date: - - Time: :	Received For Lab By: [signature]	Date: 4-3-14 Time: 10:33	EMT Project I.D.
				Jar Lot No.

☑ SAMPLE RECEIVED ON ICE
☐ TEMPERATURE (Must be recorded if sampling was greater than 6 hrs. prior to sample receipt)
3

EMT SAMPLE RETURN POLICY ON BACK

SPECIAL INSTRUCTIONS:

Environmental Monitoring & Technologies, Inc.

Sample Receipt Checklist

Client Name **EPS** Date Received: 10:33 **4/3/2014**

Work Order Numbe **14040141** Received by BW1

Checklist completed by Bruce Welch 4-3-14 (Signature / Date) Reviewed by _____ (Initials / Date)

Matrix: Carrier name AP

Shipping container/cooler in good condition?	Yes ☑	No ☐	Not Presen ☐
Custody seals intact on shippping container/cooler?	Yes ☐	No ☐	Not Presen ☑
Custody seals intact on sample bottles?	Yes ☐	No ☐	Not Presen ☑
Chain of custody present and complete?	Yes ☑	No ☐	
Chain of custody signed when relinquished and received?	Yes ☑	No ☐	
Chain of custody agrees with sample labels?	Yes ☑	No ☐	
Samples in proper container/bottle?	Yes ☑	No ☐	
Sample containers intact?	Yes ☐	No ☑	
Sufficient sample volume for indicated test?	Yes ☑	No ☐	
All samples received within holding time?	Yes ☑	No ☐	
Container/Temp Blank temperature in compliance?	Yes ☑	No ☐	
Water - VOA vials have zero headspace?	No VOA vials submitted ☐	Yes ☑	No ☐
Water - pH acceptable upon receipt?	Yes ☑	No ☐	

Adjusted? _____ Checked by _____

Any No and/or NA (not applicable) response must be detailed in the comments section below.

One 15A, two 16A, and 2 17A voa vials were broken when recieved.

Client contacted _____ Date contacted: _____ Person contacted _____

Contacted by: _____ Regarding _____

Comments: _____

Corrective Action _____

APPENDIX C

Comparison Tables

Project: 3122 14th Ave., Kenosha, WI.
Project #: 14022-0214CO#1
Sampled: 3/31/2014 and 4/1/2014
Laboratory: EMT - Morton Grove, IL

Table 1. Soil VOC Analytical Results

Chemical Name	Regional Screening Level*	SB-1/12'	SB-2/12'	SB-2/16'	SB-3/6'	SB-4/6'	SB-4/15'	SB-5/4'
VOCs								
1,1,1-Trichloroethane	38,000	< 0.025	< 0.025	< 0.025	< 0.025	< 0.025	< 0.025	< 0.025
1,1,2,2-Tetrachloroethane	NRO	< 0.025	< 0.025	< 0.025	< 0.025	< 0.025	< 0.025	< 0.025
1,1,2-Trichloroethane	50	< 0.0274	< 0.0262	< 0.0252	< 0.0252	< 0.0252	< 0.0262	< 0.0286
1,1-Dichloroethane	17	< 0.025	< 0.025	< 0.025	< 0.025	< 0.025	< 0.025	< 0.025
1,1-Dichloroethene	1100	< 0.025	< 0.025	< 0.025	< 0.025	< 0.025	< 0.025	< 0.025
1,2-Dibromo-3-chloropropane	1,100	< 0.12	< 0.115	< 0.11	< 0.11	< 0.11	< 0.115	< 0.125
1,2-Dibromoethane	0.17	< 0.025	< 0.025	< 0.025	< 0.025	< 0.025	< 0.025	< 0.025
1,2-Dichloroethane	2.3	< 0.025	< 0.025	< 0.025	< 0.025	< 0.025	< 0.025	< 0.025
1,2-Dichloropropane	4.7	< 0.0324	< 0.031	< 0.0298	< 0.0298	< 0.0298	< 0.031	< 0.0339
1,3-Dichloropropene, Total	8.3	< 0.0329	< 0.0316	< 0.0303	< 0.0303	< 0.0303	< 0.0316	< 0.0344
1-Butanol	62,000	< 1.63	< 1.56	< 1.5	< 1.5	< 1.5	< 1.56	< 1.7
2-Butanone (MEK)	200,000	< 0.333	< 0.319	< 0.306	< 0.306	< 0.306	< 0.319	< 0.348
2-Hexanone	14,000	< 0.0409	< 0.0392	< 0.0376	< 0.0376	< 0.0376	< 0.0392	< 0.0427
4-Methyl-2-Pentanone (MIBK)	53,000	< 0.148	< 0.142	< 0.136	< 0.136	< 0.136	< 0.142	< 0.155
Acetone	630,000	< 0.391	< 0.375	< 0.36	< 0.36	< 0.36	< 0.375	< 0.409
Acryonitrile	1.2	< 0.126	< 0.121	< 0.116	< 0.116	< 0.116	< 0.121	< 0.132
Benzene	5.4	< 0.025	< 0.025	< 0.025	< 0.025	< 0.025	< 0.025	< 0.025
Bromodichloromethane	1.4	< 0.025	< 0.025	< 0.025	< 0.025	< 0.025	< 0.025	< 0.025
Bromoform	220	< 0.0254	< 0.025	< 0.025	< 0.025	< 0.025	< 0.025	< 0.0266
Bromomethane	32	< 0.0391	< 0.0375	< 0.036	< 0.036	< 0.036	< 0.0375	< 0.0409
Carbon disulfide	3,700	< 0.025	< 0.025	< 0.025	< 0.025	< 0.025	< 0.025	< 0.025
Carbon tetrachloride	3.0	< 0.025	< 0.025	< 0.025	< 0.025	< 0.025	< 0.025	< 0.025
Chlorobenzene	1,400	< 0.025	< 0.025	< 0.025	< 0.025	< 0.025	< 0.025	< 0.025
Chloroethane	NRO	< 0.0328	< 0.0315	< 0.0302	< 0.0302	< 0.0302	< 0.0315	< 0.0343

*USEPA RSL (Industrial Soil Table), November 2013

All results in parts per million (**mg/Kg**) unless noted otherwise

NRO = No Remediation Objective

Project: 3122 14th Ave., Kenosha, WI.
Project #: 14022-0214CO#1
Sampled: 3/31/2014 and 4/1/2014
Laboratory: EMT - Morton Grove, IL

Table 1. Soil VOC Analytical Results (cont'd)

Chemical Name	Regional Screening Level*	SB-1/12'	SB-2/12'	SB-2/16'	SB-3/6'	SB-4/6'	SB-4/15'	SB-5/4'
VOCs								
Chloroform	1.5	< 0.025	< 0.025	< 0.025	< 0.025	< 0.025	< 0.025	< 0.025
Chloromethane	500	< 0.0453	< 0.0434	< 0.0417	< 0.0417	< 0.0417	< 0.0434	< 0.0474
cis-1,2-Dichloroethene	2,000	< 0.025	< 0.025	< 0.025	< 0.025	< 0.025	< 0.025	< 0.025
Dibromochloromethane	3.3	< 0.025	< 0.025	< 0.025	< 0.025	< 0.025	< 0.025	< 0.025
Ethylbenzene	27	< 0.0254	< 0.025	< 0.025	< 0.025	< 0.025	< 0.025	< 0.0266
Methyl tert-butyl ether	220	< 0.025	< 0.025	< 0.025	< 0.025	< 0.025	< 0.025	< 0.025
Methylene chloride	960	< 0.0351	< 0.0336	< 0.0323	< 0.0323	< 0.0323	< 0.0336	< 0.0367
Styrene	36,000	< 0.025	< 0.025	< 0.025	< 0.025	< 0.025	< 0.025	< 0.025
Tetrachloroethene	110	< 0.025	< 0.025	< 0.025	< 0.025	< 0.025	< 0.025	< 0.025
Toluene	45,000	< 0.0309	< 0.0296	< 0.0284	< 0.0284	< 0.0284	< 0.0296	< 0.0323
trans-1,2-Dichloroethene	690	< 0.025	< 0.025	< 0.025	< 0.025	< 0.025	< 0.025	< 0.0253
Trichloroethene	6.4	< 0.025	< 0.025	< 0.025	< 0.025	< 0.025	< 0.025	< 0.025
Vinyl acetate	4,100	< 0.025	< 0.025	< 0.025	< 0.025	< 0.025	< 0.025	< 0.025
Vinyl chloride	1.7	< 0.025	< 0.025	< 0.025	< 0.025	< 0.025	< 0.025	< 0.025
Xylenes, Total	2,700	< 0.0921	< 0.0882	< 0.0847	< 0.0847	< 0.0847	< 0.0882	< 0.0962

*USEPA RSL (Industrial Soil Table), November 2013

All results in parts per million (**mg/Kg**) unless noted otherwise

NRO = No Remediation Objective

Project: 3122 14th Ave., Kenosha, WI.
Project #: 14022-0214CO#1
Sampled: 3/31/2014 and 4/1/2014
Laboratory: EMT - Morton Grove, IL

Table 1. Soil VOC Analytical Results

Chemical Name	Regional Screening Level*	SB-5/16'	SB-6/8'	SB-7/4'	SB-8/6'	SB-9/10'	SB-9/16'	SB-10/6'
VOCs								
1,1,1-Trichloroethane	38,000	< 0.025	< 0.025	< 0.025	< 0.025	< 0.025	< 0.025	< 0.025
1,1,2,2-Tetrachloroethane	NRO	< 0.025	< 0.025	< 0.025	< 0.025	< 0.025	< 0.025	< 0.025
1,1,2-Trichloroethane	50	< 0.0262	< 0.0332	< 0.0262	< 0.0262	< 0.0262	< 0.0252	< 0.0262
1,1-Dichloroethane	17	< 0.025	< 0.0271	< 0.025	< 0.025	< 0.025	< 0.025	< 0.025
1,1-Dichloroethene	1100	< 0.025	< 0.0267	< 0.025	< 0.025	< 0.025	< 0.025	< 0.025
1,2-Dibromo-3-chloropropane	1,100	< 0.115	< 0.145	< 0.115	< 0.115	< 0.115	< 0.11	< 0.115
1,2-Dibromoethane	0.17	< 0.025	< 0.025	< 0.025	< 0.025	< 0.025	< 0.025	< 0.025
1,2-Dichloroethane	2.3	< 0.025	< 0.025	< 0.025	< 0.025	< 0.025	< 0.025	< 0.025
1,2-Dichloropropane	4.7	< 0.031	< 0.0392	< 0.031	< 0.031	< 0.031	< 0.0298	< 0.031
1,3-Dichloropropene, Total	8.3	< 0.0316	< 0.0399	< 0.0316	< 0.0316	< 0.0316	< 0.0303	< 0.0316
1-Butanol	62,000	< 1.56	< 1.97	< 1.56	< 1.56	< 1.56	< 1.5	< 1.56
2-Butanone (MEK)	200,000	< 0.319	< 0.403	< 0.319	< 0.319	< 0.319	< 0.306	< 0.319
2-Hexanone	14,000	< 0.0392	< 0.0495	< 0.0392	< 0.0392	< 0.0392	< 0.0376	< 0.0392
4-Methyl-2-Pentanone (MIBK)	53,000	< 0.142	< 0.179	< 0.142	< 0.142	< 0.142	< 0.136	< 0.142
Acetone	630,000	< 0.375	< 0.474	< 0.375	< 0.375	< 0.375	< 0.36	< 0.375
Acryonitrile	1.2	< 0.121	< 0.153	< 0.121	< 0.121	< 0.121	< 0.116	< 0.121
Benzene	5.4	< 0.025	< 0.025	< 0.025	< 0.025	< 0.025	< 0.025	< 0.025
Bromodichloromethane	1.4	< 0.025	< 0.025	< 0.025	< 0.025	< 0.025	< 0.025	< 0.025
Bromoform	220	< 0.025	< 0.0308	< 0.025	< 0.025	< 0.025	< 0.025	< 0.025
Bromomethane	32	< 0.0375	< 0.0474	< 0.0375	< 0.0375	< 0.0375	< 0.036	< 0.0375
Carbon disulfide	3,700	< 0.025	< 0.025	< 0.025	< 0.025	< 0.025	< 0.025	< 0.025
Carbon tetrachloride	3.0	< 0.025	< 0.0251	< 0.025	< 0.025	< 0.025	< 0.025	< 0.025
Chlorobenzene	1,400	< 0.025	< 0.025	< 0.025	< 0.025	< 0.025	< 0.025	< 0.025
Chloroethane	NRO	< 0.0315	< 0.0397	< 0.0315	< 0.0315	< 0.0315	< 0.0302	< 0.0315

*USEPA RSL (Industrial Soil Table), November 2013

All results in parts per million (**mg/Kg**) unless noted otherwise

NRO = No Remediation Objective

Project: 3122 14th Ave., Kenosha, WI.
Project #: 14022-0214CO#1
Sampled: 3/31/2014 and 4/1/2014
Laboratory: EMT - Morton Grove, IL

Table 1. Soil VOC Analytical Results (cont'd)

Chemical Name	Regional Screening Level*	SB-5/16'	SB-6/8'	SB-7/4'	SB-8/6'	SB-9/10'	SB-9/16'	SB-10/6'
VOCs								
Chloroform	1.5	< 0.025	< 0.025	< 0.025	< 0.025	< 0.025	< 0.025	< 0.025
Chloromethane	500	< 0.0434	< 0.0549	< 0.0434	< 0.0434	< 0.0434	< 0.0417	< 0.0434
cis-1,2-Dichloroethene	2,000	< 0.025	< 0.025	< 0.025	< 0.025	< 0.025	< 0.025	< 0.025
Dibromochloromethane	3.3	< 0.025	< 0.025	< 0.025	< 0.025	< 0.025	< 0.025	< 0.025
Ethylbenzene	27	< 0.025	< 0.0308	< 0.025	< 0.025	< 0.025	< 0.025	< 0.025
Methyl tert-butyl ether	220	< 0.025	< 0.0254	< 0.025	< 0.025	< 0.025	< 0.025	< 0.025
Methylene chloride	960	< 0.0336	0.086J	< 0.0336	< 0.0336	< 0.0336	< 0.0323	< 0.0336
Styrene	36,000	< 0.025	< 0.025	< 0.025	< 0.025	< 0.025	< 0.025	< 0.025
Tetrachloroethene	110	< 0.025	< 0.0284	< 0.025	< 0.025	< 0.025	< 0.025	< 0.025
Toluene	45,000	< 0.0296	< 0.0374	< 0.0296	< 0.0296	< 0.0296	< 0.0284	< 0.0296
trans-1,2-Dichloroethene	690	< 0.025	< 0.0293	< 0.025	< 0.025	< 0.025	< 0.025	< 0.025
Trichloroethene	6.4	< 0.025	< 0.025	< 0.025	< 0.025	< 0.025	< 0.025	< 0.025
Vinyl acetate	4,100	< 0.025	< 0.025	< 0.025	< 0.025	< 0.025	< 0.025	< 0.025
Vinyl chloride	1.7	< 0.025	< 0.025	< 0.025	< 0.025	< 0.025	< 0.025	< 0.025
Xylenes, Total	2,700	< 0.0882	< 0.111	< 0.0882	< 0.0882	< 0.0882	< 0.0847	< 0.0882

*USEPA RSL (Industrial Soil Table), November 2013

All results in parts per million (**mg/Kg**) unless noted otherwise

NRO = No Remediation Objective

Project: 3122 14th Avenue, Kenosha, Wisconsin
Project #: 14022-0214CO#1
Sampled: 3/31/2014 & 4/1/2014
Laboratory: EMT - Morton Grove, Illinois

Table 2. Soil PNA Analytical Results

Chemical Name	Regional Screening Level*	SB-1/12'	SB-2/12'	SB-2/16'	SB-3/6'	SB-4/6'	SB-4/15'	SB-5/4'	SB-5/16'	SB-6/8'	SB-7/4'	SB-8/6'	SB-9/10'	SB-9/16'	SB-10/6'
PNAs															
Acenaphthene	33,000	< 0.00496	< 0.00497	< 0.005	< 0.00504	< 0.00537	< 0.00494	< 0.0048	< 0.00502	< 0.00508	< 0.00493	< 0.00486	< 0.00501	< 0.00498	< 0.00491
Acenaphthylene	NRO	< 0.00342	< 0.00343	< 0.00345	< 0.00348	< 0.00371	< 0.00341	< 0.00331	< 0.00347	< 0.00351	< 0.0034	< 0.00335	< 0.00346	< 0.00344	< 0.00339
Anthracene	170,000	< 0.00345	< 0.00345	< 0.00347	< 0.00351	< 0.00374	< 0.00343	< 0.00333	< 0.00349	< 0.00353	< 0.00343	< 0.00338	< 0.00348	< 0.00346	< 0.00341
Benzo(a)anthracene	2.1	< 0.0034	< 0.00341	< 0.00343	< 0.00346	< 0.00369	< 0.00339	< 0.00329	< 0.00344	< 0.00349	< 0.00338	< 0.00333	< 0.00343	< 0.00342	< 0.00337
Benzo(a)pyrene	0.21	< 0.00295	< 0.00296	< 0.00298	< 0.00301	< 0.0032	< 0.00294	< 0.00286	< 0.00299	< 0.00303	< 0.00294	< 0.00289	< 0.00298	< 0.00297	< 0.00292
Benzo(b)fluoranthene	2.1	< 0.00316	< 0.00317	< 0.00319	< 0.00322	< 0.00343	< 0.00315	< 0.00306	< 0.0032	< 0.00324	< 0.00314	< 0.00309	< 0.00319	< 0.00317	< 0.00313
Benzo(g,h,i)perylene	NRO	< 0.00359	< 0.0036	< 0.00362	< 0.00366	< 0.0039	< 0.00358	< 0.00348	< 0.00364	< 0.00369	< 0.00358	< 0.00352	< 0.00363	< 0.00361	< 0.00356
Benzo(k)fluoranthene	21	< 0.0027	< 0.00271	< 0.00272	< 0.00275	< 0.00293	< 0.00269	< 0.00261	< 0.00274	< 0.00277	< 0.00269	< 0.00265	< 0.00273	< 0.00271	< 0.00267
Chrysene	210	< 0.00284	< 0.00285	< 0.00286	< 0.00289	< 0.00308	< 0.00283	< 0.00275	< 0.00287	< 0.00291	< 0.00282	< 0.00278	< 0.00287	< 0.00285	< 0.00281
Dibenzo(a,h)anthracene	0.21	< 0.00423	< 0.00425	< 0.00427	< 0.00431	< 0.00459	< 0.00422	< 0.0041	< 0.00429	< 0.00434	< 0.00421	< 0.00415	< 0.00428	< 0.00426	< 0.00419
Fluoranthene	22,000	< 0.00263	< 0.00264	< 0.00265	< 0.00268	< 0.00285	< 0.00262	< 0.00255	< 0.00267	< 0.0027	< 0.00262	< 0.00258	< 0.00266	< 0.00265	< 0.00261
Fluorene	22,000	< 0.00815	< 0.00817	< 0.00822	< 0.00829	< 0.00884	< 0.00812	< 0.00789	< 0.00825	< 0.00836	< 0.00811	< 0.00798	< 0.00823	< 0.00819	< 0.00807
Indeno(1,2,3-cd)pyrene	2.1	< 0.00458	< 0.00459	< 0.00462	< 0.00466	< 0.00496	< 0.00456	< 0.00443	< 0.00464	< 0.0047	< 0.00455	< 0.00449	< 0.00462	< 0.0046	< 0.00453
Naphthalene	18	< 0.00403	< 0.00404	< 0.00406	< 0.0041	< 0.00437	< 0.00401	< 0.0039	< 0.00408	< 0.00413	< 0.00401	< 0.00395	< 0.00407	< 0.00405	< 0.00399
Phenanthrene	NRO	0.015J	0.035	0.025J	< 0.00606	< 0.00645	< 0.00593	< 0.00576	< 0.00603	< 0.00611	< 0.00592	0.011J	0.0387	< 0.00598	0.018J
Pyrene	17,000	< 0.00438	< 0.0044	< 0.00442	< 0.00446	< 0.00475	< 0.00437	< 0.00424	< 0.00444	< 0.0045	< 0.00436	< 0.00429	< 0.00443	< 0.00441	< 0.00434

*USEPA RSL (Industrial Soil Table), November 2013

All results in parts per million (**mg/Kg**) unless noted otherwise

NRO = No Remediation Objective

Project: 3122 14th Avenue, Kenosha, Wisconsin
Project #: 14022-0214CO#1
Sampled: 4/1/2014
Laboratory: EMT - Morton Grove, Illinois

Table 3. Water VOC Analytical Results

Chemical Name	Preventive Action Limit (mg/L)*	GW-1	GW-3	GW-6	GW-7	GW-8	GW-10
VOCs							
1,1,1-Trichloroethane	0.040	< 0.000349	< 0.000349	< 0.000349	< 0.000349	< 0.000349	< 0.000349
1,1,2,2-Tetrachloroethane	0.007	< 0.000291	< 0.000291	< 0.000291	< 0.000291	< 0.000291	< 0.000291
1,1,2-Trichloroethane	0.0005	< 0.000264	< 0.000264	< 0.000264	< 0.000264	< 0.000264	< 0.000264
1,1-Dichloroethane	0.085	< 0.00194	< 0.00194	< 0.00194	< 0.00194	< 0.00194	< 0.00194
1,1-Dichloroethene	0.0007	< 0.00102	< 0.00102	< 0.00102	< 0.00102	< 0.00102	< 0.00102
1,2-Dibromo-3-chloropropane	0.00002	< 0.000488	< 0.000488	< 0.000488	< 0.000488	< 0.000488	< 0.000488
1,2-Dibromoethane	0.000005	< 0.00032	< 0.00032	< 0.00032	< 0.00032	< 0.00032	< 0.00032
1,2-Dichloroethane	0.0005	< 0.000274	< 0.000274	< 0.000274	< 0.000274	< 0.000274	< 0.000274
1,2-Dichloropropane	0.0005	< 0.00111	< 0.00111	< 0.00111	< 0.00111	< 0.00111	< 0.00111
1,3-Dichloropropene (cis & trans)	0.00004	< 0.000592	< 0.000592	< 0.000592	< 0.000592	< 0.000592	< 0.000592
1-Butanol	NRO	< 0.00669	< 0.00669	< 0.00669	< 0.00669	< 0.00669	< 0.00669
2-Butanone (MEK)	0.8	< 0.00138	< 0.00138	< 0.00138	< 0.00138	< 0.00138	< 0.00138
2-Hexanone	NRO	< 0.00104	< 0.00104	< 0.00104	< 0.00104	< 0.00104	< 0.00104
4-Methyl-2-Pentanone (MIBK)	0.050	< 0.000659	< 0.000659	< 0.000659	< 0.000659	< 0.000659	< 0.000659
Acetone	1.8	< 0.00375	< 0.00375	0.011J	< 0.00375	0.019J	0.0064J
Acrylonitrile	NRO	< 0.000742	< 0.000742	< 0.000742	< 0.000742	< 0.000742	< 0.000742
Benzene	0.0005	< 0.00037	< 0.00037	< 0.00037	< 0.00037	< 0.00037	< 0.00037
Bromodichloromethane	0.00006	< 0.00031	< 0.00031	< 0.00031	< 0.00031	< 0.00031	< 0.00031
Bromoform	0.00044	< 0.000254	< 0.000254	< 0.000254	< 0.000254	< 0.000254	< 0.000254
Bromomethane	0.001	< 0.0033	< 0.0033	< 0.0033	< 0.0033	< 0.0033	< 0.0033
Carbon disulfide	0.2	< 0.000259	< 0.000259	< 0.000259	< 0.000259	< 0.000259	< 0.000259
Carbon tetrachloride	0.0005	< 0.00039	< 0.00039	< 0.00039	< 0.00039	< 0.00039	< 0.00039
Chlorobenzene	NRO	< 0.000358	< 0.000358	< 0.000358	< 0.000358	< 0.000358	< 0.000358

*Wisconsin Administrative Code N.R.140

All results in parts per million (**mg/L**) unless noted otherwise.

NRO = No Remediation Objective

Project: 3122 14th Avenue, Kenosha, Wisconsin
Project #: 14022-0214CO#1
Sampled: 4/1/2014
Laboratory: EMT - Morton Grove, Illinois

Table 3. Water VOC Analytical Results (continued)

Chemical Name	Preventive Action Limit (mg/L)*	GW-1	GW-3	GW-6	GW-7	GW-8	GW-10
VOCs							
Chloroethane	0.080	< 0.000907	< 0.000907	< 0.000907	< 0.000907	< 0.000907	< 0.000907
Chloroform	0.0006	< 0.000397	< 0.000397	< 0.000397	< 0.000397	< 0.000397	< 0.000397
Chloromethane	0.003	< 0.00223	< 0.00223	< 0.00223	< 0.00223	< 0.00223	< 0.00223
cis-1,2-Dichloroethene	0.007	< 0.000421	< 0.000421	< 0.000421	< 0.000421	< 0.000421	< 0.000421
Dibromochloromethane	0.006	< 0.000492	< 0.000492	< 0.000492	< 0.000492	< 0.000492	< 0.000492
Ethylbenzene	0.140	< 0.000431	< 0.000431	< 0.000431	< 0.000431	< 0.000431	< 0.000431
Methyl tert-butyl ether	0.012	< 0.000322	< 0.000322	< 0.000322	< 0.000322	< 0.000322	< 0.000322
Methylene chloride	0.0005	0.00061J	0.00053J	0.00037J	< 0.000358	0.00045J	< 0.000358
Styrene	0.010	< 0.000534	< 0.000534	< 0.000534	< 0.000534	< 0.000534	< 0.000534
Tetrachloroethene	0.0005	< 0.0004	< 0.0004	< 0.0004	< 0.0004	< 0.0004	< 0.0004
Toluene	0.160	< 0.000299	< 0.000299	< 0.000299	< 0.000299	< 0.000299	< 0.000299
trans-1,2-Dichloroethene	0.020	< 0.000433	< 0.000433	< 0.000433	< 0.000433	< 0.000433	< 0.000433
Trichloroethene	0.0005	< 0.000439	< 0.000439	< 0.000439	< 0.000439	< 0.000439	< 0.000439
Vinyl Acetate	NRO	< 0.00101	< 0.00101	< 0.00101	< 0.00101	< 0.00101	< 0.00101
Vinyl chloride	0.00002	< 0.000316	< 0.000316	< 0.000316	< 0.000316	< 0.000316	< 0.000316
Xylenes (total)	0.0004	< 0.00066	< 0.00066	< 0.00066	< 0.00066	< 0.00066	< 0.00066

*Wisconsin Administrative Code N.R.140

All results in parts per million (**mg/L**) unless noted otherwise.

NRO = No Remediation Objective

Project: 3122 14th Avenue, Kenosha, Wisconsin
Project #: 14022-0214CO#1
Sampled: 4/1/2014
Laboratory: EMT - Morton Grove, Illinois

Table 4. Water PNA Analytical Results

Chemical Name	Preventive Action Limit (mg/L)*	GW-1	GW-3	GW-6	GW-7	GW-8	GW-10
PNAs							
Acenaphthene	NRO	< 0.000051	< 0.0000528	< 0.000056	< 0.0000534	< 0.0000515	< 0.0000565
Acenaphthylene^	NRO	< 0.00051	< 0.000528	< 0.00056	< 0.000534	< 0.000515	< 0.000565
Anthracene	0.600	< 0.000051	< 0.0000528	< 0.000056	< 0.0000534	< 0.0000515	< 0.0000565
Benzo(a)anthracene	NRO	< 0.000051	< 0.0000528	< 0.000056	< 0.0000534	< 0.0000515	< 0.0000565
Benzo(a)pyrene	0.00002	< 0.000051	< 0.0000528	0.000086J	< 0.0000534	< 0.0000515	< 0.0000565
Benzo(b)fluoranthene	0.00002	< 0.000051	< 0.0000528	< 0.000056	< 0.0000534	< 0.0000515	< 0.0000565
Benzo(g,h,i)perylene	NRO	< 0.000051	< 0.0000528	0.000065J	< 0.0000534	< 0.0000515	< 0.0000565
Benzo(k)fluoranthene	NRO	< 0.000051	< 0.0000528	< 0.000056	< 0.0000534	< 0.0000515	< 0.0000565
Chrysene	0.00002	< 0.000051	< 0.0000528	0.000058J	< 0.0000534	< 0.0000515	< 0.0000565
Dibenzo(a,h)anthracene	NRO	< 0.000051	< 0.0000528	< 0.000056	< 0.0000534	< 0.0000515	< 0.0000565
Fluoranthene	0.080	< 0.000051	< 0.0000528	0.000121	< 0.0000534	< 0.0000515	< 0.0000565
Fluorene	0.080	< 0.000051	< 0.0000528	< 0.000056	< 0.0000534	< 0.0000515	< 0.0000565
Indeno(1,2,3-cd)pyrene	NRO	< 0.000051	< 0.0000528	< 0.000056	< 0.0000534	< 0.0000515	< 0.0000565
Naphthalene	0.010	< 0.000051	< 0.0000528	< 0.000056	< 0.0000534	< 0.0000515	< 0.0000565
Phenanthrene	NRO	< 0.000051	< 0.0000528	0.0001J	0.00011	< 0.0000515	< 0.0000565
Pyrene	0.050	< 0.000051	< 0.0000528	0.00011J	< 0.0000534	< 0.0000515	< 0.0000565

*Wisconsin Administrative Code N.R.140

All results in parts per million (**mg/L**) unless noted otherwise.

NRO = No Remediation Objective